

Sheldon Regional Airport



Pavement Management Report

PREPARED BY

Applied Pavement Technology, Inc.
115 West Main Street, Suite 400
Urbana, Illinois 61801
(217) 398-3977
www.appliedpavement.com

JULY 2023



The preparation of this document was financed in part through an Airport Improvement Program grant from the Federal Aviation Administration (Project Number 3-19-0000-030-2022) as provided under Section 505 of the Airport and Airway Improvement Act of 1982, as amended. The contents do not necessarily reflect the DOT's official views or the policy of the FAA. Acceptance of this report by the FAA does not in any way constitute a commitment on the part of the United States to participate in any development depicted therein nor does it indicate the proposed development is environmentally acceptable in accordance with appropriate public laws.

SHELDON REGIONAL AIRPORT PAVEMENT MANAGEMENT REPORT

Prepared For:



Iowa Department of Transportation
Modal Transportation Bureau
800 Lincoln Way
Ames, Iowa 50010
515-239-1691
<https://iowadot.gov/aviation/>

Prepared By:



Applied Pavement Technology, Inc.
115 West Main Street, Suite 400
Urbana, Illinois 61801
217-398-3977
<https://www.appliedpavement.com>

In Association With:



Robinson Engineering Company
Consulting Engineers
819 Second Street NE
Independence, Iowa 50644
319-334-7211

TABLE OF CONTENTS

INTRODUCTION	1
PAVEMENT INVENTORY	3
PAVEMENT EVALUATION.....	6
Pavement Evaluation Procedure	6
Pavement Evaluation Results.....	7
Inspection Comments.....	13
Runway	13
Taxiways.....	13
Apron	13
T-Hangar	13
PAVEMENT MAINTENANCE AND REHABILITATION PROGRAM	15
Analysis Parameters.....	15
Critical PCIs.....	15
Localized Preventive Maintenance Policies and Unit Costs.....	15
Major Rehabilitation Unit Costs	15
Budget and Inflation Rate	15
Analysis Approach.....	15
Analysis Results.....	16
General Maintenance Recommendations	17
FAA Requirements (Public Law 103-305).....	17
FAA Advisory Circular 150/5830-7B, Appendix A. Pavement Management Program (PMP)	18
SUMMARY	23

LIST OF FIGURES

Figure 1. Pavement condition versus cost of repair.....	1
Figure 2. Pavement area by branch use at Sheldon Regional Airport.	4
Figure 3. Sheldon Regional Airport network definition map.	5
Figure 4. Visual representation of PCI scale on typical pavement surfaces.	6
Figure 5. PCI versus repair type.	7
Figure 6. Pavement area by PCI range at Sheldon Regional Airport.	8
Figure 7. Area-weighted PCI by branch use at Sheldon Regional Airport.....	9
Figure 8. Sheldon Regional Airport PCI map.....	10

LIST OF TABLES

Table 1. 2022 pavement evaluation results.....	11
Table 2. 5-year M&R program under an unlimited funding analysis scenario.	16
Table 3. Pavement inspection report.....	20

APPENDIXES

Appendix A. Cause of Distress Tables A-1
Appendix B. Inspection PhotographsB-1
Appendix C. Inspection Report.....C-1
Appendix D. Work History Report..... D-1
Appendix E. Localized Preventive Maintenance Policies and Unit Cost TablesE-1
Appendix F. Year 2023 Localized Preventive Maintenance Details F-1


INTRODUCTION

Applied Pavement Technology, Inc. (APTech), with assistance from Robinson Engineering Company Consulting Engineers (Robinson), updated the Airport Pavement Management System (APMS) for the Iowa Department of Transportation, Modal Transportation Bureau (Iowa DOT). The APMS provides a means to monitor the condition of the pavements within the state of Iowa and to proactively plan for their preservation.

As part of this project, pavement conditions at Sheldon Regional Airport were assessed in November 2022 using the Pavement Condition Index (PCI) procedure. During a PCI inspection, the types, severities, and amounts of distress present in a pavement are quantified. This information is then used to develop a composite index that represents the overall condition of the pavement in numerical terms, ranging from 0 (failed) to 100 (excellent). The PCI provides an overall measure of condition and an indication of the level of work that will be required to maintain or repair a pavement. The distress information also provides insight into what is causing the pavement to deteriorate, which is the first step in selecting the appropriate repair action to correct the problem.

Programmed into an APMS, PCI information is used to determine when preventive maintenance actions (such as crack or joint sealing) are advisable and to identify the most cost-effective time to perform major rehabilitation (such as an overlay or whitetopping). Delaying maintenance and rehabilitation (M&R) until a pavement structure has seriously degraded can cost many times more than if M&R was applied earlier in a pavement's life cycle, as shown in Figure 1. From a safety perspective, pavement distresses, such as cracks and loose debris, may pose risks in terms of the potential for aircraft tire damage and the ability of a pilot to safely control aircraft.

Figure 1. Pavement condition versus cost of repair.

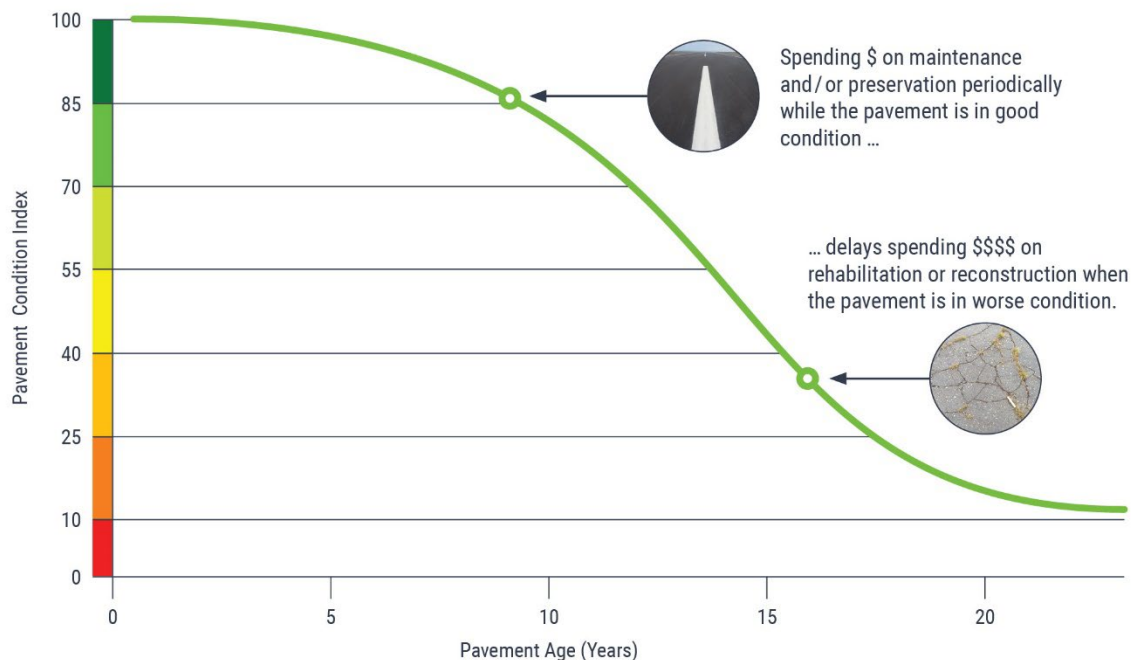

The pavement evaluation results for Sheldon Regional Airport are presented within this report and can be used by Sheldon Regional Airport, the Iowa DOT, and the Federal Aviation Administration (FAA) to identify, prioritize, and schedule pavement M&R actions at the airport. In addition to this report, the web-based interactive pavement data visualization tool IDEA, containing the information collected during this project, was updated and may be accessed from the [Iowa DOT's website](#) or directly ([Iowa APMS IDEA](#)).

PAVEMENT INVENTORY

The project began with a review of the existing inventory information pertaining to the pavements at Sheldon Regional Airport. The date of original construction, along with the date of any subsequent rehabilitation; the location of completed work; and the type of work undertaken were gathered. The information was used to update the pavement management database and associated maps, as necessary, to account for pavement-related work that had been undertaken since the last time the airport was evaluated in 2019.

The pavement network at Sheldon Regional Airport was then divided into branches, sections, and sample units. A branch is a single entity that serves a distinct function. For example, a runway is considered a branch because it serves a single function (allowing aircraft to take off and land). Taxiways, aprons, and T-hangars are also separate branches.

Each branch was further divided into sections. Traditionally, sections are defined as parts of the branch that share common attributes, such as cross-section, date of last construction, traffic level, and performance. Using this approach, if a runway was built in 1968 and then extended in 1984, it would contain two separate sections.

To estimate the overall condition of a pavement section, each section was subdivided into sample units. Portions of these sample units were evaluated during the pavement inspection, and the collected information was extrapolated to predict the overall section condition and quantities of distress.

Approximately 450,300 square feet of pavement were evaluated at Sheldon Regional Airport, as illustrated in Figure 2. This figure also shows the area-weighted age, in years, of the pavements at the time of the inspection. Figure 3 provides a map that details how the pavement network was divided into management units and identifies the sample units that were evaluated during the pavement inspection at Sheldon Regional Airport.

Figure 2. Pavement area by branch use at Sheldon Regional Airport.


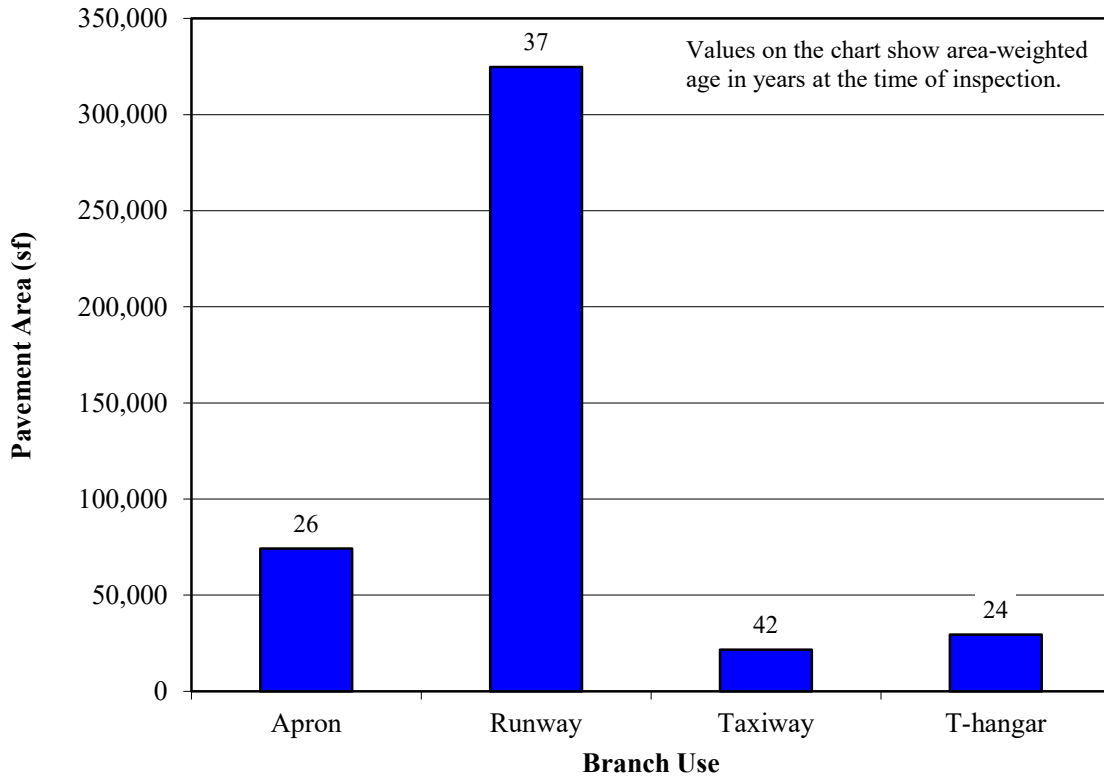


FIGURE 3. NETWORK DEFINITION MAP.

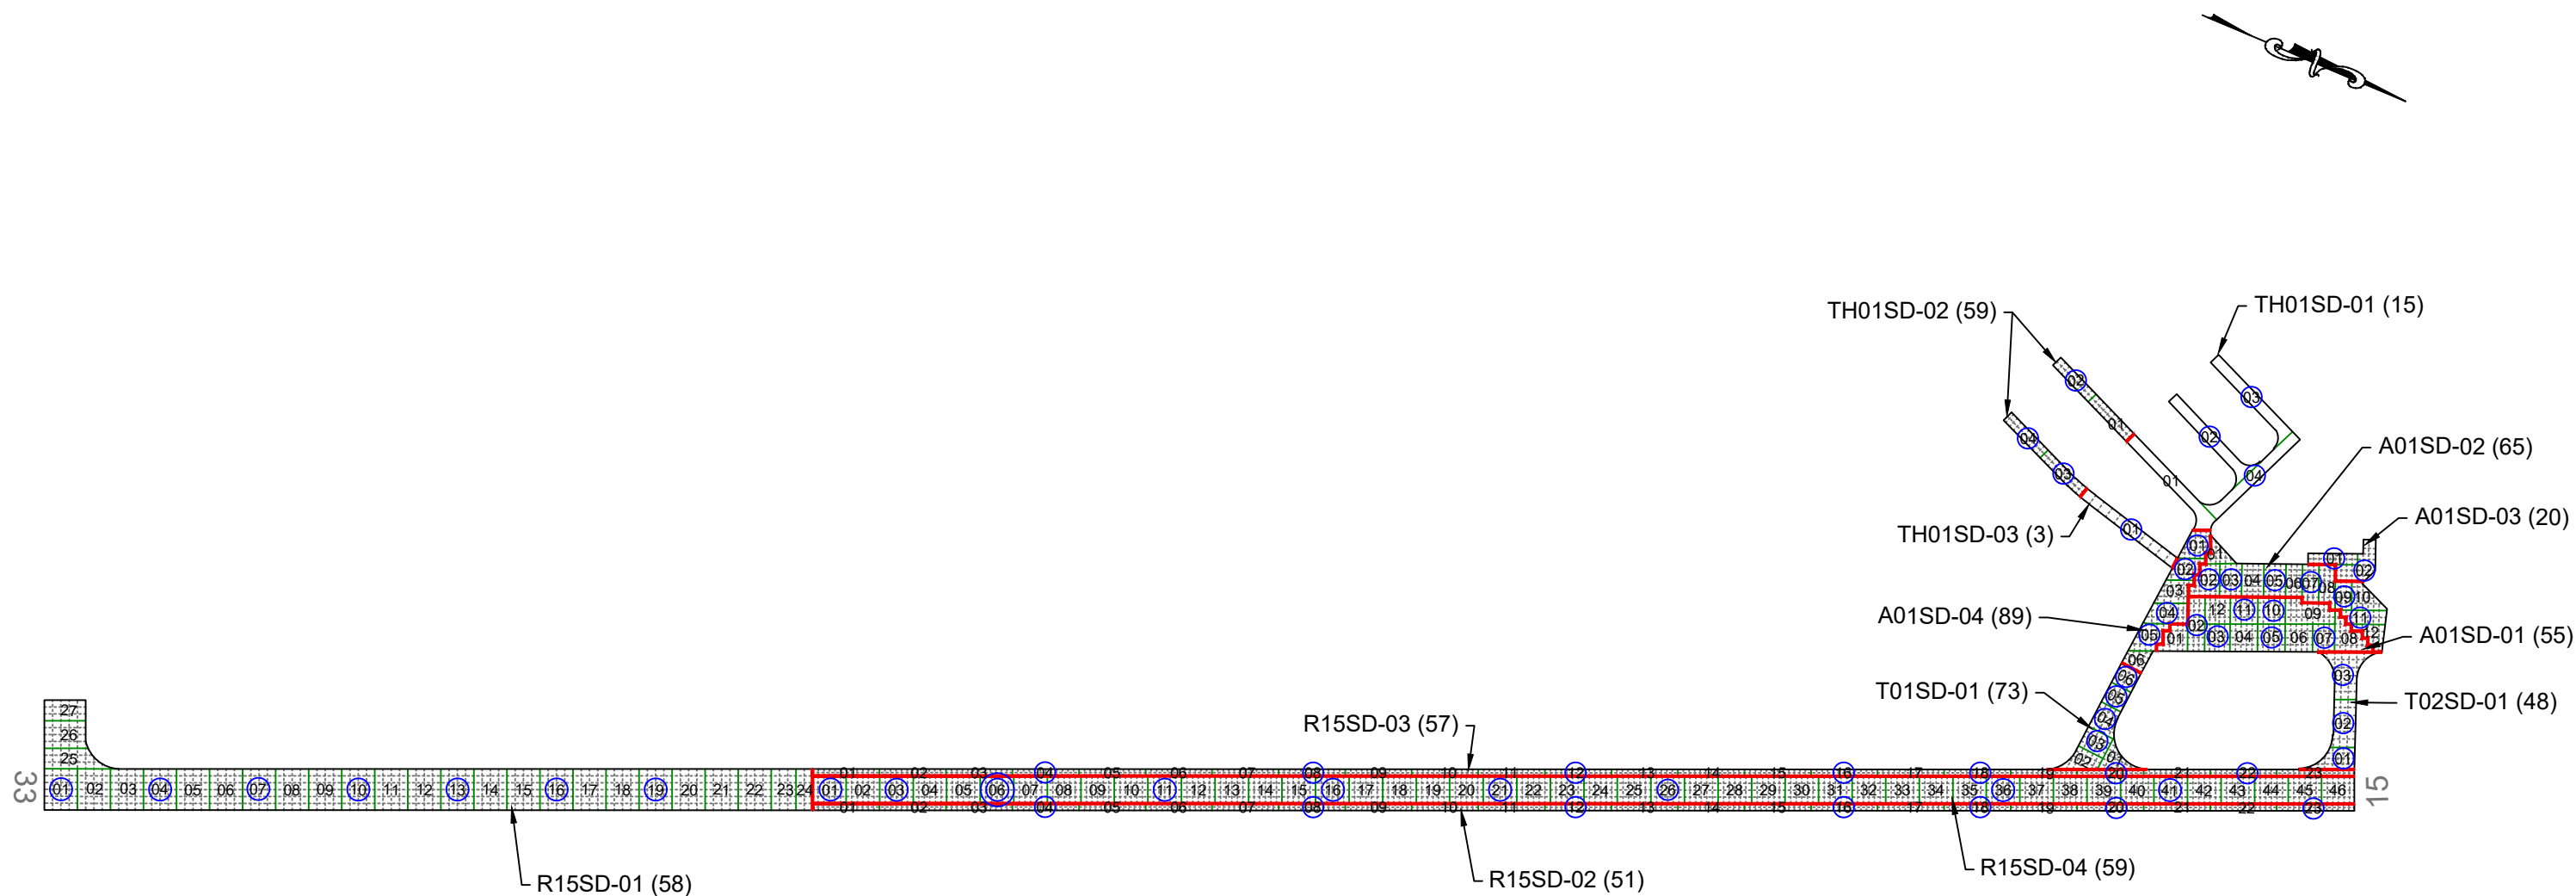

NETWORK DEFINITION LEGEND

	BRANCH IDENTIFIER
	SECTION IDENTIFIER
	PCI VALUE
	SECTION BREAK LINE
	SAMPLE UNIT BREAK LINE
	SLAB JOINT
	SAMPLE UNIT NUMBER
	SAMPLE UNIT INSPECTED
	ADDITIONAL SAMPLE UNIT

applied pavement TECHNOLOGY
 115 W. Main Street, Suite 400
 Urbana, IL 61801
 Tel: 217-398-3977
 Fax: 217-398-4027

AGENCY: Iowa Department of Transportation
 Modal Transportation Bureau

LOCATION: Sheldon Regional Airport
 Sheldon, Iowa

PAGE TITLE: Network Definition Map

PROJECT DATE: OCT. 2022	CREATION DATE: OCT. 2022	PROJECT MANAGER: LJR	JOB NUMBER: 2021-125-AM01
DRAWING SCALE: 1"=300'	LAST MODIFIED DATE: JAN. 2023	REVISED BY: DMS	DRAWN BY: KEW
FILENAME: Sheldon.dwg	LAYOUT NAME/NUMBER: NET. DEF.	PAGE NUMBER: 5	

PAVEMENT EVALUATION

Pavement Evaluation Procedure

APTech inspected the pavements at Sheldon Regional Airport using the PCI procedure described in:

- FAA Advisory Circular 150/5380-6C, [Guidelines and Procedures for Maintenance of Airport Pavements](#).
- FAA Advisory Circular 150/5380-7B, [Airport Pavement Management Program \(PMP\)](#).
- ASTM D5340-20, *Standard Test Method for Airport Pavement Condition Index Surveys*.

The PCI provides a numerical indication of overall pavement condition, as illustrated in Figure 4. The types and amounts of deterioration are used to calculate the PCI of the section. The PCI ranges from a value of 0, which represents a pavement in a failed condition, to a value of 100, which represents a pavement in excellent condition. It is important to note that factors other than overall PCI need to be considered when identifying the appropriate type of repair, including types of distress present and rate of deterioration. Also, since the PCI does not assess the structural integrity or capacity of the pavement structure, further testing may be needed to validate and refine the treatment strategy.

Figure 4. Visual representation of PCI scale on typical pavement surfaces.



Note: Photographs shown are not specific to Sheldon Regional Airport.

Generally, pavements with relatively high PCIs that are not exhibiting significant load-related distress will benefit from preventive maintenance actions, such as crack sealing or joint resealing. As the PCI drops, the pavements may require major rehabilitation, such as an overlay or whitetopping. In some situations where the PCI has dropped low enough, reconstruction may be the only viable alternative due to the substantial damage to the pavement structure. Figure 5 illustrates how the appropriate repair type varies with the PCI of a pavement section and provides the corresponding colors used for the maps and charts in this report for each range of PCIs.

Figure 5. PCI versus repair type.

PCI Range	Repair
86-100	Preventive Maintenance
71-85	
56-70	
41-55	Major Rehabilitation
26-40	Reconstruction
11-25	
0-10	

The types of distress identified during the PCI inspection provide insight into the cause of pavement deterioration, which is useful when selecting M&R strategies. Understanding the cause of distress helps in selecting a rehabilitation alternative that corrects the cause and thus eliminates or delays its recurrence. PCI distress types are characterized as:

- Load-related—These distress types are defined as being caused by aircraft or vehicular traffic and may indicate a structural deficiency. Examples of load-related distress include alligator cracking on asphalt-surfaced pavements and corner breaks on portland cement concrete (PCC) pavements.
- Climate/durability-related—These distress types often signify the presence of aged or environmentally susceptible (or both) material and include durability-related issues. Examples of climate/durability-related distress include weathering on asphalt-surfaced pavements, which is climate-related, and durability cracking on PCC pavements, which is durability-related.
- Other—Distress types that fall into this category cannot be attributed solely to load or climate/durability. Examples of this type of distress include depressions on asphalt-surfaced pavements and shrinkage cracking on PCC pavements.

Appendix A identifies the distress types considered during a PCI inspection and describes the likely cause of each distress type. It should be noted that a PCI is based on visual signs of pavement deterioration and does not provide a measure of structural capacity.

Pavement Evaluation Results

The pavements at Sheldon Regional Airport were inspected in November 2022. The 2022 area-weighted condition of Sheldon Regional Airport is 56, with conditions ranging from 3 to 89 (on a scale of 0 [failed] to 100 [excellent]). During the previous pavement inspection in 2019, the area-weighted PCI of the airport was 92.

Figure 6 summarizes the overall condition of the pavements at Sheldon Regional Airport, and Figure 7 presents area-weighted condition (average PCI adjusted to account for the relative size of the pavement sections) by branch use. Figure 8 is a map that displays the condition of the evaluated pavements. Table 1 summarizes the results of the pavement evaluation. Appendix B presents photographs taken during the PCI inspection, and Appendix C contains detailed information on the distress types observed during the visual survey. Appendix D includes detailed work history information that was collected during the record review process.

Figure 6. Pavement area by PCI range at Sheldon Regional Airport.

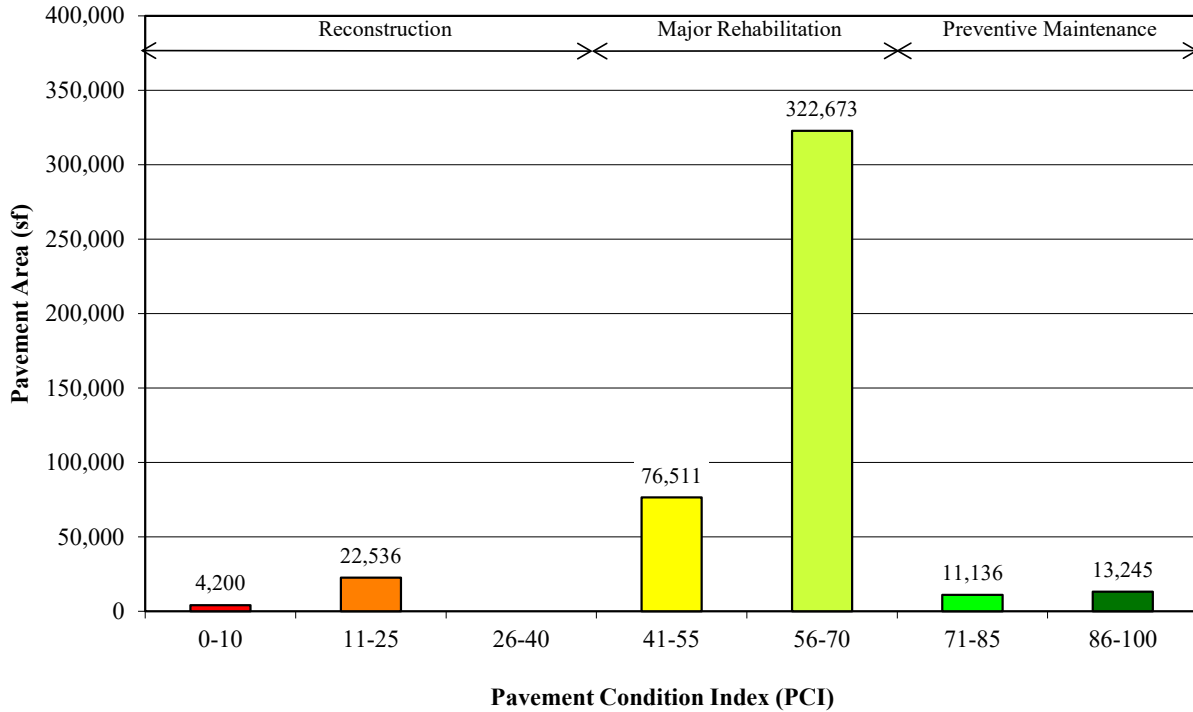


Figure 7. Area-weighted PCI by branch use at Sheldon Regional Airport.
(Values on chart are area-weighted)


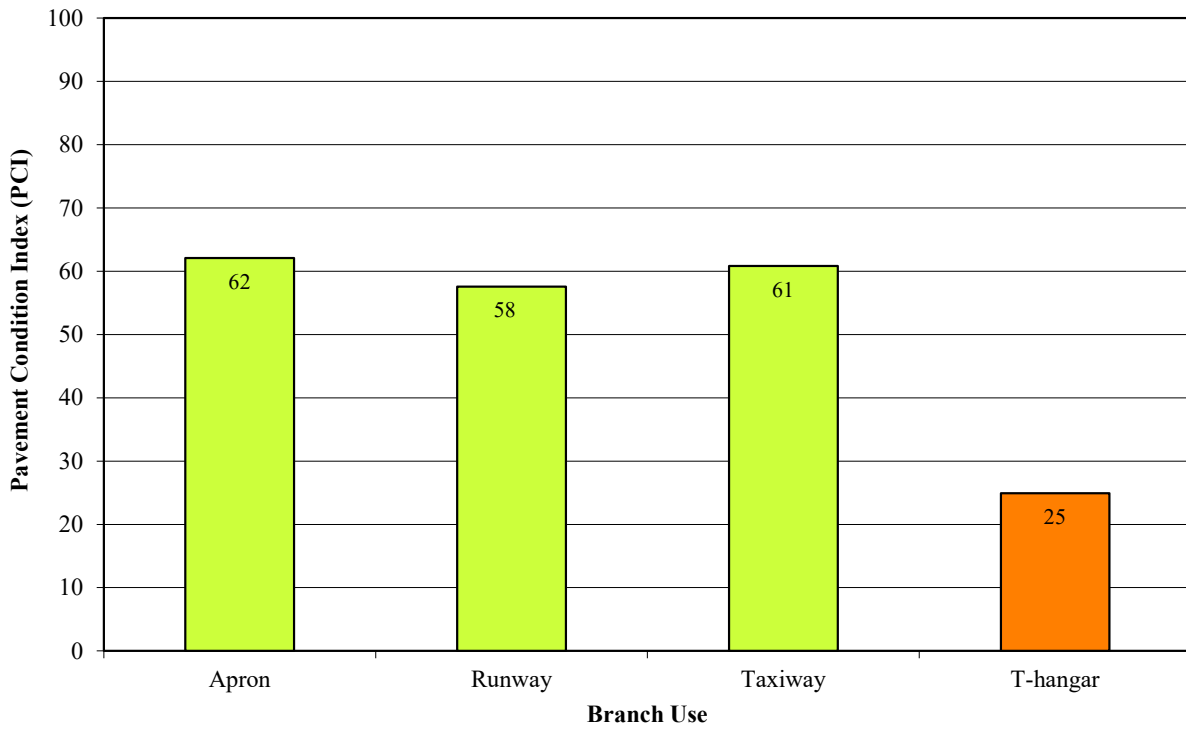


FIGURE 8. PCI MAP.

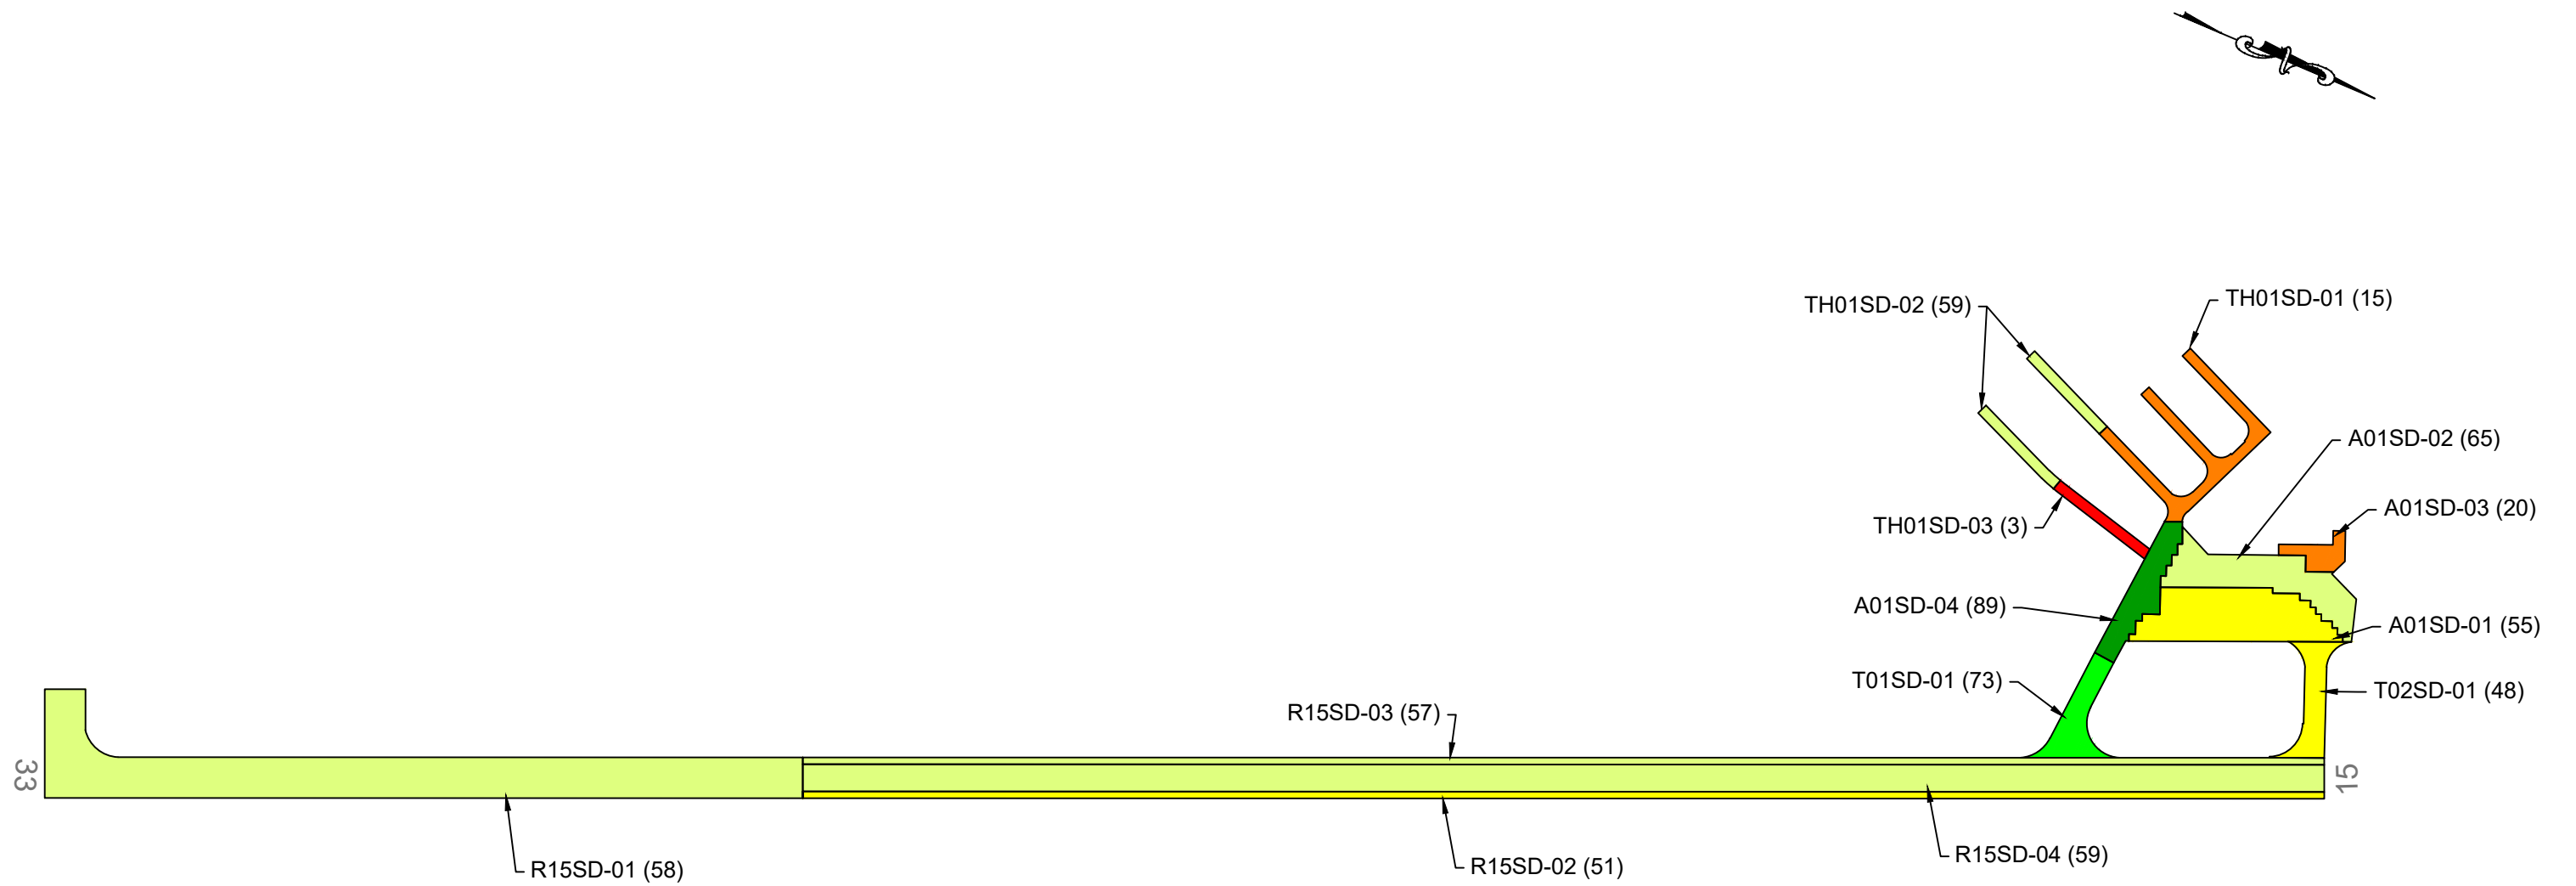

LEGEND

- BRANCH IDENTIFIER
- SECTION IDENTIFIER
- PCI VALUE
- SECTION BREAK LINE

PAVEMENT CONDITION INDEX

PCI
86-100
71-85
56-70
41-55
26-40
11-25
0-10

		115 W. Main Street, Suite 400 Urbana, IL 61801 Tel: 217-398-3977 Fax: 217-398-4027	
Robinson Engineering Company Consulting Engineers		819 Second Street NE Independence, Iowa 50644 319-334-7211	
AGENCY: Iowa Department of Transportation Modal Transportation Bureau			
LOCATION: Sheldon Regional Airport Sheldon, Iowa			
PAGE TITLE: 2022 Pavement Condition Index Map			
PROJECT DATE: OCT. 2022	CREATION DATE: OCT. 2022	PROJECT MANAGER: LJR	JOB NUMBER: 2021-125-AM01
DRAWING SCALE: 1"=300'	LAST MODIFIED DATE: MAR. 2023	REVISED BY: DMS	DRAWN BY: KEW
FILENAME: Sheldon.dwg		LAYOUT NAME/NUMBER: PCI	PAGE NUMBER: 10

Table 1. 2022 pavement evaluation results.

Branch	Section	Surface Type	Section Area (sf)	LCD	2022 PCI	% Distress Due to Load	% Distress Due to Climate/Durability	% Distress Due to Other	Type of Distress
A01SD	01	PCC	30,939	6/1/1980	55	60	17	23	Corner Break, Corner Spalling, Faulting, Joint Spalling, Joint Seal Damage, LTD Cracking, Shattered Slab, Small Patch
A01SD	02	PCC	25,082	6/1/2004	65	61	31	8	Corner Break, Corner Spalling, Faulting, Joint Spalling, Joint Seal Damage, LTD Cracking, Shattered Slab, Small Patch
A01SD	03	PCC	4,996	6/3/2009	20	79	10	11	Corner Break, Faulting, Joint Seal Damage, LTD Cracking, Shattered Slab
A01SD	04	PCC	13,245	6/3/2013	89	34	49	17	Corner Break, Corner Spalling, Joint Spalling, Joint Seal Damage, LTD Cracking, Shrinkage Cracking
R15SD	01	PCC	114,791	6/1/1980	58	27	14	59	Corner Break, Corner Spalling, Joint Spalling, Joint Seal Damage, Large Patch, LTD Cracking, Small Patch
R15SD	02	PCC	35,000	6/1/1980	51	6	15	79	Corner Break, Corner Spalling, Faulting, Joint Spalling, Joint Seal Damage, Large Patch, LTD Cracking, Small Patch
R15SD	03	PCC	35,000	6/1/1980	57	15	24	61	Corner Spalling, Faulting, Joint Spalling, Joint Seal Damage, LTD Cracking, Small Patch
R15SD	04	PCC	140,000	4/22/1991	59	43	20	37	Corner Break, Corner Spalling, Durability Cracking, Faulting, Joint Spalling, Joint Seal Damage, Large Patch, LTD Cracking, Shattered Slab, Shrinkage Cracking, Small Patch

Table 1. 2022 pavement evaluation results (continued).

Branch	Section	Surface Type	Section Area (sf)	LCD	2022 PCI	% Distress Due to Load	% Distress Due to Climate/Durability	% Distress Due to Other	Type of Distress
T01SD	01	PCC	11,136	6/1/1980	73	41	43	16	Corner Break, Corner Spalling, Joint Spalling, Joint Seal Damage, Large Patch, LTD Cracking
T02SD	01	PCC	10,572	6/1/1980	48	63	14	23	Corner Break, Corner Spalling, Faulting, Joint Spalling, Joint Seal Damage, LTD Cracking, Shattered Slab
TH01SD	01	APC	17,540	1/1/1998	15	26	68	6	Alligator Cracking, Joint Reflection Cracking, L&T Cracking, Patching, Swelling, Weathering
TH01SD	02	PCC	7,800	1/1/2000	59	58	21	21	Corner Break, Corner Spalling, Faulting, Joint Spalling, Joint Seal Damage, LTD Cracking, Shrinkage Cracking
TH01SD	03	PCC	4,200	6/1/1994	3	74	8	18	Faulting, Joint Seal Damage, LTD Cracking, Shattered Slab

Table Notes:

- See Figure 3 for the location of the branch and section.
- Surface Type: AC = asphalt cement concrete; AAC = asphalt overlay on AC; PCC = portland cement concrete; APC = asphalt overlay on PCC.
- LCD = last construction date.
- Distress due to load includes distress types that are attributed to a structural deficiency in the pavement, such as alligator cracking or rutting on asphalt-surfaced pavements or shattered slabs on PCC pavements.
- Distress due to climate or durability includes distress types that are attributed to either the aging of the pavement and the effects of the environment (such as weathering, raveling, or block cracking on asphalt-surfaced pavements) or to a materials-related problem (such as durability cracking or alkali-silica reaction [ASR] on PCC pavements). If materials-related distresses were recorded during the inspection, further laboratory testing is required to definitively determine the type present.
- Distress due to other refers to distress types that are not attributed to one factor but rather may be caused by a combination of factors.
- Distress types are defined by ASTM D5340-20. L&T Cracking = Longitudinal and Transverse Cracking; LTD Cracking = Longitudinal, Transverse, and Diagonal Cracking; ASR = Alkali-Silica Reaction.

Inspection Comments

Sheldon Regional Airport was inspected on November 20, 2022. There were thirteen pavement sections defined during the inspection.

Runway

Runway 15/33 was defined by four sections. Section 01 contained areas of low- and medium-severity small patching; joint seal damage; corner break; and longitudinal, transverse, and diagonal (LTD) cracking. It also had areas of all severities of corner spalling and joint spalling as well as low-severity large patching. Areas of medium-severity LTD cracking and corner break, all severities of corner spalling and joint spalling, low- and medium-severity faulting, high-severity joint seal damage, and low-severity large patching and small patching were observed in Section 02. Areas of low- and medium-severity LTD cracking, corner spalling, and faulting; medium- and high-severity joint seal damage; low-severity small patching; and medium-severity joint spalling were recorded in Section 03. Medium- and high-severity corner break; all severities of LTD cracking, corner spalling, and joint spalling; low-severity faulting and durability cracking; low- and medium-severity small patching, joint seal damage, and large patching; medium-severity shattered slab; and shrinkage cracking were identified in Section 04. An atypical area of medium- and high-severity durability cracking was observed and recorded as an additional sample unit in accordance with ASTM D5340-20.

Taxiways

Taxiway 01 consisted of one section. Section 01 contained areas of medium- and high-severity joint seal damage and low- and medium-severity joint spalling, large patching, LTD cracking, corner break, and corner spalling.

Taxiway 02 contained one section. Medium-severity corner break, joint spalling, and shattered slab; medium- and high-severity corner spalling and LTD cracking; low-severity faulting; and high-severity joint seal damage was observed in Section 01.

Apron

The apron area was defined by four sections. Section 01 contained medium-severity shattered slab, joint spalling, and corner break; all severities of LTD cracking and corner spalling; low-severity faulting; high-severity joint seal damage; and low- and medium-severity small patching. Low- and medium-severity corner break, LTD cracking, and corner spalling; low-severity small patching and faulting; medium- and high-severity joint seal damage; and medium-severity joint spalling and shattered slab were recorded in Section 02. Section 03 was in poor condition with high-severity joint seal damage and low- and medium-severity corner break, faulting, LTD cracking, and shattered slab noted at the time of inspection. Section 04 contained areas of low- and medium-severity corner break and joint seal damage, medium-severity LTD cracking and corner spalling, low-severity joint spalling, and shrinkage cracking.

T-Hangar

The T-hangar area consisted of three sections. Section 01 was in poor condition with medium-severity alligator cracking and joint reflection cracking, low-severity L&T cracking, low- and medium-severity patching and swelling, and high-severity weathering observed during the inspection. The low-severity L&T cracking in Section 01 was unsealed, and the medium-severity joint reflection cracking was due to either the development of secondary cracking or unsealed crack widths that exceeded $\frac{1}{4}$ in. Section 02 contained areas of medium-severity joint spalling

and corner spalling, low- and medium-severity corner break and LTD cracking, shrinkage cracking, low-severity faulting, and high-severity joint seal damage. Section 03 was in poor condition with low-severity faulting, high-severity joint seal damage, medium-severity LTD cracking, and medium- and high-severity shattered slab noted at the time of inspection.

PAVEMENT MAINTENANCE AND REHABILITATION PROGRAM

Using the information collected during the pavement inspection, the PAVER pavement management software was used to develop a 5-year M&R program for Sheldon Regional Airport. In addition, a 1-year plan for localized preventive maintenance (such as crack sealing and patching) was prepared.

Analysis Parameters

Critical PCIs

PAVER uses critical PCIs to determine whether localized preventive maintenance or major rehabilitation is the appropriate repair action. Above the critical PCI, localized preventive maintenance activities are recommended. Below the critical PCI, major rehabilitation actions, such as an overlay or reconstruction, are recommended. The Iowa DOT set the critical PCIs at 65 for runways, 60 for taxiways, and 55 for aprons and T-hangars.

Localized Preventive Maintenance Policies and Unit Costs

Localized preventive maintenance policies were developed for asphalt-surfaced and PCC pavements. These policies, shown in Appendix E, identify the localized preventive maintenance actions that the Iowa DOT considered appropriate to correct the different distress types and severities. The Iowa DOT provided unit costs for each of the localized preventive maintenance actions included in these policies, and these costs are detailed in Appendix E. Please note that this information is of a general nature for the entire state. The localized preventive maintenance policies and unit costs may require adjustment to reflect specific conditions at Sheldon Regional Airport.

Major Rehabilitation Unit Costs

PAVER estimates the cost of major rehabilitation based on the predicted PCI of the pavement section. The Iowa DOT provided the costs for major rehabilitation, and they are presented in Appendix E. If major rehabilitation is recommended in the 5-year program, further engineering investigation will be needed to identify the most appropriate rehabilitation action and to estimate the cost of such work more accurately.

Budget and Inflation Rate

An unlimited budget with a start date of July 1, 2023 and an inflation rate of 4.0 percent was used during the analysis.

Analysis Approach

The 5-year M&R program was prepared with the goal of maintaining the pavements above established critical PCIs. During this analysis, major rehabilitation was recommended for pavements in the year they dropped below their critical PCI. For the first year (2023) of the analysis only, a localized preventive maintenance plan was developed for those pavement sections that were above their critical PCI. If major rehabilitation was triggered for a section in 2024 or 2025, then localized preventive maintenance was not recommended for 2023. While localized preventive maintenance should be an annual undertaking at Sheldon Regional Airport, it is not possible to accurately predict the propagation of cracking and other distress types. Therefore, the airport should budget for maintenance every year and can use the 2023 localized

preventive maintenance plan as a baseline for that work. As the pavements age, it can be assumed that the amount of localized preventive maintenance required will increase.

Analysis Results

A summary of the M&R program for Sheldon Regional Airport is presented in Table 2. Detailed information on the recommended localized preventive maintenance plan for 2023 is provided in Appendix F.

Table 2. 5-year M&R program under an unlimited funding analysis scenario.

Year	Branch	Section	Surface Type	Type of Repair	Estimated Cost
2023	A01SD	01	PCC	Major Rehabilitation	\$264,524
2023	A01SD	02	PCC	Major Rehabilitation	\$214,448
2023	A01SD	03	PCC	Major Rehabilitation	\$90,327
2023	A01SD	04	PCC	Preventive Maintenance	\$2,738
2023	R15SD	01	PCC	Major Rehabilitation	\$981,448
2023	R15SD	02	PCC	Major Rehabilitation	\$302,247
2023	R15SD	03	PCC	Major Rehabilitation	\$299,245
2023	R15SD	04	PCC	Major Rehabilitation	\$1,196,981
2023	T01SD	01	PCC	Preventive Maintenance	\$8,853
2023	T02SD	01	PCC	Major Rehabilitation	\$124,040
2023	TH01SD	01	APC	Major Rehabilitation	\$189,790
2023	TH01SD	02	PCC	Preventive Maintenance	\$6,975
2023	TH01SD	03	PCC	Major Rehabilitation	\$75,935
2027	TH01SD	02	PCC	Major Rehabilitation	\$78,018

Total Estimated Cost: \$3,836,000

Table Notes:

1. See Figure 3 for the location of the branch and section.
2. Surface Type: AC = asphalt cement concrete; AAC = asphalt overlay on AC; PCC = portland cement concrete; APC = asphalt overlay on PCC.
3. Type of Repair: Major Rehabilitation such as pavement reconstruction or an overlay; Localized Preventive Maintenance such as crack sealing or patching.
4. The estimated costs provided are of a general nature for the entire state and may require adjustment to reflect specific conditions at Sheldon Regional Airport.

The recommendations made in this report are based on a broad network-level analysis and meant to provide Sheldon Regional Airport with an indication of the type of pavement-related work required during the next 5 years. Further engineering investigation may be necessary to identify which repair action is most appropriate. In addition, the cost estimates provided are based on overall unit costs for the entire state, and Sheldon Regional Airport should adjust the plan to reflect local costs.

Because an unlimited budget was used in the analysis, it is possible that the pavement repair program may need to be adjusted to consider economic or operational constraints. The identification of a project need does not necessarily mean that state or federal funding will be

available in the year it is indicated. It is important to remember that regardless of the recommendations presented within this report, Sheldon Regional Airport is responsible for repairing pavements where existing conditions pose a hazard to safe operations.

General Maintenance Recommendations

In addition to the specific maintenance actions presented in Appendix F, it is recommended that the following strategies be considered for prolonging pavement life:

1. Regularly inspect all safety areas of the airport and document all inspection activity. A sample form that can be used to perform these inspections is provided in Table 3 of this report.
2. Provide a method of tracking all maintenance activities that occur as a result of inspections. These need to be reported to the FAA and the Iowa DOT. This information is used to update the APMS records and is required to remain in compliance with Public Law 103-305 (see the next section of this report for further information on this law).
3. Conduct an aggressive campaign against weed growth through timely herbicide applications and mowing programs of the safety areas. Vegetation growth in pavement cracks is destructive and significantly increases the rate of pavement deterioration.
4. Implement a periodic crack and joint sealing program. Keeping water and debris out of the pavement system by sealing cracks and joints is a proven and cost-effective method of extending the life of the pavement system.
5. Ensure that dirt does not build up along the edges of the pavements. This can create a “bathtub” effect, reducing the ability of water to drain away from the pavement system.
6. Closely monitor the movement of heavy equipment (particularly farming, construction, and fueling equipment) to make sure it is only operating on pavements that are designed to accommodate heavy loads. Failure to restrict heavy equipment to appropriate areas may result in the premature failure of airport pavements.

FAA Requirements (Public Law 103-305)

Because Sheldon Regional Airport is in the National Plan of Integrated Airport Systems (NPIAS), the airport sponsor is required to keep the airport in a viable operating condition. This includes maintaining airport pavements in accordance with Public Law 103-305. Public Law 103-305 states that after January 1, 1995, NPIAS airport sponsors must provide assurances or certifications that an airport has implemented an effective airport pavement maintenance management system (PMMS) before the airport will be considered for federal funding of pavement replacement or reconstruction projects. To be in full compliance with the federal law, the PMMS must include the following components at minimum: pavement inventory, pavement inspections, record keeping, information retrieval, and program funding.

This report serves as a complete pavement inventory and detailed inspection. To remain in compliance with the law, Sheldon Regional Airport will also need to undertake monthly drive-by inspections of pavement conditions and track pavement-related maintenance activities.

FAA Advisory Circular 150/5380-7B provides detailed guidance pertaining to the requirements for an acceptable pavement management program (PMP). Appendix A of the FAA Advisory Circular 150/5380-7B outlines what needs to be included in a PMP to remain in compliance with this law and Grant Assurance #11. The following is a copy of this Appendix, along with

instructions for supplementing this report so that all requirements are met. Note that the italicized words are direct quotations from the FAA Advisory Circular.

FAA Advisory Circular 150/5830-7B, Appendix A. Pavement Management Program (PMP)

A-1.0. An effective PMP specifies the procedures to follow to assure that proper preventative and remedial pavement maintenance is performed. The program should identify funding or anticipated funding and other resources available to provide remedial and preventive maintenance activities. An airport sponsor may use any format deemed appropriate, but the program needs to, as a minimum, include the following:

A-1.1. Pavement Inventory. *The following must be depicted:*

- a. *Identification of all runways, taxiways, and aprons with pavement broken down into sections each having similar properties.*

The network definition map provided in Figure 3 of this report shows the location of all runways, taxiways, aprons, and T-hangars at Sheldon Regional Airport. If any new pavements are constructed or any pavement areas are permanently closed, this map must be updated. Project plans should be submitted to the Iowa DOT after project completion.

- b. *Dimensions of pavement sections.*

The dimensions of all runways, taxiways, aprons, and T-hangars are stored in the PAVER database. Appendix C provides information on length, width, and area. In addition, the network definition map provided in Figure 3 is drawn to scale. Any changes to pavement dimensions must be recorded.

- c. *Type of pavement surface.*

The type of pavement for each section at Sheldon Regional Airport is listed in Table 1 of this report and is also stored in the PAVER database. Any changes to the pavement type (through an overlay or reconstruction) must be recorded.

- d. *Year of construction and/or most recent major rehabilitation.*

Dates for pavement construction, rehabilitation, or reconstruction must be recorded. The current pavement history for Sheldon Regional Airport is provided in Appendix D of this report.

- e. *Whether AIP [Airport Improvement Program] or PFC [Passenger Facility Charge] funds were used to construct, reconstruct, or repair the pavement.*

Funding sources for all pavement projects should be recorded.

A-1.2. PMP Pavement Inspection Schedule. *Airports must perform a detailed inspection of airfield pavements at least once a year for the PMP. If a pavement condition index (PCI) survey is performed, as set forth in ASTM D5340, Standard Test Method for Airport Pavement Condition Index Surveys, the frequency of the detailed inspection by PCI surveys may be extended to three years. Less comprehensive routine daily, weekly, and monthly maintenance inspections required for operations should be addressed.*

This report consists of a detailed inspection that will extend the inspection period to 3 years. It is the airport sponsor's responsibility to perform monthly drive-by inspections. A sample pavement inspection report form is provided in Table 3 of this report.

A-1.3. Record Keeping. *The airport must record and keep on file complete information about all detailed inspections and maintenance performed until the pavement system is replaced. The types of distress, their locations, and remedial action, scheduled or performed, must be documented. The minimum information recorded includes:*

- a. *Inspection date*
- b. *Location*
- c. *Distress types*
- d. *Maintenance scheduled or performed*

Items a through c are satisfied by this inspection report. Item d is the responsibility of the airport, as is record keeping of the monthly drive-by inspections.

A-1.4. Information Retrieval. *An airport sponsor may use any form of record keeping it deems appropriate so long as the information and records from the pavement survey can generate required reports, as necessary.*

Keep this report, monthly drive-by inspection reports, construction updates, and all records of maintenance activities in a readily accessible location so that they can be easily retrieved as requested by the FAA.

Table 3. Pavement inspection report.

Inspected By: _____

Date Inspected: _____

Branch	Section	Distress Description/Dimensions/Severity/ Recommended Action	Description of Repair	Date Performed	Cost	Funding Source
A01SD	01					
A01SD	02					
A01SD	03					
A01SD	04					
R15SD	01					
R15SD	02					

Table 3. Pavement inspection report (continued).

Inspected By: _____

Date Inspected: _____

Branch	Section	Distress Description/Dimensions/Severity/ Recommended Action	Description of Repair	Date Performed	Cost	Funding Source
R15SD	03					
R15SD	04					
T01SD	01					
T02SD	01					
TH01SD	01					
TH01SD	02					

Table 3. Pavement inspection report (continued).

Inspected By: _____

Date Inspected: _____

Branch	Section	Distress Description/Dimensions/Severity/ Recommended Action	Description of Repair	Date Performed	Cost	Funding Source
TH01SD	03					

Table Note: See Figure 3 for the location of the branch and section.

SUMMARY

This report documents the results of the pavement evaluation conducted at Sheldon Regional Airport. A visual inspection of the pavements in 2022 found that the overall condition of the pavement network is a PCI of 56. A 5-year pavement repair program, shown in Table 2, was generated for Sheldon Regional Airport, which revealed that approximately \$3,836,000 needs to be expended on M&R. Sheldon Regional Airport should utilize these study results to assist in planning for future maintenance needs as part of the airport CIP planning process.

APPENDIX A

CAUSE OF DISTRESS TABLES

Table A-1. Cause of pavement distress, asphalt-surfaced pavements.

Distress Type	Probable Cause of Distress
Alligator Cracking	Fatigue failure of the asphalt surface under repeated traffic loading.
Bleeding	Excessive amounts of asphalt cement or tars in the mix or low air void content, or both.
Block Cracking	Shrinkage of the asphalt and daily temperature cycling; it is not load associated.
Corrugation	Traffic action combined with an unstable pavement layer.
Depression	Settlement of the foundation soil or can be “built up” during construction.
Jet-Blast Erosion	Bituminous binder has been burned or carbonized.
Joint Reflection Cracking	Movement of the concrete slab beneath the asphalt surface due to thermal and moisture changes.
L&T Cracking	Cracks may be caused by (1) a poorly constructed paving lane joint, (2) shrinkage of the asphalt surface due to low temperatures or hardening of the asphalt, or (3) reflective cracking caused by cracks in an underlying PCC slab.
Oil Spillage	Deterioration or softening of the pavement surface caused by the spilling of oil, fuel, or other solvents.
Patching	N/A
Polished Aggregate	Repeated traffic applications.
Raveling	Asphalt binder may have hardened significantly, causing coarse aggregate pieces to dislodge.
Rutting	Usually caused by consolidation or lateral movement of the materials due to traffic loads.
Shoving	Where PCC pavements adjoin flexible pavements, PCC “growth” may shove the asphalt pavement.
Slippage Cracking	Low strength surface mix or poor bond between the surface and the next layer of the pavement structure.
Swelling	Usually caused by frost action or by swelling soil.
Weathering	Asphalt binder and/or fine aggregate may wear away as the pavement ages and hardens.

Table A-2. Cause of pavement distress, PCC pavements.

Distress Type	Probable Cause of Distress
ASR	Chemical reaction of alkalis in the portland cement with certain reactive silica minerals. ASR may be accelerated by the use of chemical pavement deicers.
Blowup	Incompressible materials in the joints.
Corner Break	Load repetition combined with loss of support and curling stresses.
Durability Cracking	Concrete's inability to withstand environmental factors such as freeze-thaw cycles.
Faulting	Upheaval or consolidation.
Joint Seal Damage	Stripping of joint sealant, extrusion of joint sealant, weed growth, hardening of the filler (oxidation), loss of bond to the slab edges, or absence of sealant in the joint.
LTD Cracking	Combination of load repetition, curling stresses, and shrinkage stresses.
Patching (Small and Large)	N/A
Popouts	Freeze-thaw action in combination with expansive aggregates.
Pumping	Poor drainage, poor joint sealant.
Scaling	Over finishing of concrete, deicing salts, improper construction, freeze-thaw cycles, and poor aggregate.
Shattered Slab	Load repetition.
Shrinkage Cracking	Setting and curing of the concrete.
Spalling (Joint and Corner)	Excessive stresses at the joint caused by infiltration of incompressible materials or traffic loads; weak concrete at the joint combined with traffic loads.

APPENDIX B

INSPECTION PHOTOGRAPHS

A01SD-01. Overview.



A01SD-01. LTD Cracking (Sample Unit No. 07).



A01SD-02. Overview.



A01SD-02. Corner Break (Sample Unit No. 03).



A01SD-03. Overview.



A01SD-03. LTD Cracking (Sample Unit No. 02).



A01SD-04. Overview.



A01SD-04. Corner Break (Sample Unit No. 02).



R15SD-01. Overview.



R15SD-01. Corner Spalling (Sample Unit No. 16).



R15SD-01. LTD Cracking (Sample Unit No. 10).



R15SD-02. Overview.



R15SD-02. Corner Spalling (Sample Unit No. 04).



R15SD-02. Small Patching (Sample Unit No. 04).



R15SD-03. Overview.



R15SD-03. LTD Cracking (Sample Unit No. 04).



R15SD-04. Overview.



R15SD-04. Corner Spalling (Sample Unit No. 36).



R15SD-04. Durability Cracking (Additional Sample Unit No. 06) (1).



R15SD-04. Durability Cracking (Additional Sample Unit No. 06) (2).



R15SD-04. LTD Cracking (Sample Unit No. 21).



T01SD-01. Overview.



T01SD-01. LTD Cracking (Sample Unit No. 05).



T02SD-01. Overview.



T02SD-01. LTD Cracking (Sample Unit No. 02).



T02SD-01. Shattered Slab (Sample Unit No. 03).



TH01SD-01. Overview.



TH01SD-01. Alligator Cracking (Sample Unit No. 04).



TH01SD-02. Overview.



TH01SD-02. LTD Cracking (Sample Unit No. 03).



TH01SD-03. Overview.



TH01SD-03. LTD Cracking (Sample Unit No. 01).



APPENDIX C

INSPECTION REPORT

RE-INSPECTION REPORT SHELDON REGIONAL AIRPORT

Pavement Database: IA 2022

Generate Date: 6/14/2023

Network ID: SHL

Page 1

Branch - Section ID: A01SD - 001

Branch Name: APRON 01

Use: APRON

LCD: 6/1/1980

PCI Family: IowaPCCAPNCW_General

Surface Type: PCC

Rank: P

Section Area (sf): 30,939.00

Length (ft): 408.00

Width (ft): 62.00

From: EAST EDGE OF APRON

To: EAST EDGE OF SECTIONS 2

Slabs: 248

Section Comments:

Slab Length (ft): 12.50

Slab Width (ft): 10.00

Joint Length (ft): 4,994.17

Last Insp Date: 11/20/2022

Inspection Comments:

PCI: 55

Total Samples: 12

Surveyed: 6

Sample Number: 002

Sample Type: R

Sample Comments:

Sample PCI: 48

Sample Area (Slabs): 24.00

62 CORNER BREAK	M	1.00 Slabs
63 LINEAR CRACKING	M	2.00 Slabs
65 JOINT SEAL DAMAGE	H	24.00 Slabs
66 SMALL PATCH	L	3.00 Slabs
66 SMALL PATCH	M	1.00 Slabs
71 FAULTING	L	1.00 Slabs
72 SHATTERED SLAB	M	1.00 Slabs
74 JOINT SPALL	M	1.00 Slabs
74 JOINT SPALL	M	1.00 Slabs
75 CORNER SPALL	H	1.00 Slabs
75 CORNER SPALL	L	2.00 Slabs

Sample Number: 003

Sample Type: R

Sample Comments:

Sample PCI: 80

Sample Area (Slabs): 20.00

63 LINEAR CRACKING	M	1.00 Slabs
65 JOINT SEAL DAMAGE	H	20.00 Slabs
75 CORNER SPALL	L	1.00 Slabs

Sample Number: 005

Sample Type: R

Sample Comments:

Sample PCI: 62

Sample Area (Slabs): 20.00

63 LINEAR CRACKING	M	4.00 Slabs
65 JOINT SEAL DAMAGE	H	20.00 Slabs
75 CORNER SPALL	M	2.00 Slabs

RE-INSPECTION REPORT SHELDON REGIONAL AIRPORT

Pavement Database: IA 2022

Generate Date: 6/14/2023

Network ID: SHL

Page 2

Sample Number: 007

Sample Type: R

Sample Comments:

Sample PCI: 58

Sample Area (Slabs): 16.00

63 LINEAR CRACKING	M	4.00 Slabs
65 JOINT SEAL DAMAGE	H	16.00 Slabs
75 CORNER SPALL	M	3.00 Slabs

Sample Number: 010

Sample Type: R

Sample Comments:

Sample PCI: 40

Sample Area (Slabs): 20.00

63 LINEAR CRACKING	M	4.00 Slabs
65 JOINT SEAL DAMAGE	H	20.00 Slabs
71 FAULTING	L	2.00 Slabs
72 SHATTERED SLAB	M	1.00 Slabs
74 JOINT SPALL	M	1.00 Slabs
74 JOINT SPALL	M	1.00 Slabs
75 CORNER SPALL	M	1.00 Slabs
75 CORNER SPALL	M	5.00 Slabs

Sample Number: 011

Sample Type: R

Sample Comments:

Sample PCI: 45

Sample Area (Slabs): 20.00

63 LINEAR CRACKING	H	1.00 Slabs
63 LINEAR CRACKING	L	1.00 Slabs
63 LINEAR CRACKING	M	1.00 Slabs
65 JOINT SEAL DAMAGE	H	20.00 Slabs
72 SHATTERED SLAB	M	2.00 Slabs
74 JOINT SPALL	M	1.00 Slabs
75 CORNER SPALL	M	1.00 Slabs

RE-INSPECTION REPORT SHELDON REGIONAL AIRPORT

Pavement Database: IA 2022

Generate Date: 6/14/2023

Network ID: SHL

Page 3

Branch - Section ID: A01SD - 002

Branch Name: APRON 01

Use: APRON

LCD: 6/1/2004

PCI Family: IowaPCCAPNCW_General

Surface Type: PCC

Rank: P

Section Area (sf): 25,082.00

Length (ft): 365.00

Width (ft): 67.00

From: SOUTH EDGE OF APRON

To: MAINTENANCE HANGER

Slabs: 241

Section Comments:

Slab Length (ft): 10.00

Slab Width (ft): 10.00

Joint Length (ft): 4,398.28

Last Insp Date: 11/20/2022

Inspection Comments:

PCI: 65

Total Samples: 12

Surveyed: 6

Sample Number: 02

Sample Type: R

Sample Comments:

Sample PCI: 73

Sample Area (Slabs): 30.00

63 LINEAR CRACKING	L	2.00 Slabs
63 LINEAR CRACKING	M	1.00 Slabs
65 JOINT SEAL DAMAGE	H	30.00 Slabs
75 CORNER SPALL	M	2.00 Slabs

Sample Number: 03

Sample Type: R

Sample Comments:

Sample PCI: 66

Sample Area (Slabs): 24.00

62 CORNER BREAK	L	1.00 Slabs
62 CORNER BREAK	M	1.00 Slabs
63 LINEAR CRACKING	M	2.00 Slabs
65 JOINT SEAL DAMAGE	H	24.00 Slabs
66 SMALL PATCH	L	1.00 Slabs
71 FAULTING	L	1.00 Slabs

Sample Number: 05

Sample Type: R

Sample Comments:

Sample PCI: 46

Sample Area (Slabs): 24.00

62 CORNER BREAK	M	1.00 Slabs
62 CORNER BREAK	M	1.00 Slabs
63 LINEAR CRACKING	M	3.00 Slabs
63 LINEAR CRACKING	M	3.00 Slabs
65 JOINT SEAL DAMAGE	H	24.00 Slabs
72 SHATTERED SLAB	M	1.00 Slabs
74 JOINT SPALL	M	1.00 Slabs

RE-INSPECTION REPORT SHELDON REGIONAL AIRPORT

Pavement Database: IA 2022

Generate Date: 6/14/2023

Network ID: SHL

Page 4

Sample Number: 07

Sample Type: R

Sample Comments:

Sample PCI: 86

Sample Area (Slabs): 21.00

65 JOINT SEAL DAMAGE

H

21.00 Slabs

75 CORNER SPALL

L

1.00 Slabs

Sample Number: 09

Sample Type: R

Sample Comments:

Sample PCI: 52

Sample Area (Slabs): 15.00

62 CORNER BREAK

M

2.00 Slabs

63 LINEAR CRACKING

M

3.00 Slabs

65 JOINT SEAL DAMAGE

H

15.00 Slabs

75 CORNER SPALL

M

2.00 Slabs

Sample Number: 11

Sample Type: R

Sample Comments:

Sample PCI: 60

Sample Area (Slabs): 13.00

63 LINEAR CRACKING

L

2.00 Slabs

63 LINEAR CRACKING

M

3.00 Slabs

65 JOINT SEAL DAMAGE

M

13.00 Slabs

RE-INSPECTION REPORT SHELDON REGIONAL AIRPORT

Pavement Database: IA 2022

Generate Date: 6/14/2023

Network ID: SHL

Page 5

Branch - Section ID: A01SD - 003

Branch Name: APRON 01

Use: APRON

LCD: 6/3/2009

PCI Family: IowaPCCAPNCW_General

Surface Type: PCC

Rank: P

Section Area (sf): 4,996.00

Length (ft): 110.00

Width (ft): 50.00

From: SOUTH EDGE OF APRON

To: MAINTENANCE HANGER

Slabs: 44

Section Comments: avg

Slab Length (ft): 9.70

Slab Width (ft): 10.00

Joint Length (ft): 739.68

Last Insp Date: 11/20/2022

Inspection Comments:

PCI: 20

Total Samples: 2

Surveyed: 2

Sample Number: 01

Sample Type: R

Sample Comments:

Sample PCI: 17

Sample Area (Slabs): 18.00

62 CORNER BREAK	L	1.00 Slabs
63 LINEAR CRACKING	M	5.00 Slabs
65 JOINT SEAL DAMAGE	H	18.00 Slabs
71 FAULTING	L	5.00 Slabs
72 SHATTERED SLAB	L	1.00 Slabs
72 SHATTERED SLAB	M	5.00 Slabs

Sample Number: 02

Sample Type: R

Sample Comments:

Sample PCI: 23

Sample Area (Slabs): 26.00

62 CORNER BREAK	L	1.00 Slabs
62 CORNER BREAK	L	2.00 Slabs
62 CORNER BREAK	M	3.00 Slabs
62 CORNER BREAK	M	1.00 Slabs
63 LINEAR CRACKING	L	1.00 Slabs
63 LINEAR CRACKING	M	8.00 Slabs
65 JOINT SEAL DAMAGE	H	26.00 Slabs
71 FAULTING	M	1.00 Slabs
72 SHATTERED SLAB	M	3.00 Slabs

RE-INSPECTION REPORT SHELDON REGIONAL AIRPORT

Pavement Database: IA 2022

Generate Date: 6/14/2023

Network ID: SHL

Page 6

Branch - Section ID: A01SD - 004

Branch Name: APRON 01

Use: APRON

LCD: 6/3/2013

PCI Family: IowaPCCAPNCW_General

Surface Type: PCC

Rank: P

Section Area (sf): 13,245.00

Length (ft): 250.00

Width (ft): 45.00

From: SEE MAP

To: SEE MAP

Slabs: 118

Section Comments: SLAB SIZE VARIES

Slab Length (ft): 11.00

Slab Width (ft): 10.00

Joint Length (ft): 2,143.73

Last Insp Date: 11/20/2022

Inspection Comments:

PCI: 89

Total Samples: 6

Surveyed: 4

Sample Number: 01

Sample Type: R

Sample Comments:

Sample PCI: 89

Sample Area (Slabs): 24.00

63 LINEAR CRACKING	M	1.00 Slabs
65 JOINT SEAL DAMAGE	L	24.00 Slabs

Sample Number: 02

Sample Type: R

Sample Comments:

Sample PCI: 90

Sample Area (Slabs): 21.00

62 CORNER BREAK	L	1.00 Slabs
65 JOINT SEAL DAMAGE	L	21.00 Slabs
75 CORNER SPALL	M	1.00 Slabs

Sample Number: 04

Sample Type: R

Sample Comments:

Sample PCI: 97

Sample Area (Slabs): 20.00

65 JOINT SEAL DAMAGE	L	20.00 Slabs
73 SHRINKAGE CRACKING	N	1.00 Slabs

Sample Number: 05

Sample Type: R

Sample Comments:

Sample PCI: 79

Sample Area (Slabs): 20.00

62 CORNER BREAK	M	1.00 Slabs
65 JOINT SEAL DAMAGE	M	20.00 Slabs
74 JOINT SPALL	L	2.00 Slabs
75 CORNER SPALL	M	1.00 Slabs

RE-INSPECTION REPORT SHELDON REGIONAL AIRPORT

Pavement Database: IA 2022

Generate Date: 6/14/2023

Network ID: SHL

Page 7

Branch - Section ID: R15SD - 001

Branch Name: RUNWAY 15/33

Use: RUNWAY

LCD: 6/1/1980

PCI Family: IowaPCCRWNCW_General

Surface Type: PCC

Rank: P

Section Area (sf): 114,791.00

Length (ft): 1,425.00

Width (ft): 84.00

From: SOUTH END OF RUNWAY

To: SOUTH END OF SECTION 4

Slabs: 600

Section Comments:

Slab Length (ft): 15.30

Slab Width (ft): 12.50

Joint Length (ft): 15,238.85

Last Insp Date: 11/20/2022

Inspection Comments:

PCI: 58

Total Samples: 27

Surveyed: 7

Sample Number: 001

Sample Type: R

Sample Comments:

Sample PCI: 78

Sample Area (Slabs): 24.00

65 JOINT SEAL DAMAGE	M	24.00 Slabs
66 SMALL PATCH	L	3.00 Slabs
74 JOINT SPALL	M	1.00 Slabs
75 CORNER SPALL	L	4.00 Slabs
75 CORNER SPALL	M	2.00 Slabs

Sample Number: 004

Sample Type: R

Sample Comments:

Sample PCI: 61

Sample Area (Slabs): 24.00

63 LINEAR CRACKING	M	1.00 Slabs
65 JOINT SEAL DAMAGE	M	24.00 Slabs
66 SMALL PATCH	L	1.00 Slabs
66 SMALL PATCH	L	1.00 Slabs
66 SMALL PATCH	L	3.00 Slabs
67 LARGE PATCH	L	1.00 Slabs
74 JOINT SPALL	M	2.00 Slabs
74 JOINT SPALL	M	1.00 Slabs
75 CORNER SPALL	L	2.00 Slabs
75 CORNER SPALL	M	1.00 Slabs
75 CORNER SPALL	M	4.00 Slabs
75 CORNER SPALL	M	2.00 Slabs

RE-INSPECTION REPORT SHELDON REGIONAL AIRPORT

Pavement Database: IA 2022

Generate Date: 6/14/2023

Network ID: SHL

Page 8

Sample Number: 007

Sample Type: R

Sample Comments:

Sample PCI: 59

Sample Area (Slabs): 24.00

62 CORNER BREAK	M	1.00 Slabs
63 LINEAR CRACKING	M	3.00 Slabs
65 JOINT SEAL DAMAGE	M	24.00 Slabs
66 SMALL PATCH	L	1.00 Slabs
74 JOINT SPALL	L	1.00 Slabs
75 CORNER SPALL	L	1.00 Slabs
75 CORNER SPALL	M	3.00 Slabs

Sample Number: 010

Sample Type: R

Sample Comments:

Sample PCI: 56

Sample Area (Slabs): 24.00

63 LINEAR CRACKING	L	1.00 Slabs
63 LINEAR CRACKING	M	3.00 Slabs
65 JOINT SEAL DAMAGE	M	24.00 Slabs
66 SMALL PATCH	L	1.00 Slabs
66 SMALL PATCH	L	2.00 Slabs
74 JOINT SPALL	M	3.00 Slabs
75 CORNER SPALL	L	1.00 Slabs
75 CORNER SPALL	M	4.00 Slabs
75 CORNER SPALL	M	1.00 Slabs

Sample Number: 013

Sample Type: R

Sample Comments:

Sample PCI: 48

Sample Area (Slabs): 24.00

62 CORNER BREAK	L	1.00 Slabs
63 LINEAR CRACKING	M	1.00 Slabs
65 JOINT SEAL DAMAGE	M	24.00 Slabs
66 SMALL PATCH	L	2.00 Slabs
66 SMALL PATCH	M	1.00 Slabs
74 JOINT SPALL	H	1.00 Slabs
74 JOINT SPALL	M	2.00 Slabs
74 JOINT SPALL	M	1.00 Slabs
74 JOINT SPALL	M	2.00 Slabs
75 CORNER SPALL	H	1.00 Slabs
75 CORNER SPALL	H	1.00 Slabs
75 CORNER SPALL	L	4.00 Slabs
75 CORNER SPALL	L	1.00 Slabs
75 CORNER SPALL	M	3.00 Slabs
75 CORNER SPALL	M	4.00 Slabs

RE-INSPECTION REPORT SHELDON REGIONAL AIRPORT

Pavement Database: IA 2022

Generate Date: 6/14/2023

Network ID: SHL

Page 9

Sample Number: 016

Sample Type: R

Sample Comments:

Sample PCI: 62

Sample Area (Slabs): 24.00

63 LINEAR CRACKING	M	1.00 Slabs
65 JOINT SEAL DAMAGE	L	24.00 Slabs
66 SMALL PATCH	L	1.00 Slabs
74 JOINT SPALL	M	5.00 Slabs
74 JOINT SPALL	M	1.00 Slabs
74 JOINT SPALL	M	1.00 Slabs
75 CORNER SPALL	L	1.00 Slabs
75 CORNER SPALL	L	1.00 Slabs
75 CORNER SPALL	M	4.00 Slabs
75 CORNER SPALL	M	4.00 Slabs
75 CORNER SPALL	M	1.00 Slabs

Sample Number: 019

Sample Type: R

Sample Comments:

Sample PCI: 43

Sample Area (Slabs): 24.00

63 LINEAR CRACKING	L	1.00 Slabs
63 LINEAR CRACKING	M	2.00 Slabs
65 JOINT SEAL DAMAGE	L	24.00 Slabs
66 SMALL PATCH	L	6.00 Slabs
66 SMALL PATCH	M	4.00 Slabs
74 JOINT SPALL	L	1.00 Slabs
74 JOINT SPALL	M	8.00 Slabs
74 JOINT SPALL	M	3.00 Slabs
75 CORNER SPALL	H	1.00 Slabs
75 CORNER SPALL	L	2.00 Slabs
75 CORNER SPALL	M	2.00 Slabs

RE-INSPECTION REPORT SHELDON REGIONAL AIRPORT

Pavement Database: IA 2022

Generate Date: 6/14/2023

Network ID: SHL

Page 10

Branch - Section ID: R15SD - 002

Branch Name: RUNWAY 15/33

Use: RUNWAY

LCD: 6/1/1980

PCI Family: IowaPCCRWNCW_General

Surface Type: PCC

Rank: P

Section Area (sf): 35,000.00

Length (ft): 2,800.00

Width (ft): 12.50

From: N END OF SECTION 1

To: NORTH END OF RWY EAST

Slabs: 514

Section Comments:

Slab Length (ft): 10.80

Slab Width (ft): 6.30

Joint Length (ft): 5,983.80

Last Insp Date: 11/20/2022

Inspection Comments:

PCI: 51

Total Samples: 23

Surveyed: 7

Sample Number: 004

Sample Type: R

Sample Comments:

Sample PCI: 42

Sample Area (Slabs): 24.00

65 JOINT SEAL DAMAGE	H	24.00 Slabs
66 SMALL PATCH	L	2.00 Slabs
66 SMALL PATCH	L	1.00 Slabs
67 LARGE PATCH	L	1.00 Slabs
71 FAULTING	L	7.00 Slabs
74 JOINT SPALL	H	1.00 Slabs
74 JOINT SPALL	M	1.00 Slabs
75 CORNER SPALL	H	5.00 Slabs
75 CORNER SPALL	H	2.00 Slabs
75 CORNER SPALL	L	2.00 Slabs
75 CORNER SPALL	L	1.00 Slabs
75 CORNER SPALL	M	1.00 Slabs
75 CORNER SPALL	M	1.00 Slabs

Sample Number: 008

Sample Type: R

Sample Comments:

Sample PCI: 49

Sample Area (Slabs): 24.00

65 JOINT SEAL DAMAGE	H	24.00 Slabs
66 SMALL PATCH	L	2.00 Slabs
66 SMALL PATCH	L	1.00 Slabs
71 FAULTING	L	5.00 Slabs
71 FAULTING	M	3.00 Slabs
74 JOINT SPALL	M	1.00 Slabs
74 JOINT SPALL	M	1.00 Slabs
75 CORNER SPALL	H	2.00 Slabs
75 CORNER SPALL	L	1.00 Slabs
75 CORNER SPALL	L	1.00 Slabs
75 CORNER SPALL	M	3.00 Slabs
75 CORNER SPALL	M	1.00 Slabs
75 CORNER SPALL	M	1.00 Slabs

RE-INSPECTION REPORT SHELDON REGIONAL AIRPORT

Pavement Database: IA 2022

Generate Date: 6/14/2023

Network ID: SHL

Page 11

Sample Number: 012

Sample Type: R

Sample Comments:

Sample PCI: 54

Sample Area (Slabs): 24.00

62 CORNER BREAK	M	1.00 Slabs
65 JOINT SEAL DAMAGE	H	24.00 Slabs
71 FAULTING	L	8.00 Slabs
74 JOINT SPALL	L	1.00 Slabs
75 CORNER SPALL	H	2.00 Slabs
75 CORNER SPALL	L	3.00 Slabs
75 CORNER SPALL	M	5.00 Slabs

Sample Number: 016

Sample Type: R

Sample Comments:

Sample PCI: 33

Sample Area (Slabs): 24.00

63 LINEAR CRACKING	M	1.00 Slabs
65 JOINT SEAL DAMAGE	H	24.00 Slabs
66 SMALL PATCH	L	8.00 Slabs
71 FAULTING	L	9.00 Slabs
74 JOINT SPALL	M	1.00 Slabs
74 JOINT SPALL	M	1.00 Slabs
75 CORNER SPALL	H	9.00 Slabs
75 CORNER SPALL	L	1.00 Slabs
75 CORNER SPALL	M	10.00 Slabs

Sample Number: 018

Sample Type: R

Sample Comments:

Sample PCI: 50

Sample Area (Slabs): 24.00

65 JOINT SEAL DAMAGE	H	24.00 Slabs
66 SMALL PATCH	L	5.00 Slabs
71 FAULTING	L	5.00 Slabs
74 JOINT SPALL	M	4.00 Slabs
75 CORNER SPALL	H	1.00 Slabs
75 CORNER SPALL	L	2.00 Slabs
75 CORNER SPALL	M	11.00 Slabs

Sample Number: 020

Sample Type: R

Sample Comments:

Sample PCI: 47

Sample Area (Slabs): 24.00

63 LINEAR CRACKING	M	1.00 Slabs
65 JOINT SEAL DAMAGE	H	24.00 Slabs
66 SMALL PATCH	L	1.00 Slabs
71 FAULTING	L	4.00 Slabs
71 FAULTING	M	4.00 Slabs
74 JOINT SPALL	M	2.00 Slabs
75 CORNER SPALL	M	8.00 Slabs

RE-INSPECTION REPORT SHELDON REGIONAL AIRPORT

Pavement Database: IA 2022

Generate Date: 6/14/2023

Network ID: SHL

Page 12

Sample Number: 023

Sample Type: R

Sample Comments:

Sample PCI: 76

Sample Area (Slabs): 28.00

65 JOINT SEAL DAMAGE

H

28.00 Slabs

66 SMALL PATCH

L

1.00 Slabs

71 FAULTING

L

6.00 Slabs

74 JOINT SPALL

L

1.00 Slabs

RE-INSPECTION REPORT SHELDON REGIONAL AIRPORT

Pavement Database: IA 2022

Generate Date: 6/14/2023

Network ID: SHL

Page 13

Branch - Section ID: R15SD - 003

Branch Name: RUNWAY 15/33

Use: RUNWAY

LCD: 6/1/1980

PCI Family: IowaPCCRWNCW_General

Surface Type: PCC

Rank: P

Section Area (sf): 35,000.00

Length (ft): 2,800.00

Width (ft): 12.50

From: N END OF SECTION 1

To: N END OF RWY WEST

Slabs: 514

Section Comments:

Slab Length (ft): 10.80

Slab Width (ft): 6.30

Joint Length (ft): 5,983.80

Last Insp Date: 11/20/2022

Inspection Comments:

PCI: 57

Total Samples: 23

Surveyed: 7

Sample Number: 004

Sample Type: R

Sample Comments:

Sample PCI: 49

Sample Area (Slabs): 24.00

63 LINEAR CRACKING	L	1.00 Slabs
63 LINEAR CRACKING	M	2.00 Slabs
65 JOINT SEAL DAMAGE	M	24.00 Slabs
66 SMALL PATCH	L	5.00 Slabs
71 FAULTING	L	6.00 Slabs
74 JOINT SPALL	M	3.00 Slabs
75 CORNER SPALL	L	2.00 Slabs
75 CORNER SPALL	M	6.00 Slabs

Sample Number: 008

Sample Type: R

Sample Comments:

Sample PCI: 44

Sample Area (Slabs): 24.00

65 JOINT SEAL DAMAGE	H	24.00 Slabs
66 SMALL PATCH	L	1.00 Slabs
71 FAULTING	M	12.00 Slabs
75 CORNER SPALL	M	11.00 Slabs

Sample Number: 012

Sample Type: R

Sample Comments:

Sample PCI: 58

Sample Area (Slabs): 24.00

65 JOINT SEAL DAMAGE	H	24.00 Slabs
71 FAULTING	L	5.00 Slabs
71 FAULTING	M	1.00 Slabs
74 JOINT SPALL	M	2.00 Slabs
75 CORNER SPALL	L	2.00 Slabs
75 CORNER SPALL	M	8.00 Slabs

RE-INSPECTION REPORT SHELDON REGIONAL AIRPORT

Pavement Database: IA 2022

Generate Date: 6/14/2023

Network ID: SHL

Page 14

Sample Number: 016

Sample Type: R

Sample Comments:

Sample PCI: 55

Sample Area (Slabs): 24.00

65 JOINT SEAL DAMAGE	H	24.00 Slabs
66 SMALL PATCH	L	10.00 Slabs
71 FAULTING	L	5.00 Slabs
74 JOINT SPALL	M	1.00 Slabs
75 CORNER SPALL	L	8.00 Slabs
75 CORNER SPALL	M	9.00 Slabs

Sample Number: 018

Sample Type: R

Sample Comments:

Sample PCI: 67

Sample Area (Slabs): 24.00

65 JOINT SEAL DAMAGE	M	24.00 Slabs
66 SMALL PATCH	L	5.00 Slabs
74 JOINT SPALL	M	5.00 Slabs
75 CORNER SPALL	L	5.00 Slabs
75 CORNER SPALL	M	5.00 Slabs

Sample Number: 020

Sample Type: R

Sample Comments:

Sample PCI: 61

Sample Area (Slabs): 24.00

63 LINEAR CRACKING	L	2.00 Slabs
63 LINEAR CRACKING	M	5.00 Slabs
65 JOINT SEAL DAMAGE	M	24.00 Slabs

Sample Number: 022

Sample Type: R

Sample Comments:

Sample PCI: 73

Sample Area (Slabs): 16.00

65 JOINT SEAL DAMAGE	M	16.00 Slabs
71 FAULTING	M	2.00 Slabs
75 CORNER SPALL	L	2.00 Slabs

RE-INSPECTION REPORT SHELDON REGIONAL AIRPORT

Pavement Database: IA 2022

Generate Date: 6/14/2023

Network ID: SHL

Page 15

Branch - Section ID: R15SD - 004

Branch Name: RUNWAY 15/33

Use: RUNWAY

LCD: 4/22/1991

PCI Family: IowaPCCRWNCW_General

Surface Type: PCC

Rank: P

Section Area (sf): 140,000.00

Length (ft): 2,800.00

Width (ft): 50.00

From: N END OF SECTION 1

To: N END OF RWY CENTER

Slabs: 1,047

Section Comments:

Slab Length (ft): 10.70

Slab Width (ft): 12.50

Joint Length (ft): 21,434.11

Last Insp Date: 11/20/2022

Inspection Comments:

PCI: 59

Total Samples: 46

Surveyed: 9

Sample Number: 001

Sample Type: R

Sample Comments:

Sample PCI: 40

Sample Area (Slabs): 24.00

62 CORNER BREAK	H	1.00 Slabs
62 CORNER BREAK	M	1.00 Slabs
63 LINEAR CRACKING	M	3.00 Slabs
64 DURABILITY CRACKING	L	2.00 Slabs
65 JOINT SEAL DAMAGE	M	24.00 Slabs
66 SMALL PATCH	L	2.00 Slabs
66 SMALL PATCH	L	1.00 Slabs
67 LARGE PATCH	L	1.00 Slabs
67 LARGE PATCH	L	2.00 Slabs
72 SHATTERED SLAB	M	1.00 Slabs
74 JOINT SPALL	M	1.00 Slabs
75 CORNER SPALL	M	1.00 Slabs
75 CORNER SPALL	M	1.00 Slabs

Sample Number: 003

Sample Type: R

Sample Comments:

Sample PCI: 78

Sample Area (Slabs): 24.00

65 JOINT SEAL DAMAGE	L	24.00 Slabs
66 SMALL PATCH	L	2.00 Slabs
66 SMALL PATCH	M	1.00 Slabs
74 JOINT SPALL	L	2.00 Slabs
74 JOINT SPALL	M	1.00 Slabs
75 CORNER SPALL	L	2.00 Slabs
75 CORNER SPALL	M	1.00 Slabs
75 CORNER SPALL	M	1.00 Slabs

RE-INSPECTION REPORT SHELDON REGIONAL AIRPORT

Pavement Database: IA 2022

Generate Date: 6/14/2023

Network ID: SHL

Page 16

Sample Number: 006

Sample Type: A

Sample Comments:

Sample PCI: 11

Sample Area (Slabs): 24.00

63 LINEAR CRACKING	M	14.00 Slabs
64 DURABILITY CRACKING	H	3.00 Slabs
64 DURABILITY CRACKING	L	4.00 Slabs
64 DURABILITY CRACKING	M	5.00 Slabs
65 JOINT SEAL DAMAGE	M	24.00 Slabs
66 SMALL PATCH	L	4.00 Slabs
66 SMALL PATCH	M	3.00 Slabs
67 LARGE PATCH	M	2.00 Slabs
75 CORNER SPALL	M	1.00 Slabs

Sample Number: 011

Sample Type: R

Sample Comments:

Sample PCI: 50

Sample Area (Slabs): 24.00

63 LINEAR CRACKING	M	6.00 Slabs	
65 JOINT SEAL DAMAGE	M	24.00 Slabs	
71 FAULTING	L	4.00 Slabs	AT 63
74 JOINT SPALL	L	2.00 Slabs	
75 CORNER SPALL	L	1.00 Slabs	
75 CORNER SPALL	M	1.00 Slabs	

Sample Number: 016

Sample Type: R

Sample Comments:

Sample PCI: 68

Sample Area (Slabs): 24.00

63 LINEAR CRACKING	H	1.00 Slabs
63 LINEAR CRACKING	L	1.00 Slabs
63 LINEAR CRACKING	M	1.00 Slabs
65 JOINT SEAL DAMAGE	L	24.00 Slabs
74 JOINT SPALL	M	1.00 Slabs
75 CORNER SPALL	M	2.00 Slabs
75 CORNER SPALL	M	1.00 Slabs

Sample Number: 021

Sample Type: R

Sample Comments:

Sample PCI: 36

Sample Area (Slabs): 24.00

62 CORNER BREAK	M	1.00 Slabs
63 LINEAR CRACKING	H	1.00 Slabs
63 LINEAR CRACKING	L	1.00 Slabs
63 LINEAR CRACKING	M	2.00 Slabs
63 LINEAR CRACKING	M	1.00 Slabs
63 LINEAR CRACKING	M	1.00 Slabs
65 JOINT SEAL DAMAGE	M	24.00 Slabs
66 SMALL PATCH	M	1.00 Slabs
67 LARGE PATCH	L	1.00 Slabs
67 LARGE PATCH	L	1.00 Slabs
74 JOINT SPALL	H	1.00 Slabs
74 JOINT SPALL	M	2.00 Slabs
75 CORNER SPALL	H	2.00 Slabs
75 CORNER SPALL	L	2.00 Slabs
75 CORNER SPALL	M	6.00 Slabs

RE-INSPECTION REPORT SHELDON REGIONAL AIRPORT

Pavement Database: IA 2022

Generate Date: 6/14/2023

Network ID: SHL

Page 17

Sample Number: 026

Sample Type: R

Sample Comments:

Sample PCI: 73

Sample Area (Slabs): 24.00

63 LINEAR CRACKING	M	1.00 Slabs
65 JOINT SEAL DAMAGE	M	24.00 Slabs
66 SMALL PATCH	L	1.00 Slabs
74 JOINT SPALL	M	1.00 Slabs
75 CORNER SPALL	L	2.00 Slabs
75 CORNER SPALL	M	3.00 Slabs

Sample Number: 036

Sample Type: R

Sample Comments:

Sample PCI: 67

Sample Area (Slabs): 24.00

65 JOINT SEAL DAMAGE	L	24.00 Slabs
71 FAULTING	L	4.00 Slabs
74 JOINT SPALL	M	1.00 Slabs
75 CORNER SPALL	L	1.00 Slabs
75 CORNER SPALL	M	12.00 Slabs

Sample Number: 041

Sample Type: R

Sample Comments:

Sample PCI: 66

Sample Area (Slabs): 24.00

63 LINEAR CRACKING	M	3.00 Slabs
65 JOINT SEAL DAMAGE	M	24.00 Slabs
73 SHRINKAGE CRACKING	N	1.00 Slabs
75 CORNER SPALL	L	1.00 Slabs
75 CORNER SPALL	M	2.00 Slabs

RE-INSPECTION REPORT SHELDON REGIONAL AIRPORT

Pavement Database: IA 2022

Generate Date: 6/14/2023

Network ID: SHL

Page 19

Branch - Section ID: T02SD - 001

Branch Name: TAXIWAY 02

Use: TAXIWAY

LCD: 6/1/1980

PCI Family: IowaPCCTWNCW_General

Surface Type: PCC

Rank: P

Section Area (sf): 10,572.00

Length (ft): 215.00

Width (ft): 40.00

From: RUNWAY

To: APRON

Slabs: 72

Section Comments: avg

Slab Length (ft): 12.30

Slab Width (ft): 12.20

Joint Length (ft): 1,446.67

Last Insp Date: 11/20/2022

Inspection Comments:

PCI: 48

Total Samples: 3

Surveyed: 3

Sample Number: 001

Sample Type: R

Sample Comments:

Sample PCI: 70

Sample Area (Slabs): 26.00

65 JOINT SEAL DAMAGE	H	26.00 Slabs
71 FAULTING	L	1.00 Slabs
72 SHATTERED SLAB	M	1.00 Slabs
75 CORNER SPALL	M	2.00 Slabs

Sample Number: 002

Sample Type: R

Sample Comments:

Sample PCI: 54

Sample Area (Slabs): 20.00

63 LINEAR CRACKING	H	1.00 Slabs
65 JOINT SEAL DAMAGE	H	20.00 Slabs
71 FAULTING	L	2.00 Slabs
72 SHATTERED SLAB	M	1.00 Slabs
74 JOINT SPALL	M	4.00 Slabs

Sample Number: 003

Sample Type: R

Sample Comments:

Sample PCI: 22

Sample Area (Slabs): 26.00

62 CORNER BREAK	M	5.00 Slabs
63 LINEAR CRACKING	M	4.00 Slabs
65 JOINT SEAL DAMAGE	H	26.00 Slabs
72 SHATTERED SLAB	M	5.00 Slabs
74 JOINT SPALL	M	1.00 Slabs
75 CORNER SPALL	H	5.00 Slabs
75 CORNER SPALL	M	2.00 Slabs

RE-INSPECTION REPORT SHELDON REGIONAL AIRPORT

Pavement Database: IA 2022

Generate Date: 6/14/2023

Network ID: SHL

Page 20

Branch - Section ID: TH01SD - 001

Branch Name: T-HANGAR 01

Use: T-HANGAR

LCD: 1/1/1998

PCI Family: IowaASPHALTTHNorthern

Surface Type: APC

Rank: P

Section Area (sf): 17,540.00

Length (ft): 877.00

Width (ft): 20.00

From: .

To: .

Slabs:

Section Comments:

Slab Length (ft):

Slab Width (ft):

Joint Length (ft):

Last Insp Date: 11/20/2022

Inspection Comments:

PCI: 15

Total Samples: 4

Surveyed: 3

Sample Number: 02

Sample Type: R

Sample Comments:

Sample PCI: 19

Sample Area (SF): 4,200.00

41 ALLIGATOR CRACKING	M	45.00 SF	
47 JOINT REFLECTION CRACKING	M	500.00 Ft	W, VEG
48 LONGITUDINAL/TRANSVERSE CRACKING	L	220.00 Ft	LU
56 SWELLING	M	10.00 SF	
57 WEATHERING	H	4,200.00 SF	

Sample Number: 03

Sample Type: R

Sample Comments:

Sample PCI: 18

Sample Area (SF): 4,065.00

41 ALLIGATOR CRACKING	M	120.00 SF	
47 JOINT REFLECTION CRACKING	M	380.00 Ft	W, VEG
48 LONGITUDINAL/TRANSVERSE CRACKING	L	210.00 Ft	LU
57 WEATHERING	H	4,065.00 SF	

Sample Number: 04

Sample Type: R

Sample Comments:

Sample PCI: 9

Sample Area (SF): 4,405.00

41 ALLIGATOR CRACKING	M	500.00 SF	
47 JOINT REFLECTION CRACKING	M	475.00 Ft	W, 2NDY, VEG
48 LONGITUDINAL/TRANSVERSE CRACKING	L	180.00 Ft	LU
50 PATCHING	L	385.00 SF	PCC PATCH
50 PATCHING	M	20.00 SF	PCC PATCH
56 SWELLING	L	8.00 SF	
57 WEATHERING	H	4,000.00 SF	

RE-INSPECTION REPORT SHELDON REGIONAL AIRPORT

Pavement Database: IA 2022

Generate Date: 6/14/2023

Network ID: SHL

Page 21

Branch - Section ID: TH01SD - 002

Branch Name: T-HANGAR 01

Use: T-HANGAR

LCD: 1/1/2000

PCI Family: IowaPCCTH NC NCW

Surface Type: PCC

Rank: P

Section Area (sf): 7,800.00

Length (ft): 390.00

Width (ft): 20.00

From: .

To: .

Slabs: 78

Section Comments:

Slab Length (ft): 10.00

Slab Width (ft): 10.00

Joint Length (ft): 1,150.00

Last Insp Date: 11/20/2022

Inspection Comments:

PCI: 59

Total Samples: 4

Surveyed: 3

Sample Number: 02

Sample Type: R

Sample Comments:

Sample PCI: 62

Sample Area (Slabs): 18.00

62 CORNER BREAK	L	1.00 Slabs
62 CORNER BREAK	M	1.00 Slabs
62 CORNER BREAK	M	1.00 Slabs
63 LINEAR CRACKING	M	1.00 Slabs
65 JOINT SEAL DAMAGE	H	18.00 Slabs
73 SHRINKAGE CRACKING	N	2.00 Slabs
74 JOINT SPALL	M	1.00 Slabs

Sample Number: 03

Sample Type: R

Sample Comments:

Sample PCI: 59

Sample Area (Slabs): 20.00

62 CORNER BREAK	M	1.00 Slabs
63 LINEAR CRACKING	M	2.00 Slabs
65 JOINT SEAL DAMAGE	H	20.00 Slabs
71 FAULTING	L	3.00 Slabs
73 SHRINKAGE CRACKING	N	2.00 Slabs
75 CORNER SPALL	M	1.00 Slabs
75 CORNER SPALL	M	1.00 Slabs

Sample Number: 04

Sample Type: R

Sample Comments:

Sample PCI: 57

Sample Area (Slabs): 20.00

63 LINEAR CRACKING	L	1.00 Slabs
63 LINEAR CRACKING	M	4.00 Slabs
65 JOINT SEAL DAMAGE	H	20.00 Slabs
73 SHRINKAGE CRACKING	N	2.00 Slabs
75 CORNER SPALL	M	1.00 Slabs

RE-INSPECTION REPORT SHELDON REGIONAL AIRPORT

Pavement Database: IA 2022

Generate Date: 6/14/2023

Network ID: SHL

Page 22

Branch - Section ID: TH01SD - 003

Branch Name: T-HANGAR 01

Use: T-HANGAR

LCD: 6/1/1994

PCI Family: IowaPCCTH NC NCW

Surface Type: PCC

Rank: P

Section Area (sf): 4,200.00

Length (ft): 210.00

Width (ft): 20.00

From: .

To: .

Slabs: 11

Section Comments:

Slab Length (ft): 20.00

Slab Width (ft): 20.00

Joint Length (ft): 190.00

Last Insp Date: 11/20/2022

Inspection Comments:

PCI: 3

Total Samples: 1

Surveyed: 1

Sample Number: 01

Sample Type: R

Sample Comments:

Sample PCI: 3

Sample Area (Slabs): 11.00

63 LINEAR CRACKING

M

9.00 Slabs

65 JOINT SEAL DAMAGE

H

11.00 Slabs

71 FAULTING

L

6.00 Slabs

72 SHATTERED SLAB

H

1.00 Slabs

72 SHATTERED SLAB

M

1.00 Slabs

APPENDIX D

WORK HISTORY REPORT

WORK HISTORY

Pavement Database: IA 2022

Generate Date: 6/25/2023

Network ID: SHL

Page 1

Network: SHELDON REGIONAL AIRPORT

Branch - Section ID: A01SD - 001

LCD: 6/1/1980
Use: APRON
Rank: P
Surface: PCC

Length (ft): 408.00
Width (ft): 62.00
True Area (sf): 30,939.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-01-1980	CR-PC	Complete Reconstruction - PCC	\$0.00	0.00	True	EST

Branch - Section ID: A01SD - 002

LCD: 6/1/2004
Use: APRON
Rank: P
Surface: PCC

Length (ft): 365.00
Width (ft): 67.00
True Area (sf): 25,082.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-01-2004	CR-PC	Complete Reconstruction - PCC	\$0.00	0.00	True	-
06-01-1998	OL-AS	Overlay - AC Structural	\$0.00	0.00	True	Assumed-please make sure
06-30-1963	NC-PC	New Construction - PCC	\$0.00	0.00	True	-

Branch - Section ID: A01SD - 003

LCD: 6/3/2009
Use: APRON
Rank: P
Surface: PCC

Length (ft): 110.00
Width (ft): 50.00
True Area (sf): 4,996.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-03-2009	CR-PC	Complete Reconstruction - PCC	\$0.00	6.00	True	FAA SPEC P-505 (REINFORCED)
06-02-2009	SB-AG	Subbase - Aggregate	\$0.00	6.00	False	IDOT SPEC 2115
06-01-2009	SG-CO	Subgrade - Compacted	\$0.00	12.00	False	FAA SPEC P-152
06-01-2004	NU-IN	New Construction - Initial	\$0.00	0.00	True	-

Branch - Section ID: A01SD - 004

LCD: 6/3/2013
Use: APRON
Rank: P
Surface: PCC

Length (ft): 250.00
Width (ft): 45.00
True Area (sf): 13,245.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-03-2013	NC-PC	New Construction - PCC	\$0.00	6.00	True	6" PCC (P-505)
06-02-2013	SB-AG	Subbase - Aggregate	\$0.00	6.00	False	6" GRANULAR SUBBASE (IOWA DOT SPEC 2111)
06-01-2013	SG-ST	Subgrade - Stabilized	\$0.00	12.00	False	12" FLY-ASH TREATED SUBGRADE P-158

WORK HISTORY

Pavement Database: IA 2022

Generate Date: 6/25/2023

Network ID: SHL

Page 2

Branch - Section ID: R15SD - 001

LCD: 6/1/1980
 Use: RUNWAY
 Rank: P
 Surface: PCC

Length (ft): 1,425.00
 Width (ft): 84.00
 True Area (sf): 114,791.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-01-2013	PA-PP	Patching - PCC Partial Depth	\$0.00	0.00	False	-
06-01-2013	CS-PC	Crack Sealing - PCC	\$0.00	0.00	False	-
06-01-2013	JS-LC	Joint Seal (Localized)	\$0.00	0.00	False	-
06-01-1980	NC-PC	New Construction - PCC	\$0.00	0.00	True	-

Branch - Section ID: R15SD - 002

LCD: 6/1/1980
 Use: RUNWAY
 Rank: P
 Surface: PCC

Length (ft): 2,800.00
 Width (ft): 12.50
 True Area (sf): 35,000.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-01-2013	PA-PP	Patching - PCC Partial Depth	\$0.00	0.00	False	-
06-01-2013	JS-LC	Joint Seal (Localized)	\$0.00	0.00	False	-
06-01-2013	SL-PC	Slab Replacement - PCC	\$0.00	0.00	False	-
06-01-2013	CS-PC	Crack Sealing - PCC	\$0.00	0.00	False	-
06-01-1980	NC-PC	New Construction - PCC	\$0.00	0.00	True	-

Branch - Section ID: R15SD - 003

LCD: 6/1/1980
 Use: RUNWAY
 Rank: P
 Surface: PCC

Length (ft): 2,800.00
 Width (ft): 12.50
 True Area (sf): 35,000.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-01-2013	SL-PC	Slab Replacement - PCC	\$0.00	0.00	False	-
06-01-2013	CS-PC	Crack Sealing - PCC	\$0.00	0.00	False	-
06-01-2013	PA-PP	Patching - PCC Partial Depth	\$0.00	0.00	False	-
06-01-2013	JS-LC	Joint Seal (Localized)	\$0.00	0.00	False	-
06-01-1980	NC-PC	New Construction - PCC	\$0.00	0.00	True	-

Branch - Section ID: R15SD - 004

LCD: 4/22/1991
 Use: RUNWAY
 Rank: P
 Surface: PCC

Length (ft): 2,800.00
 Width (ft): 50.00
 True Area (sf): 140,000.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
07-01-2022	SL-PC	Slab Replacement - PCC	\$0.00	0.00	False	est
06-01-2013	CS-PC	Crack Sealing - PCC	\$0.00	0.00	False	-
06-01-2013	PA-PP	Patching - PCC Partial Depth	\$0.00	0.00	False	-
06-01-2013	SL-PC	Slab Replacement - PCC	\$0.00	0.00	False	-
06-01-2013	JS-LC	Joint Seal (Localized)	\$0.00	0.00	False	-
04-22-1991	CR-PC	Complete Reconstruction - PCC	\$0.00	6.00	True	6" P-501 PCC
04-21-1991	BA-AG	Base Course - Aggregate	\$0.00	6.00	False	6" P-208 CAB
06-01-1963	NC-PC	New Construction - PCC	\$0.00	0.00	True	-

WORK HISTORY

Pavement Database: IA 2022

Generate Date: 6/25/2023

Network ID: SHL

Page 3

Branch - Section ID: T01SD - 001

LCD: 6/1/1980
 Use: TAXIWAY
 Rank: P
 Surface: PCC

Length (ft): 270.00
 Width (ft): 40.00
 True Area (sf): 11,136.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-01-2018	PA-PP	Patching - PCC Partial Depth	\$0.00	0.00	False	EST
06-01-2013	JS-LC	Joint Seal (Localized)	\$0.00	0.00	False	-
06-01-2013	SL-PC	Slab Replacement - PCC	\$0.00	0.00	False	-
06-01-1980	NC-PC	New Construction - PCC	\$0.00	0.00	True	-

Branch - Section ID: T02SD - 001

LCD: 6/1/1980
 Use: TAXIWAY
 Rank: P
 Surface: PCC

Length (ft): 215.00
 Width (ft): 40.00
 True Area (sf): 10,572.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-01-1980	NC-PC	New Construction - PCC	\$0.00	0.00	True	-

Branch - Section ID: TH01SD - 001

LCD: 1/1/1998
 Use: T-HANGAR
 Rank: P
 Surface: APC

Length (ft): 877.00
 Width (ft): 20.00
 True Area (sf): 17,540.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
01-01-1998	OL-AC	Overlay - AC	\$0.00	0.00	True	EST
06-02-1963	NC-PC	New Construction - PCC	\$0.00	6.00	True	6" PCC
06-01-1963	SB-AG	Subbase - Aggregate	\$0.00	6.00	False	6" P-154 Subbase

Branch - Section ID: TH01SD - 002

LCD: 1/1/2000
 Use: T-HANGAR
 Rank: P
 Surface: PCC

Length (ft): 390.00
 Width (ft): 20.00
 True Area (sf): 7,800.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
01-01-2000	NU-IN	New Construction - Initial	\$0.00	0.00	True	EST, BETWEEN 1994 AND 2004 (BACKCALCULATED)

Branch - Section ID: TH01SD - 003

LCD: 6/1/1994
 Use: T-HANGAR
 Rank: P
 Surface: PCC

Length (ft): 210.00
 Width (ft): 20.00
 True Area (sf): 4,200.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-01-1994	NU-IN	New Construction - Initial	\$0.00	0.00	True	EST, BETWEEN 1994 AND 2004

APPENDIX E

LOCALIZED PREVENTIVE MAINTENANCE POLICIES AND UNIT COST TABLES

Table E-1. Localized preventive maintenance policy, asphalt-surfaced pavements.

Distress Type	Severity Level	Maintenance Action
Alligator Cracking	Low	Monitor
Alligator Cracking	Medium	Asphalt Patch
Alligator Cracking	High	Asphalt Patch
Bleeding	N/A	Monitor
Block Cracking	Low	Monitor
Block Cracking	Medium	Crack Seal—Asphalt
Block Cracking	High	Crack Seal—Asphalt
Corrugation	Low	Monitor
Corrugation	Medium	Asphalt Patch
Corrugation	High	Asphalt Patch
Depression	Low	Monitor
Depression	Medium	Monitor
Depression	High	Asphalt Patch
Jet-Blast Erosion	N/A	Asphalt Patch
Joint Reflection Cracking	Low	Monitor
Joint Reflection Cracking	Medium	Crack Seal—Asphalt
Joint Reflection Cracking	High	Crack Seal—Asphalt
L&T Cracking	Low	Monitor
L&T Cracking	Medium	Crack Seal—Asphalt
L&T Cracking	High	Crack Seal—Asphalt
Oil Spillage	N/A	Asphalt Patch
Patching	Low	Monitor
Patching	Medium	Asphalt Patch
Patching	High	Asphalt Patch
Polished Aggregate	N/A	Monitor
Raveling	Low	Monitor
Raveling	Medium	Asphalt Patch
Raveling	High	Asphalt Patch
Rutting	Low	Monitor
Rutting	Medium	Monitor
Rutting	High	Asphalt Patch
Shoving	Low	Monitor
Shoving	Medium	Asphalt Patch
Shoving	High	Asphalt Patch
Slippage Cracking	N/A	Asphalt Patch
Swelling	Low	Monitor
Swelling	Medium	Monitor
Swelling	High	Asphalt Patch
Weathering	Low	Monitor
Weathering	Medium	Monitor
Weathering	High	Asphalt Patch

Table E-2. Localized preventive maintenance policy, PCC pavements.

Distress Type	Severity Level	Maintenance Action
ASR	Low	Monitor
ASR	Medium	Slab Replacement
ASR	High	Slab Replacement
Blowup	Low	Slab Replacement
Blowup	Medium	Slab Replacement
Blowup	High	Slab Replacement
Corner Break	Low	Crack Seal—PCC
Corner Break	Medium	Full Depth PCC Patch
Corner Break	High	Full Depth PCC Patch
Durability Cracking	Low	Monitor
Durability Cracking	Medium	Full Depth Patch
Durability Cracking	High	Slab Replacement
Faulting	Low	Monitor
Faulting	Medium	Grinding
Faulting	High	Slab Replacement
Joint Seal Damage	Low	Monitor
Joint Seal Damage	Medium	Joint Seal
Joint Seal Damage	High	Joint Seal
LTD Cracking	Low	Monitor
LTD Cracking	Medium	Crack Seal—PCC
LTD Cracking	High	Slab Replacement
Patching (Small and Large)	Low	Monitor
Patching (Small and Large)	Medium	Full Depth PCC Patch
Patching (Small and Large)	High	Full Depth PCC Patch
Popouts	N/A	Monitor
Pumping	N/A	Monitor
Scaling	Low	Monitor
Scaling	Medium	Partial Depth PCC Patch
Scaling	High	Slab Replacement
Shattered Slab	Low	Crack Seal—PCC
Shattered Slab	Medium	Slab Replacement
Shattered Slab	High	Slab Replacement
Shrinkage Cracking	N/A	Monitor
Spalling (Joint and Corner)	Low	Monitor
Spalling (Joint and Corner)	Medium	Partial Depth PCC Patch
Spalling (Joint and Corner)	High	Partial Depth PCC Patch

Table E-3. 2023 unit costs for localized preventive maintenance actions.

Maintenance Action	Unit Cost
Asphalt Patch—Asphalt-Surfaced Pavement	\$15.24/sf
Crack Sealing—Asphalt-Surfaced Pavement	\$2.61/lf
Partial Depth PCC Patch—PCC Pavement	\$39.04/sf
Full Depth PCC Patch—PCC Pavement	\$17.43/sf
Crack Sealing—PCC Pavement	\$3.14/lf
Joint Sealing—PCC Pavement	\$3.14/lf
Grinding—PCC Pavement	\$0.37/sf
Slab Replacement—PCC Pavement	\$17.43/sf

Table Note: The unit cost estimates are based on broad statewide numbers and should be adjusted to reflect local costs.

Table E-4. 2023 unit costs (per square foot) based on pavement type and PCI ranges.

Pavement Type	PCI Range 0–40	PCI Range 40–50	PCI Range 50–60	PCI Range 60–70	PCI Range 70–80	PCI Range 80–90	PCI Range 90–100
AC	\$10.82	\$5.12	\$5.12	\$5.12	\$0.00	\$0.00	\$0.00
PCC	\$18.08	\$8.55	\$8.55	\$8.55	\$0.00	\$0.00	\$0.00

Table Note: The unit cost estimates are based on broad statewide numbers and should be adjusted to reflect local costs.

APPENDIX F

YEAR 2023 LOCALIZED PREVENTIVE MAINTENANCE DETAILS

Table F-1. Year 2023 localized preventive maintenance details.

Branch	Section	Distress Type	Severity	Distress Quantity	Distress Unit	Maintenance Action	Unit Cost	2023 Estimated Cost
A01SD	04	Corner Break	Low	1	Slabs	Crack Sealing - PCC	\$3.14	\$36
A01SD	04	Corner Break	Medium	1	Slabs	Patching - PCC Full Depth	\$17.43	\$781
A01SD	04	Corner Spalling	Medium	3	Slabs	Patching - PCC Partial Depth	\$39.04	\$292
A01SD	04	Joint Seal Damage	Medium	28	Slabs	Joint Seal (Localized)	\$3.14	\$1,584
A01SD	04	LTD Cracking	Medium	1	Slabs	Crack Sealing - PCC	\$3.14	\$46
T01SD	01	Corner Break	Low	1	Slabs	Crack Sealing - PCC	\$3.14	\$38
T01SD	01	Corner Break	Medium	1	Slabs	Patching - PCC Full Depth	\$17.43	\$822
T01SD	01	Corner Spalling	Medium	1	Slabs	Patching - PCC Partial Depth	\$39.04	\$153
T01SD	01	Joint Seal Damage	Medium	23	Slabs	Joint Seal (Localized)	\$3.14	\$1,261
T01SD	01	Joint Seal Damage	High	88	Slabs	Joint Seal (Localized)	\$3.14	\$4,729
T01SD	01	Joint Spalling	Medium	1	Slabs	Patching - PCC Partial Depth	\$39.04	\$368
T01SD	01	Large Patch	Medium	1	Slabs	Patching - PCC Full Depth	\$17.43	\$1,253
T01SD	01	LTD Cracking	Medium	7	Slabs	Crack Sealing - PCC	\$3.14	\$229
TH01SD	02	Corner Break	Low	1	Slabs	Crack Sealing - PCC	\$3.14	\$35
TH01SD	02	Corner Break	Medium	4	Slabs	Patching - PCC Full Depth	\$17.43	\$2,271
TH01SD	02	Corner Spalling	Medium	4	Slabs	Patching - PCC Partial Depth	\$39.04	\$424
TH01SD	02	Joint Seal Damage	High	78	Slabs	Joint Seal (Localized)	\$3.14	\$3,611
TH01SD	02	Joint Spalling	Medium	1	Slabs	Patching - PCC Partial Depth	\$39.04	\$339
TH01SD	02	LTD Cracking	Medium	9	Slabs	Crack Sealing - PCC	\$3.14	\$296

Table F-1. Year 2023 localized preventive maintenance details (continued).

Table Notes:

1. See Figure 3 for the location of the branch and section.
2. Distress types are defined by ASTM D5340-20. L&T Cracking = Longitudinal and Transverse Cracking; LTD Cracking = Longitudinal, Transverse, and Diagonal Cracking; ASR = Alkali-Silica Reaction.
3. The costs provided are of a general nature for the entire state and may require adjustment to reflect specific conditions at Sheldon Regional Airport.



PREPARED FOR

Iowa Department of Transportation
Modal Transportation Bureau
800 Lincoln Way
Ames, Iowa 50010
515-239-1691
<https://iowadot.gov/aviation>

JULY 2023