

Council Bluffs Municipal Airport



Pavement Management Report

PREPARED BY

Applied Pavement Technology, Inc.
1908 South First Street, Suite 201
Champaign, Illinois 61820
(217) 398-3977
www.appliedpavement.com

AUGUST 2026



The preparation of this document was financed in part through an Airport Improvement Program grant from the Federal Aviation Administration (Project Number 3-19-0000-033-2025) as provided under Section 505 of the Airport and Airway Improvement Act of 1982, as amended. The contents do not necessarily reflect the DOT's official views or the policy of the FAA. Acceptance of this report by the FAA does not in any way constitute a commitment on the part of the United States to participate in any development depicted therein nor does it indicate the proposed development is environmentally acceptable in accordance with appropriate public laws

COUNCIL BLUFFS MUNICIPAL AIRPORT PAVEMENT MANAGEMENT REPORT

Prepared For:



Iowa Department of Transportation
Modal Transportation Bureau
800 Lincoln Way
Ames, Iowa 50010
515-239-1691
<https://iowadot.gov/modes-travel/aviation>

Prepared By:



Applied Pavement Technology, Inc.
1908 South First Street, Suite 201
Champaign, Illinois 61820
217-398-3977
<https://www.appliedpavement.com>

In Association With:



Robinson Engineering Company
Consulting Engineers
1545 Dalton Street
Jesup, Iowa 50648
319-334-7211

TABLE OF CONTENTS

INTRODUCTION.....	1
PAVEMENT INVENTORY.....	3
PAVEMENT EVALUATION.....	6
Pavement Evaluation Procedure	6
Pavement Evaluation Results.....	8
Inspection Comments.....	13
Runway	13
Taxiways	13
Aprons.....	13
T-Hangar.....	14
PAVEMENT MAINTENANCE AND REHABILITATION PROGRAM	15
Analysis Parameters.....	15
Critical PCIs	15
Localized Preventive Maintenance Policies and Unit Costs.....	15
Major Rehabilitation Unit Costs.....	15
Budget and Inflation Rate.....	15
Analysis Approach.....	15
Analysis Results	16
General Maintenance Recommendations.....	17
FAA Requirements (Public Law 103-305).....	17
FAA Advisory Circular 150/5830-7B, Appendix A. Pavement Management Program (PMP).....	18
SUMMARY	24
REFERENCES.....	25

LIST OF FIGURES

Figure 1. Pavement condition versus cost of repair.	1
Figure 2. Pavement area by branch use at Council Bluffs Municipal Airport.	4
Figure 3. Council Bluffs Municipal Airport network definition map.	5
Figure 4. Visual representation of PCI scale on typical pavement surfaces.	7
Figure 5. PCI versus repair type.....	8
Figure 6. Pavement area by PCI range at Council Bluffs Municipal Airport.....	9
Figure 7. Area-weighted PCI by branch use at Council Bluffs Municipal Airport.	9
Figure 8. Council Bluffs Municipal Airport PCI map.....	10

LIST OF TABLES

Table 1. 2026 pavement evaluation results.....	11
Table 2. 5-year M&R program under an unlimited funding analysis scenario.	16
Table 3. Pavement inspection report.....	20

APPENDICES

Appendix A. Cause of Distress TablesA-1

Appendix B. Inspection PhotographsB-1

Appendix C. Inspection Report..... C-1

Appendix D. Work History Report D-1

Appendix E. Localized Preventive Maintenance Policies and Unit Cost Tables.....E-1

Appendix F. Year 2026 Localized Preventive Maintenance Details F-1


INTRODUCTION

Applied Pavement Technology, Inc. (APTech), with assistance from Robinson Engineering Company Consulting Engineers (Robinson), updated the airport pavement management system (APMS) for the Iowa Department of Transportation, Modal Transportation Bureau (Iowa DOT). The APMS provides a means to monitor the condition of the pavements in the State of Iowa and to proactively plan for their preservation.

As part of this project, pavement conditions at Council Bluffs Municipal Airport were visually assessed in March 2026 using the Pavement Condition Index (PCI) procedure. During a PCI inspection, the types, severities, and amounts of distress present on the pavement surface are quantified. This information is then used to develop a composite index that represents the overall condition of the pavement in numerical terms, ranging from 0 (*Failed*) to 100 (*Excellent*). The PCI provides an overall measure of condition and an indication of the level of work that will be required to maintain or repair a pavement. The distress information also provides insight into what is causing the pavement to deteriorate, which is the first step in selecting the appropriate repair action to correct the problem.

Programmed into an APMS, PCI data and results are used to determine when preventive maintenance actions (such as crack or joint sealing) are advisable and to identify the most cost-effective time to perform major rehabilitation (such as an overlay or whitetopping). Delaying maintenance and rehabilitation (M&R) until a pavement structure has seriously degraded can cost many times more than if M&R was applied earlier in a pavement's life cycle, as shown in Figure 1. From a safety perspective, pavement distresses, such as cracks and loose debris, may pose risks in terms of the potential for aircraft tire damage and the ability of a pilot to safely control aircraft.

Figure 1. Pavement condition versus cost of repair.

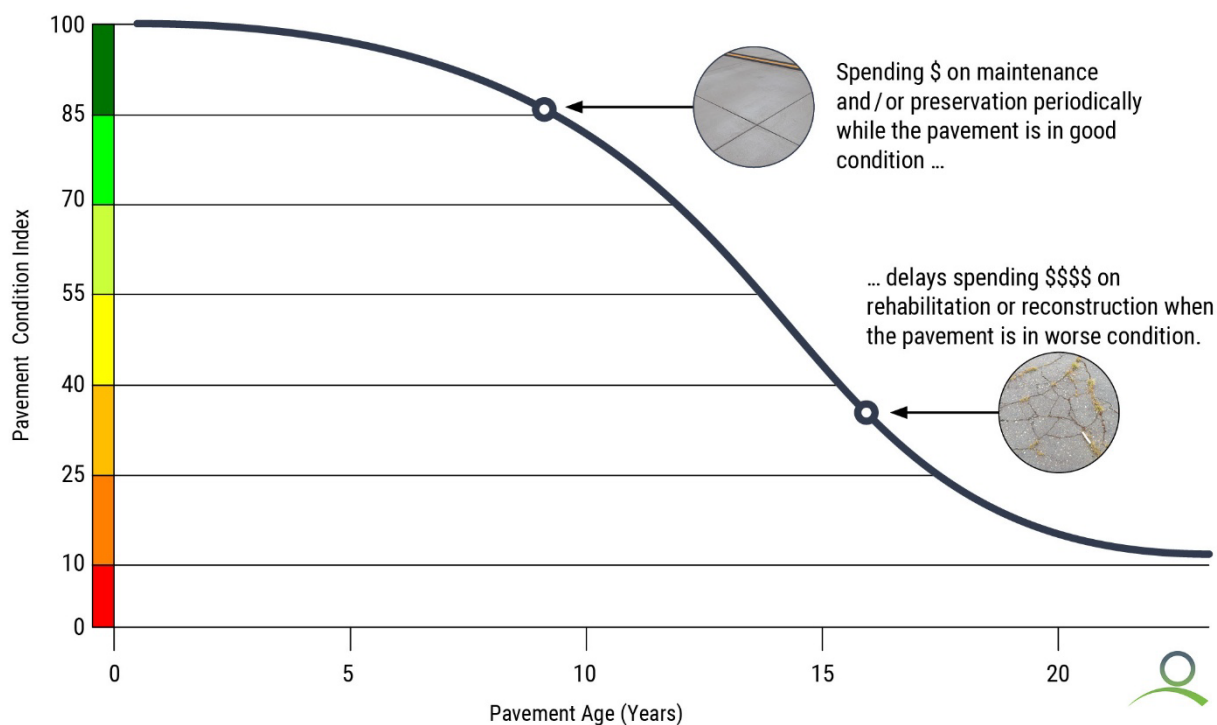

The pavement evaluation results for Council Bluffs Municipal Airport are presented in this report and can be used by Council Bluffs Municipal Airport, the Iowa DOT, and the Federal Aviation Administration (FAA) to identify, prioritize, and schedule pavement M&R actions at the airport. In addition to this report, the web-based interactive pavement data visualization tool IDEA, containing the information collected during this project, was updated and may be accessed from the [Iowa DOT's website](#) or directly ([Iowa APMS IDEA](#)).

PAVEMENT INVENTORY

The project began with a review of the existing inventory information pertaining to the pavements at Council Bluffs Municipal Airport. The date of original construction, along with the date of any subsequent rehabilitation; the location of completed work; and the type of work undertaken were gathered. The information was used to update the pavement management database and associated maps, as necessary, to account for pavement-related work that had been undertaken since the last time the airport was evaluated in 2022.

The pavement network at Council Bluffs Municipal Airport was then divided into branches, sections, and sample units. A branch is a single entity that serves a distinct function. For example, a runway is considered a branch because it serves a single function (allowing aircraft to take off and land). Taxiways, aprons, and T-hangars are also separate branches.

Each branch was further divided into sections. Traditionally, sections are defined as parts of the branch that share common attributes, such as cross section, date of last construction, traffic level, and performance. Using this approach, if a runway was built in 1968 and then extended in 1984, it would contain two separate sections.

To estimate the overall condition of a pavement section, each section was subdivided into sample units. Portions of these sample units were evaluated during the pavement inspection, and the collected information was extrapolated to predict the overall section condition and quantities of distress.

Approximately 1,540,500 square feet of pavement were evaluated at Council Bluffs Municipal Airport, as illustrated in Figure 2. This figure also shows the area-weighted age in years of the pavements at the time of the inspection. Figure 3 is a map that details how the pavement network was divided into management units and identifies the sample units that were evaluated during the pavement inspection at Council Bluffs Municipal Airport.

Figure 2. Pavement area by branch use at Council Bluffs Municipal Airport.


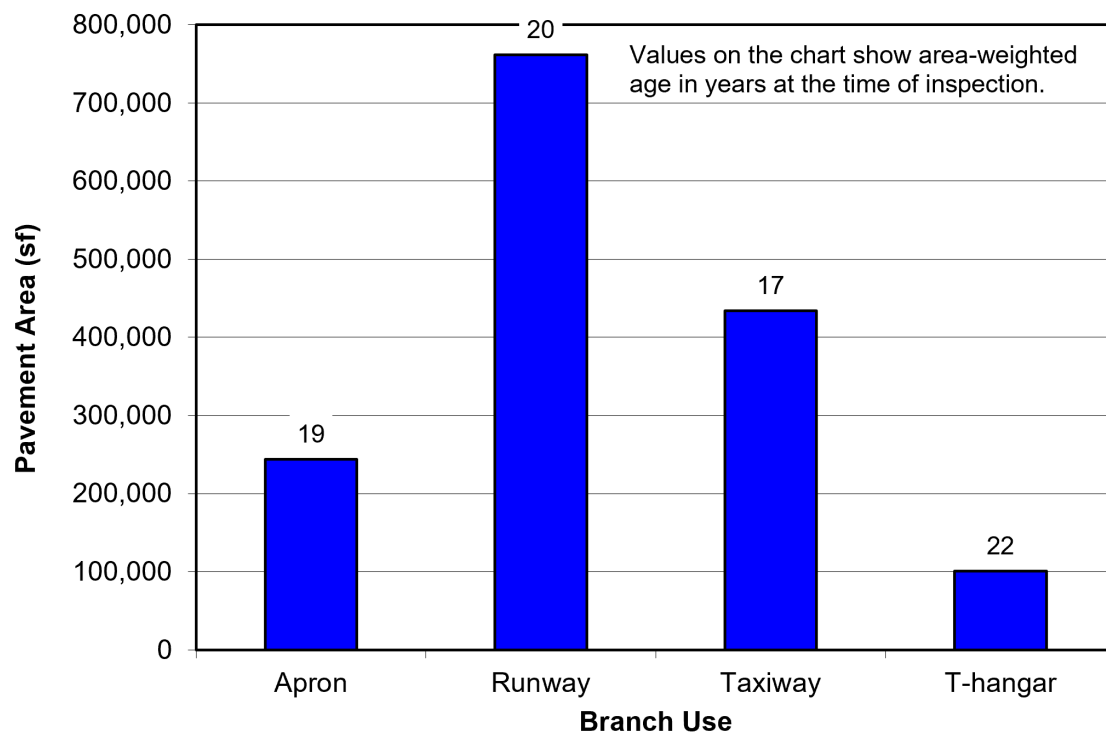


FIGURE 3. NETWORK DEFINITION MAP.

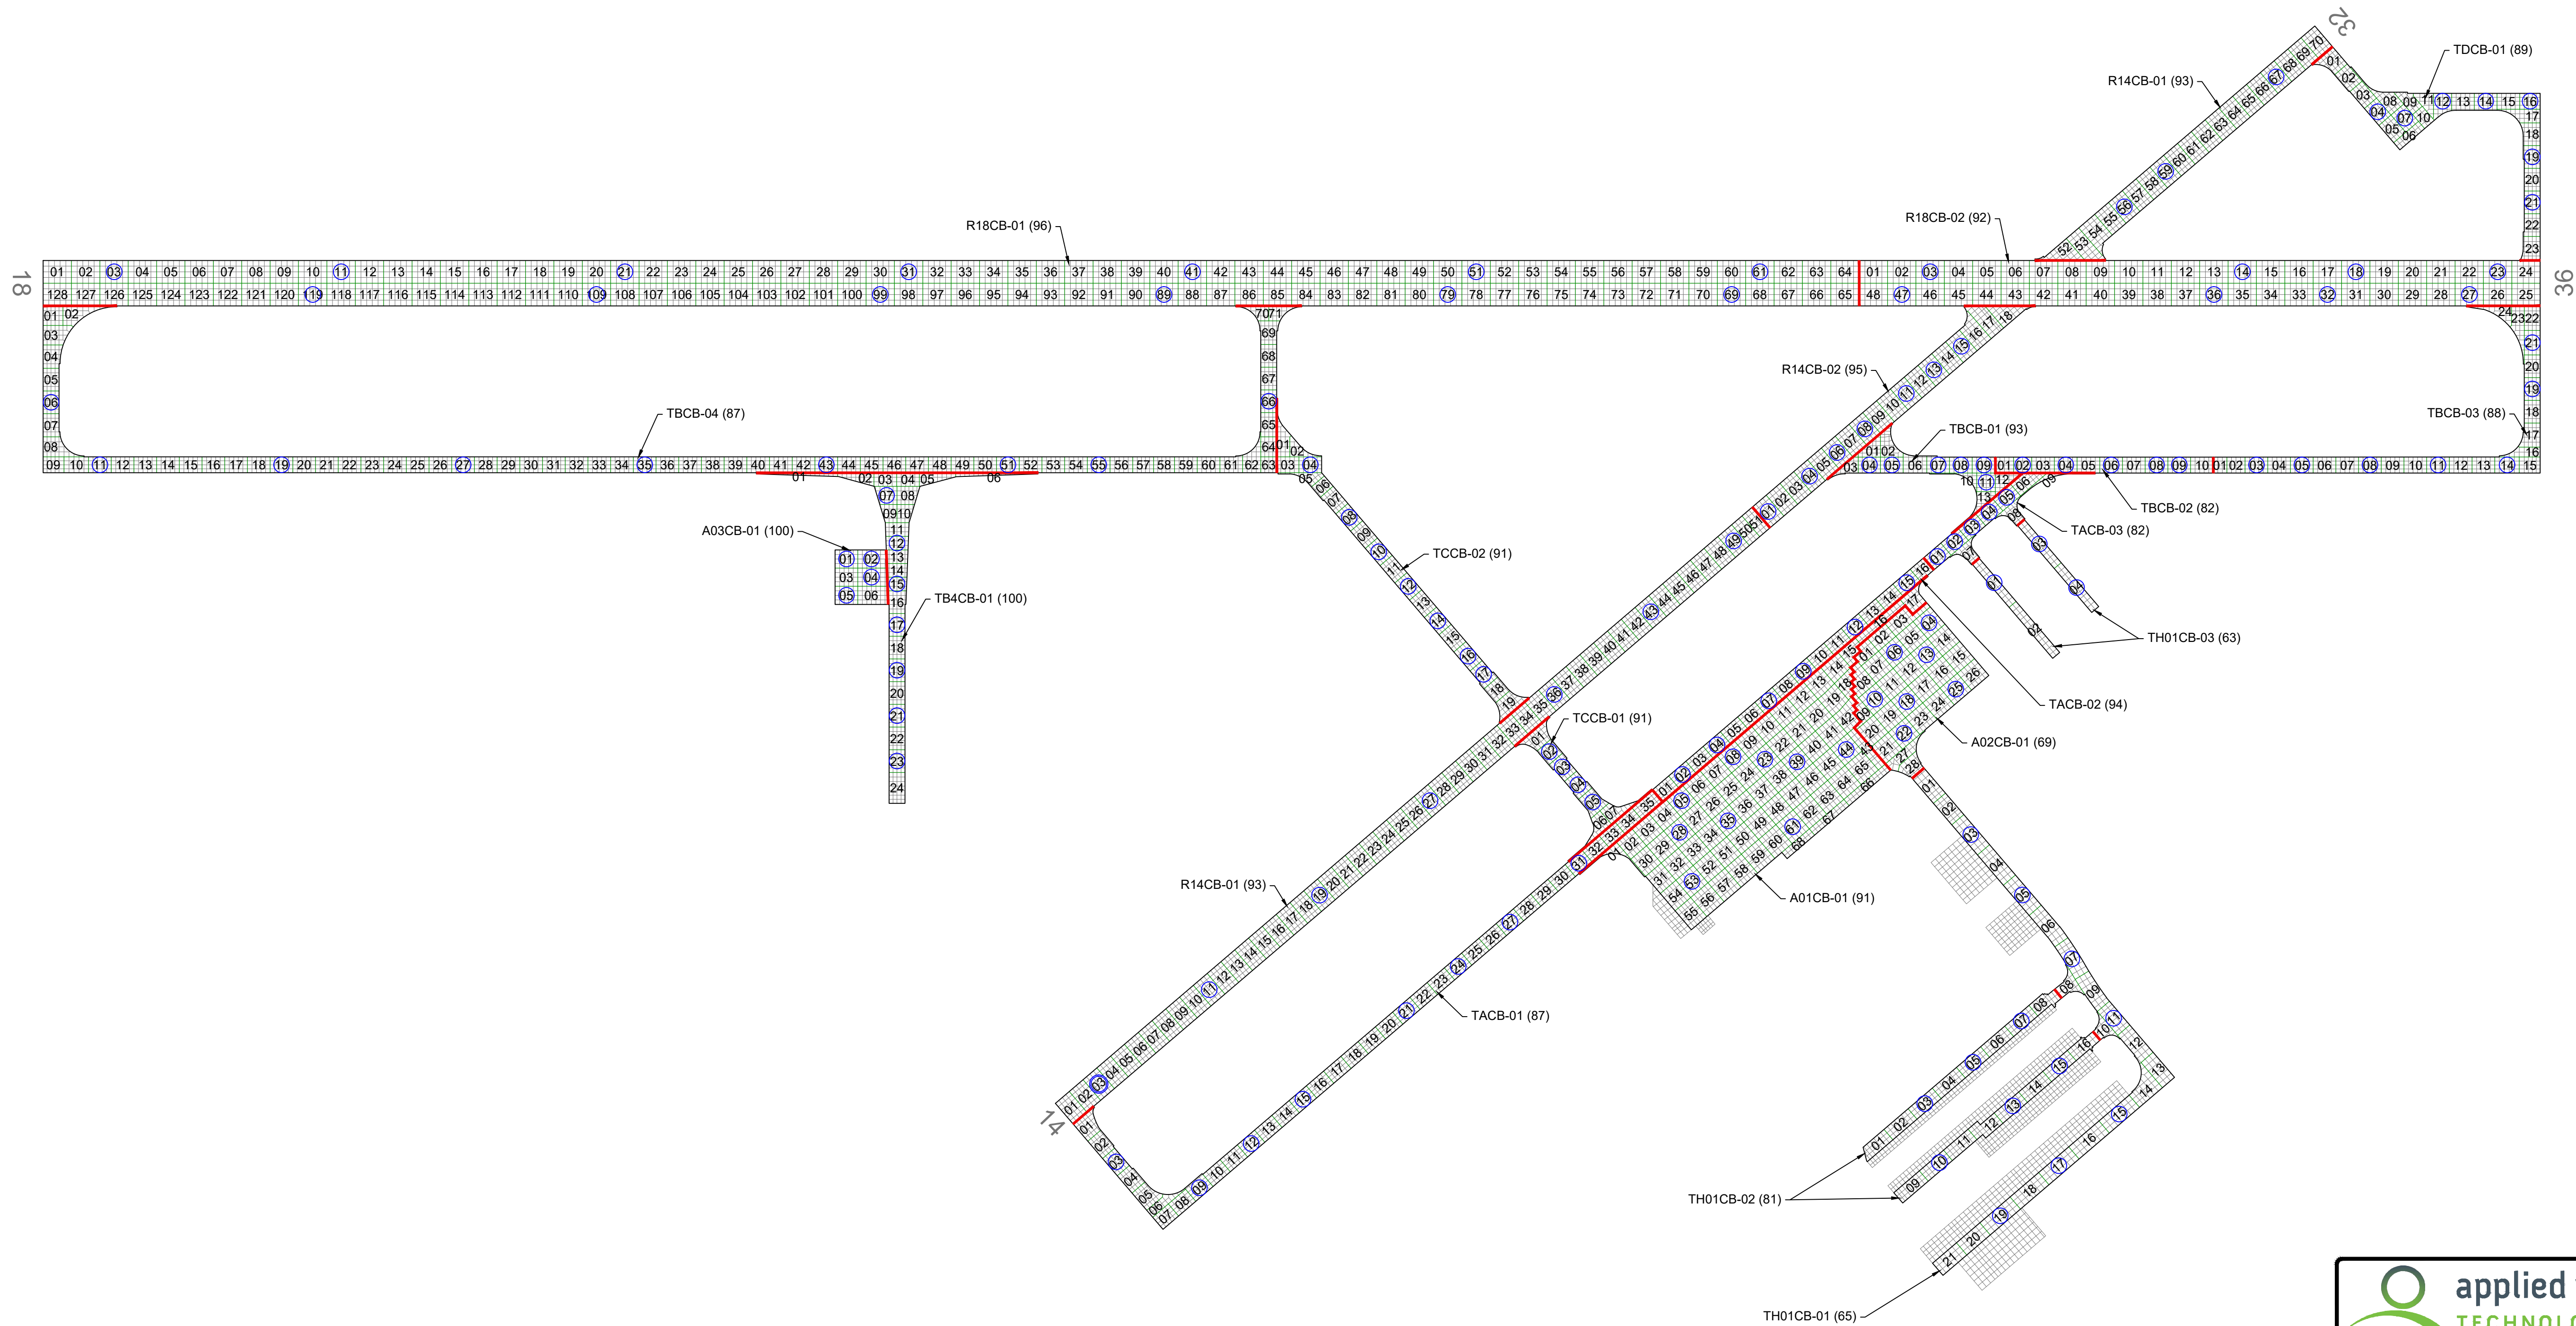

NETWORK DEFINITION LEGEND			
	BRANCH IDENTIFIER		
	SECTION IDENTIFIER		
	PCI VALUE		
	SECTION BREAK LINE		
	SAMPLE UNIT BREAK LINE		
	SLAB JOINT		
	SAMPLE UNIT NUMBER		
	SAMPLE UNIT INSPECTED		
	ADDITIONAL SAMPLE UNIT		

1908 South First Street, Suite 201 Champaign, Illinois 61820 Tel: 217-398-3977 Fax: 217-398-4027			
AGENCY: Iowa Department of Transportation			
Modal Transportation Bureau			
LOCATION: Council Bluffs Municipal Airport			
Council Bluffs, Iowa			
PAGE TITLE: Network Definition Map			
PROJECT DATE: NOV. 2025	CREATION DATE: NOV. 2025	PROJECT MANAGER: LJR	JOB NUMBER: 2021-125-AM04
DRAWING SCALE: 1"=200'	LAST MODIFIED DATE: JUN. 2026	REVISED BY: KEW	DRAWN BY: KEW
FILENAME: Council Bluffs.dwg	LAYOUT NAME/NUMBER: NET. DEF.	PAGE NUMBER: 5	

PAVEMENT EVALUATION

Pavement Evaluation Procedure

APTech visually inspected the pavements at Council Bluffs Municipal Airport using the PCI procedure described in the following publications:

- FAA Advisory Circular 150/5380-6C, *Guidelines and Procedures for Maintenance of Airport Pavements* (FAA 2014a).
- FAA Advisory Circular 150/5380-7B, *Airport Pavement Management Program (PMP)*; (FAA 2014b).
- ASTM D5340, *Standard Test Method for Airport Pavement Condition Index Surveys* (ASTM 2024).
- USACE *PAVER Distress Identification Manuals* (USACE 2009a, 2009b).

During the PCI inspection, a cursory inspection of the entirety of a pavement section was performed. Sample units identified for more detailed inspection were verified, and adjustments to the selected sample units for inspection were made as needed to ensure an accurate assessment of the pavement's condition. Data pertaining to the types, severities, and quantities of observed pavement distresses were then collected within each sample unit. These data were then used to calculate the composite PCI of each pavement section. The PCI provides a numerical indication of overall pavement condition, as illustrated in Figure 4. The PCI ranges from a value of 0, which represents a pavement in a *Failed* condition, to a value of 100, which represents a pavement in *Excellent* condition with no visible signs of deterioration. It is important to note that factors other than overall PCI need to be considered when identifying the appropriate type of repair, including types of distress present and rate of deterioration. Also, since the PCI does not assess the structural integrity or capacity of the pavement structure, further testing may be needed to validate and refine the treatment strategy.


Figure 4. Visual representation of PCI scale on typical pavement surfaces.



Note: Photographs shown are not specific to Council Bluffs Municipal Airport.

Generally, pavements with relatively high PCIs that are not exhibiting significant load-related distress will benefit from preventive maintenance actions, such as crack sealing or joint resealing. As the PCI drops, the pavements may require major rehabilitation, such as an overlay or whitetopping. In some situations where the PCI has dropped low enough, reconstruction may be the only viable alternative due to the substantial damage to the pavement structure. Figure 5 illustrates how the appropriate repair type varies with the PCI of a pavement section and provides the corresponding colors used on the maps and charts in this report for each PCI range.

Figure 5. PCI versus repair type.

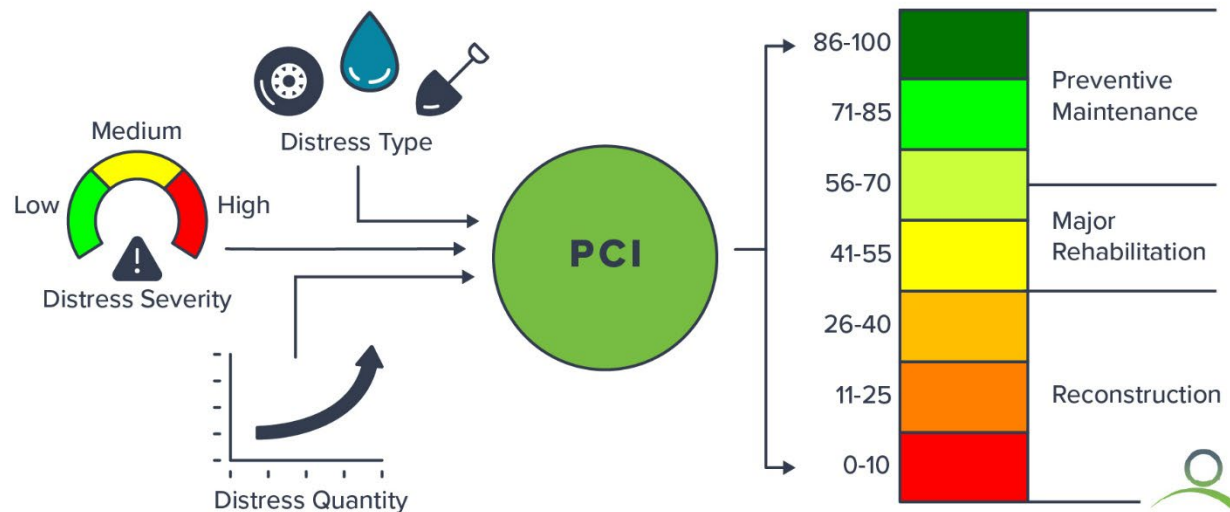

The types of distress identified during the PCI inspection provide insight into the cause of pavement deterioration, which is useful when selecting M&R strategies. Understanding the cause of distress helps in selecting a rehabilitation alternative that corrects the cause and thus eliminates or delays its recurrence. Appendix A identifies the distress types considered during a PCI inspection and describes the likely cause of each distress type. The PCI procedure is based on visual signs of pavement deterioration and does not provide a measure of structural capacity. PCI distress types are characterized as follows:

- Load-related distress types are caused by aircraft or vehicular traffic and may indicate a structural deficiency. Examples of load-related distress include alligator cracking on asphalt-surfaced pavements and shattered slabs or corner breaks on concrete pavements.
- Climate- and durability-related distress types often signify the presence of aged or environmentally susceptible (or both) material and include durability-related issues. Examples of climate- and durability-related distress include weathering on asphalt-surfaced pavements, which is climate related, and durability cracking on concrete pavements, which is durability related.
- Other distress types cannot be attributed solely to load or climate/durability. Examples of this type of distress include depressions on asphalt-surfaced pavements and shrinkage cracking on concrete pavements.

Pavement Evaluation Results

The pavements at Council Bluffs Municipal Airport were inspected in March 2026. The 2026 area-weighted condition of Council Bluffs Municipal Airport is 90, with conditions ranging from 63 to 100 (on a scale of 0 [*Failed*] to 100 [*Excellent*]). During the previous pavement inspection in 2022, the area-weighted PCI of the airport was 87.

Figure 6 summarizes the overall condition of the pavements at Council Bluffs Municipal Airport, and Figure 7 presents area-weighted condition (average PCI adjusted to account for the relative size of the pavement sections) by branch use. Figure 8 is a map that displays the condition of the evaluated pavements. Table 1 summarizes the results of the pavement evaluation. Appendix B presents photographs taken during the PCI inspection, and Appendix C contains detailed information on the distress types observed during the visual survey. Appendix D includes detailed work history information that was collected during the record review process.

Figure 6. Pavement area by PCI range at Council Bluffs Municipal Airport.



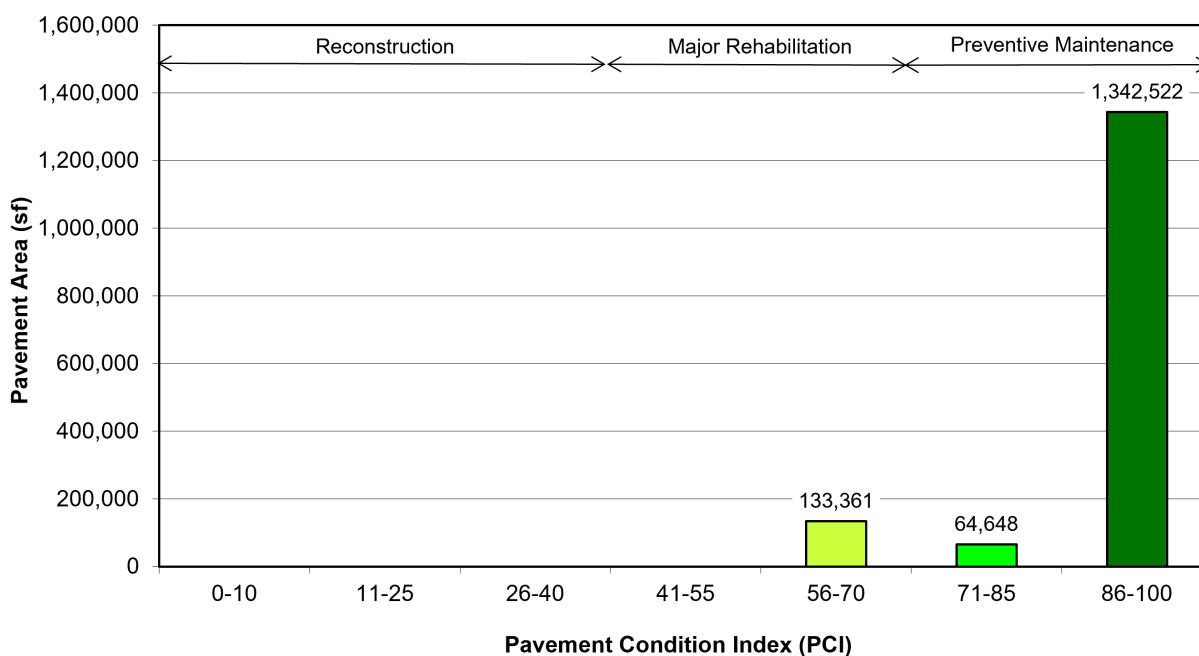
Figure 7. Area-weighted PCI by branch use at Council Bluffs Municipal Airport.
(Values on chart are area weighted.)

FIGURE 8. PCI MAP.

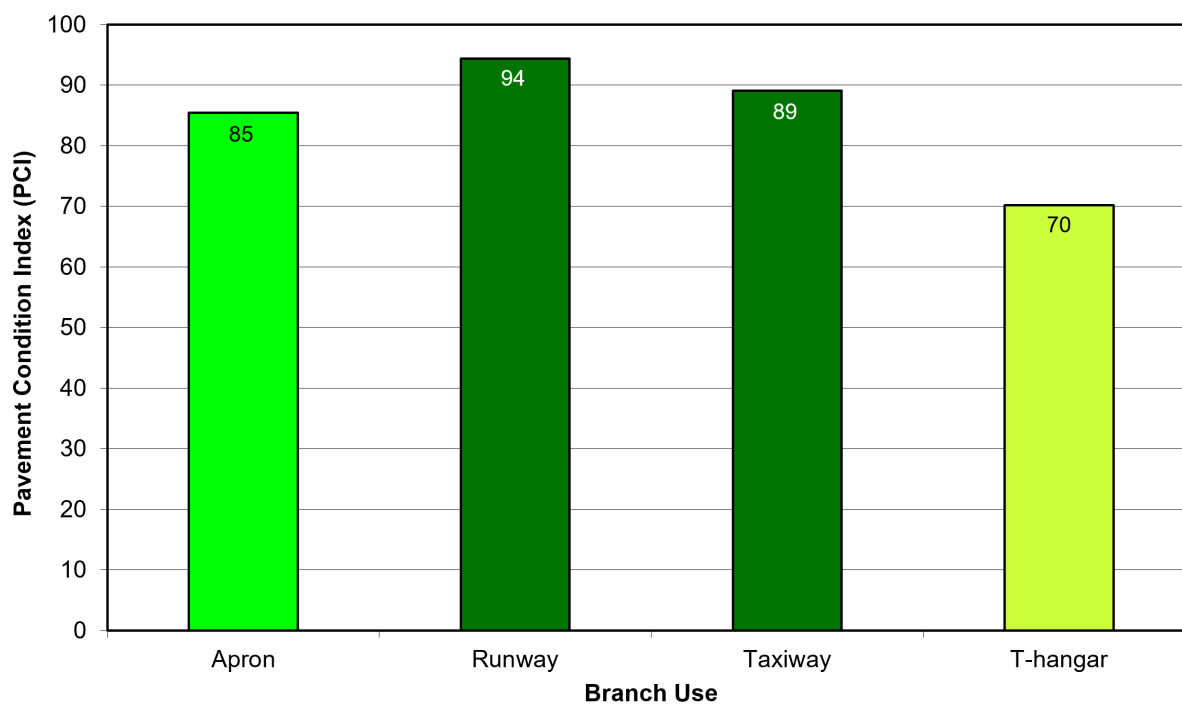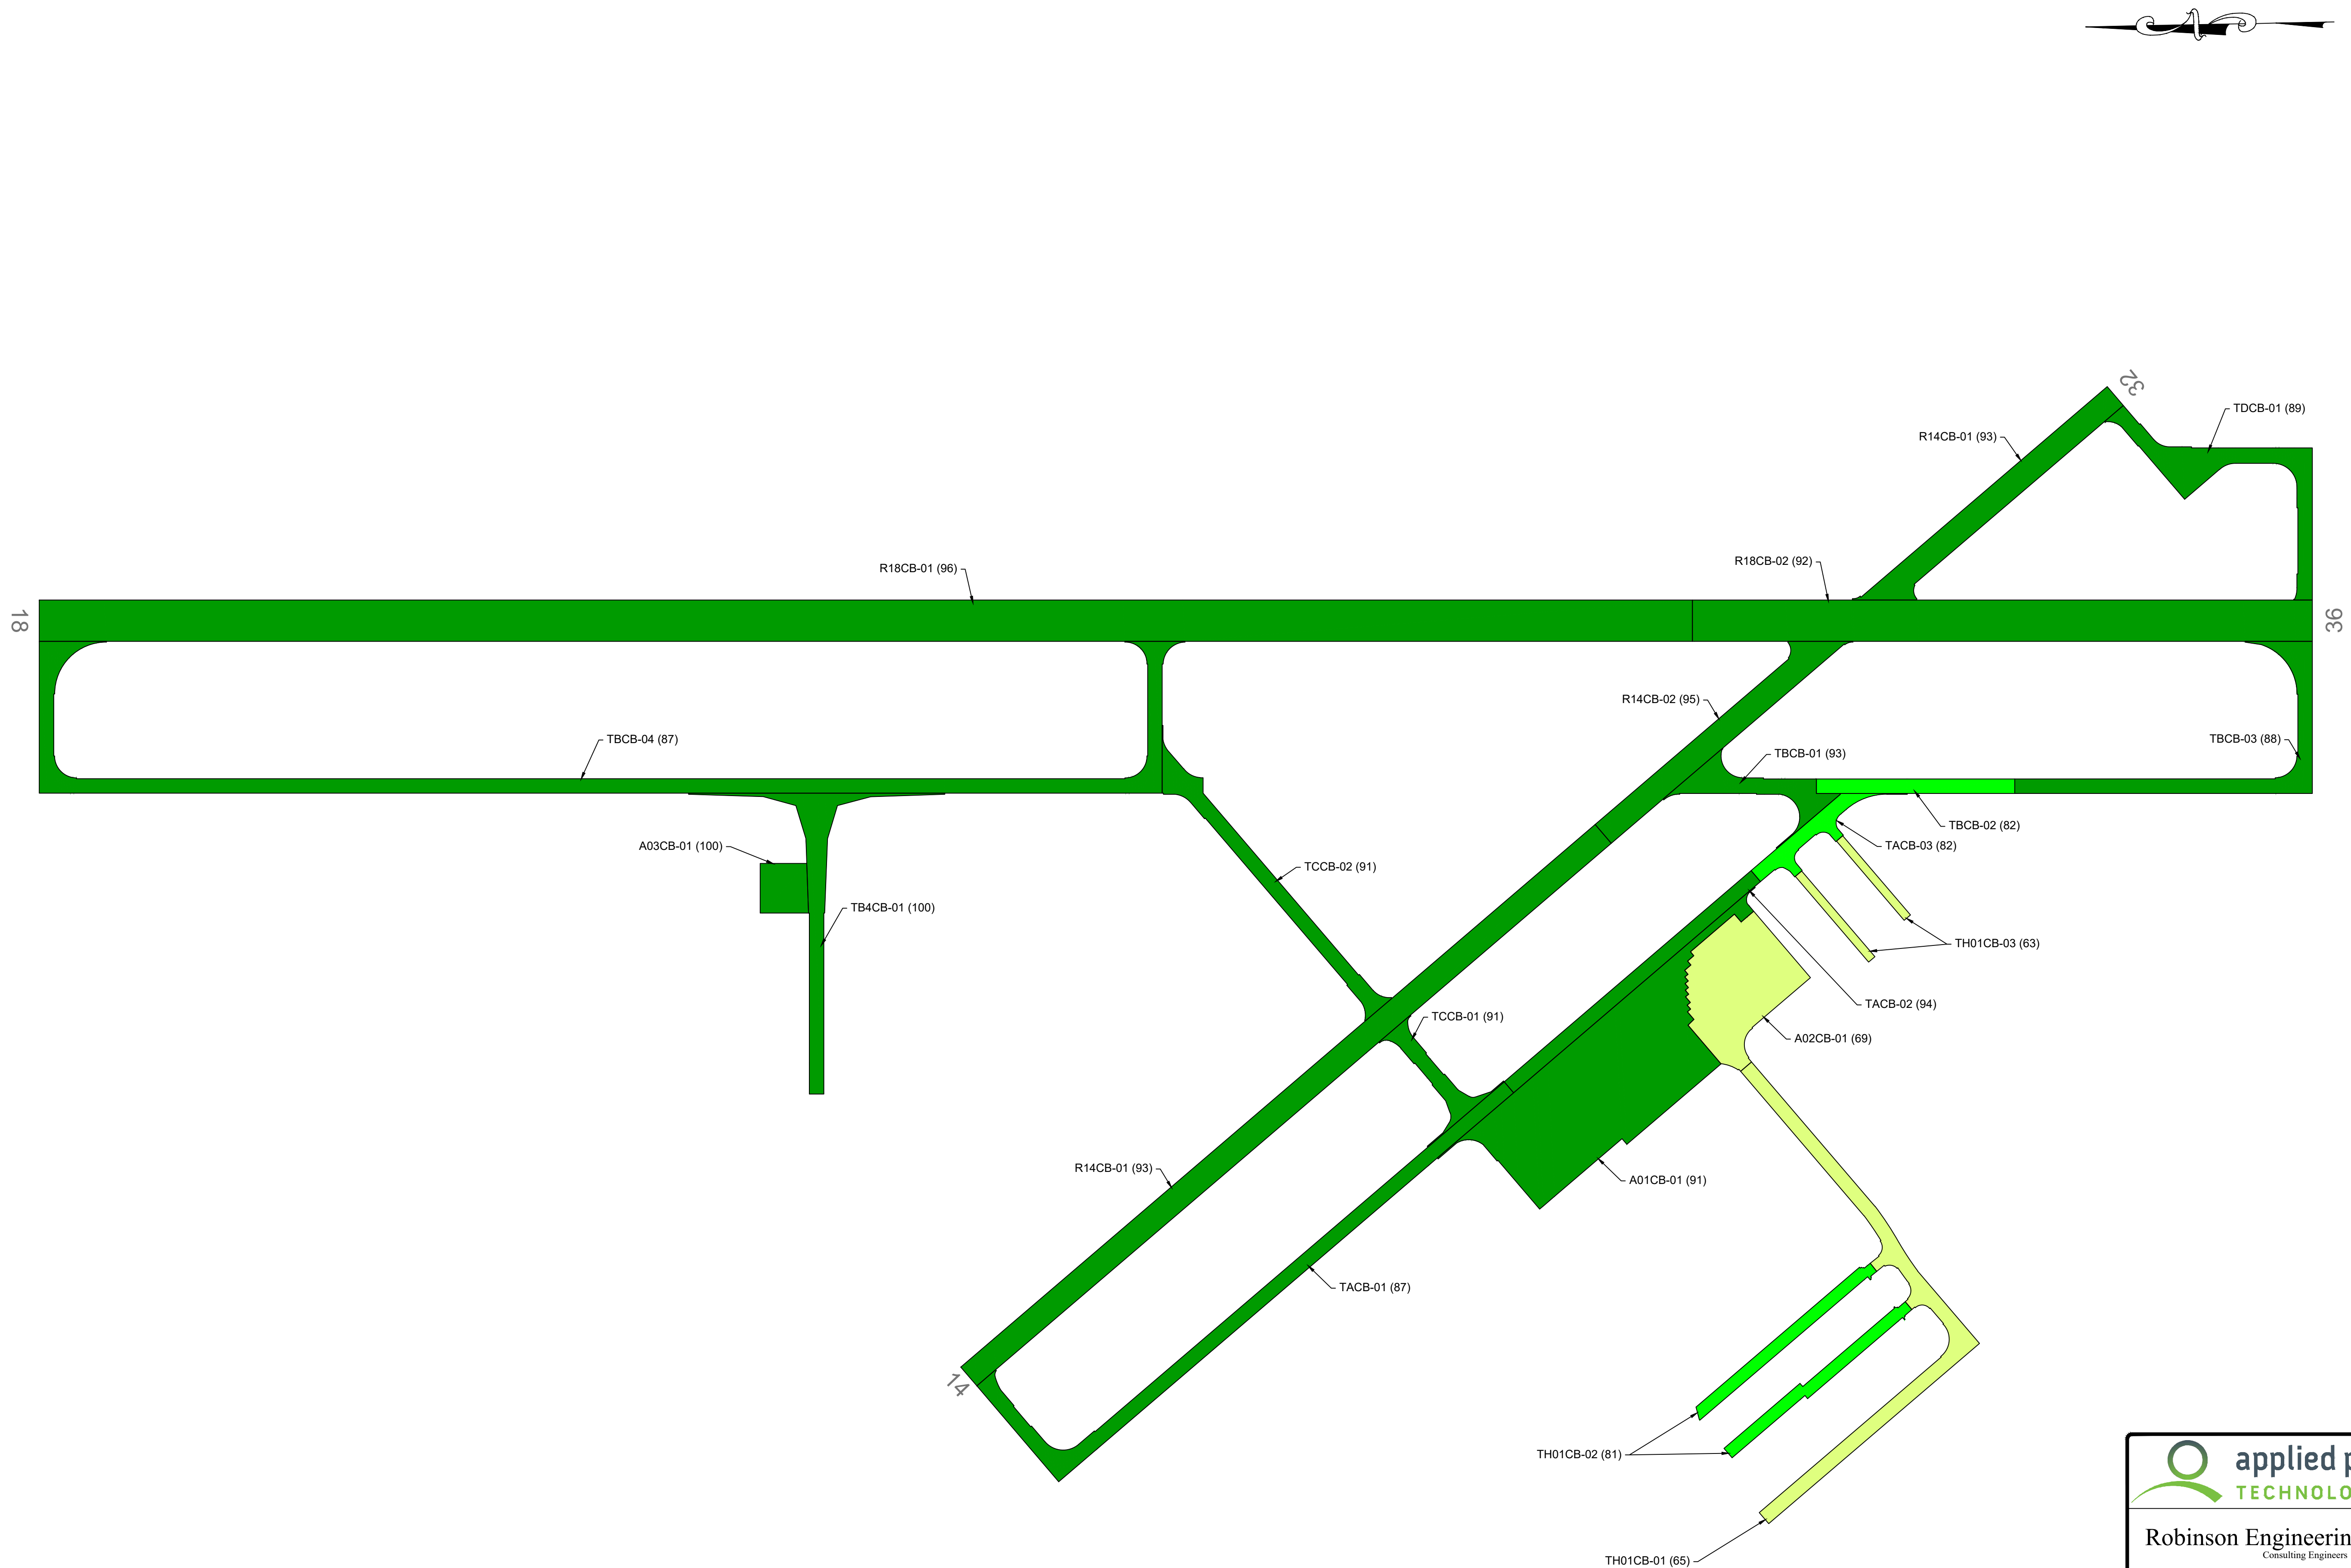

LEGEND

- BRANCH IDENTIFIER
- SECTION IDENTIFIER
- PCI VALUE
- SECTION BREAK LINE

PAVEMENT CONDITION INDEX

PCI

86-100
71-85
56-70
41-55
26-40
11-25
0-10

applied pavement TECHNOLOGY

1908 South First Street, Suite 201
Champaign, Illinois 61820
Tel: 217-398-3977
Fax: 217-398-4027

Robinson Engineering Company

1545 Dalton Street
Jesup, Iowa 50648
563-920-5382

AGENCY: Iowa Department of Transportation

LOCATION: Modal Transportation Bureau
Council Bluffs Municipal Airport
Council Bluffs, Iowa

PAGE TITLE: 2026 Pavement Condition Index Map

PROJECT DATE: NOV. 2025	CREATION DATE: NOV. 2025	PROJECT MANAGER: LJR	JOB NUMBER: 2021-125-AM04
DRAWING SCALE: 1"=200'	LAST MODIFIED DATE: JUL. 2026	REVISED BY: KEW	DRAWN BY: KEW
FILENAME: Council Bluffs.dwg		LAYOUT NAME/NUMBER: PCI	PAGE NUMBER: 10

Table 1. 2026 pavement evaluation results.

Branch	Section	Surface Type	Section Area (sf)	LCD	2026 PCI	% Distress Due to Load	% Distress Due to Climate/Durability	% Distress Due to Other	Type of Distress
A01CB	01	PCC	164,387	6/3/2010	91	11	87	2	Corner Spalling, Joint Seal Damage, LTD Cracking
A02CB	01	PCC	66,015	9/1/1995	69	42	19	39	ASR, Corner Break, Corner Spalling, Faulting, Joint Spalling, Joint Seal Damage, LTD Cracking, Shattered Slab, Shrinkage Cracking, Small Patch
A03CB	01	PCC	13,788	6/1/2025	100	0	0	0	No Distress
R14CB	01	PCC	167,703	6/3/2007	93	80	0	20	Corner Break, Faulting, LTD Cracking, Popouts, Shattered Slab
R14CB	02	PCC	44,038	6/3/2007	95	59	0	41	Faulting, Joint Spalling, LTD Cracking, Shrinkage Cracking
R18CB	01	PCC	400,000	6/3/2006	96	16	0	84	Corner Spalling, Faulting, Joint Spalling, Large Patch, LTD Cracking, Scaling, Small Patch
R18CB	02	PCC	150,000	6/3/2007	92	0	0	100	Corner Spalling, Faulting, Joint Spalling, Popouts, Shrinkage Cracking
TACB	01	PCC	62,015	6/3/2007	87	4	72	24	Corner Spalling, Faulting, Joint Spalling, Joint Seal Damage, LTD Cracking, Popouts, Shrinkage Cracking
TACB	02	PCC	27,570	11/3/2009	94	10	82	8	Corner Spalling, Joint Seal Damage, LTD Cracking
TACB	03	PCC	14,392	6/3/2007	82	0	55	45	Corner Spalling, Faulting, Joint Spalling, Joint Seal Damage
TB4CB	01	PCC	38,040	5/3/2024	100	0	0	0	No Distress
TBCB	01	PCC	21,182	6/3/2009	93	0	94	6	Corner Spalling, Joint Seal Damage
TBCB	02	PCC	16,800	6/3/2009	82	3	60	37	Corner Break, Corner Spalling, Faulting, Joint Seal Damage, Shrinkage Cracking, Small Patch
TBCB	03	PCC	41,805	6/3/2006	88	14	65	21	Corner Spalling, Faulting, Joint Spalling, Joint Seal Damage, LTD Cracking, Shrinkage Cracking, Small Patch

Table 1. 2026 pavement evaluation results (continued).

Branch	Section	Surface Type	Section Area (sf)	LCD	2026 PCI	% Distress Due to Load	% Distress Due to Climate/ Durability	% Distress Due to Other	Type of Distress
TBCB	04	PCC	125,508	6/3/2006	87	24	66	10	Corner Break, Corner Spalling, Joint Spalling, Joint Seal Damage, LTD Cracking, Shrinkage Cracking
TCCB	01	PCC	13,340	6/3/2007	91	0	100	0	Joint Seal Damage
TCCB	02	PCC	32,471	6/3/2007	91	0	71	29	Corner Spalling, Joint Seal Damage, Popouts
TDCB	01	PCC	40,675	9/3/2009	89	0	100	0	Joint Seal Damage
TH01CB	01	PCC	56,846	6/1/2004	65	57	21	22	ASR, Corner Spalling, Joint Spalling, Joint Seal Damage, LTD Cracking, Shattered Slab, Shrinkage Cracking, Small Patch
TH01CB	02	PCC	33,456	11/3/2008	81	19	48	33	Corner Break, Corner Spalling, Faulting, Joint Spalling, Joint Seal Damage, LTD Cracking, Shrinkage Cracking
TH01CB	03	PCC	10,500	1/1/1995	63	62	29	9	Corner Break, Faulting, Joint Seal Damage, LTD Cracking, Shattered Slab, Shrinkage Cracking

Table notes:

1. See Figure 3 for the location of the branch and section.
2. Surface type: AC = asphalt cement concrete; AAC = asphalt overlay on AC; PCC = portland cement concrete; APC = asphalt overlay on concrete.
3. LCD = last construction date.
4. Distress due to load includes distress types that are attributed to a structural deficiency in the pavement, such as alligator cracking or rutting on asphalt-surfaced pavements or shattered slabs on concrete pavements.
5. Distress due to climate or durability includes distress types that are attributed to either the aging of the pavement and the effects of the environment (such as weathering, raveling, or block cracking on asphalt-surfaced pavements) or to a materials-related problem (such as durability cracking or alkali-silica reaction [ASR] on concrete pavements). If materials-related distresses were recorded during the inspection, further laboratory testing is required to definitively determine the type present.
6. Distress due to other refers to distress types that are not attributed to one factor but rather may be caused by a combination of factors.
7. Distress types are defined by ASTM D5340. L&T cracking = longitudinal and transverse cracking; LTD cracking = longitudinal, transverse, and diagonal cracking; ASR = alkali-silica reaction.

Inspection Comments

Council Bluffs Municipal Airport was inspected on March 26 and 27, 2026. Twenty-one pavement sections were defined during the inspection.

Runway

Runway 14/32 consisted of two sections. Section 01 contained low- and medium-severity longitudinal, transverse, and diagonal (LTD) cracking; low-severity faulting; and popouts. An atypical area containing low- and medium-severity corner break and medium-severity shattered slab was observed and recorded as an additional sample unit in accordance with ASTM D5340. Low-severity faulting and joint spalling, low- and medium-severity LTD cracking, and shrinkage cracking were recorded in Section 02.

Runway 18/36 was defined by two sections. Section 01 was in *Excellent* condition. Low- and medium-severity corner spalling and low-severity faulting, joint spalling, large patching, LTD cracking, scaling, and small patching were observed in this section. Section 02 had low-severity joint spalling and corner spalling, all severities of faulting, popouts, and shrinkage cracking recorded at the time of inspection.

Taxiways

Taxiway A consisted of three sections. Section 01 contained low-severity joint spalling, corner spalling, faulting, and LTD cracking; medium- and high-severity joint seal damage; popouts; and shrinkage cracking. Medium-severity corner spalling, low- and medium-severity joint seal damage, and low-severity LTD cracking were identified in Section 02. Section 03 had medium-severity joint spalling and corner spalling, low- and medium-severity faulting, and high-severity joint seal damage.

Taxiway B4 was defined by one section that was in *Excellent* condition with no distress noted at the time of inspection.

Taxiway B contained four sections. Section 01 contained low-severity corner spalling and medium-severity joint seal damage. Low-severity corner break and faulting, low- and medium-severity corner spalling, medium- and high-severity joint seal damage, shrinkage cracking, and medium-severity small patching were observed in Section 02. Section 03 had low-severity corner spalling, faulting, and small patching; medium- and high-severity joint seal damage; low- and medium-severity joint spalling and LTD cracking; and shrinkage cracking noted. Medium-severity corner break; low- and medium-severity joint spalling, corner spalling, and LTD cracking; medium- and high-severity joint seal damage; and shrinkage cracking were recorded in Section 04.

Taxiway C contained two sections. Medium- and high-severity joint seal damage were recorded throughout Section 01. Popouts and medium-severity corner spalling and joint seal damage were identified in Section 02.

Taxiway D consisted of one section that contained medium- and high-severity joint seal damage.

Aprons

Apron 01 was defined by one section with low-severity corner spalling, all severities of joint seal damage, and medium-severity LTD cracking.

Apron 02 consisted of one section. Low- and medium-severity ASR; medium-severity corner break, LTD cracking, and shattered slab; all severities of joint spalling and corner spalling; low-

severity faulting and small patching; high-severity joint seal damage; and shrinkage cracking were recorded in Section 01.

Apron 03 contained one section that was in *Excellent* condition with no distress observed.

T-Hangar

The T-hangar area consisted of three sections. Section 01 had low-severity ASR and small patching, low- and medium-severity corner spalling and LTD cracking, high-severity joint seal damage, medium- and high-severity joint spalling, medium-severity shattered slab, and shrinkage cracking recorded during the inspection. Low-severity corner break, corner spalling, and faulting; high-severity joint seal damage; all severities of joint spalling; low- and medium-severity LTD cracking; and shrinkage cracking were observed in Section 02. Section 03 contained medium-severity corner break, faulting, and shattered slab; medium- and high-severity joint seal damage; low- and medium-severity LTD cracking; and shrinkage cracking.

PAVEMENT MAINTENANCE AND REHABILITATION PROGRAM

Using the information collected during the pavement inspection, the PAVER pavement management software was used to develop a 5-year M&R program for Council Bluffs Municipal Airport (USACE 2021). In addition, a 1-year plan for localized preventive maintenance (such as crack sealing and patching) was prepared.

Analysis Parameters

Critical PCIs

PAVER uses critical PCIs to determine whether localized preventive maintenance or major rehabilitation is the appropriate repair action. Above the critical PCI, localized preventive maintenance activities are recommended. Below the critical PCI, major rehabilitation actions, such as an overlay or reconstruction, are recommended. The Iowa DOT set the critical PCIs at 65 for runways, 60 for taxiways, and 55 for aprons and T-hangars.

Localized Preventive Maintenance Policies and Unit Costs

Localized preventive maintenance policies were developed for asphalt-surfaced and concrete pavements. These policies, shown in Appendix E, identify the localized preventive maintenance actions that the Iowa DOT considered appropriate to correct the various distress types and severities. The Iowa DOT provided unit costs for each of the localized preventive maintenance actions included in these policies. These costs are detailed in Appendix E. This information is of a general nature for the entire State. The localized preventive maintenance policies and unit costs may require adjustments to reflect specific conditions at Council Bluffs Municipal Airport.

Major Rehabilitation Unit Costs

PAVER estimates the cost of major rehabilitation based on the predicted PCI of the pavement section. The Iowa DOT provided the costs for major rehabilitation. These costs are detailed in Appendix E. If major rehabilitation is recommended in the 5-year program, further engineering investigation will be needed to identify the most appropriate rehabilitation action and to estimate the cost of such work more accurately.

Budget and Inflation Rate

An unlimited budget with a start date of August 1, 2026, and an inflation rate of 2.3 percent was used during the analysis.

Analysis Approach

The 5-year M&R program was prepared with the goal of maintaining the pavements above established critical PCIs. During this analysis, major rehabilitation was recommended for pavements in the year they dropped below their critical PCI. For the first year (2026) of the analysis only, a localized preventive maintenance plan was developed for those pavement sections that were above their critical PCI. If major rehabilitation was triggered for a section in 2027 or 2028, then localized preventive maintenance was not recommended for 2026. While localized preventive maintenance should be an annual undertaking at Council Bluffs Municipal Airport, it is not possible to accurately predict the propagation of cracking and other distress types. Therefore, the airport should budget for maintenance every year and can use the 2026 localized preventive maintenance plan as a baseline for that work. As the pavements age, it can be assumed that the amount of localized preventive maintenance required will increase.

Analysis Results

A summary of the M&R program for Council Bluffs Municipal Airport is presented in Table 2. Detailed information on the recommended localized preventive maintenance plan for 2026 is in Appendix F.

Table 2. 5-year M&R program under an unlimited funding analysis scenario.

Year	Branch	Section	Surface Type	Type of Repair	Estimated Cost
2026	A01CB	01	PCC	Preventive Maintenance	\$86,092
2026	A02CB	01	PCC	Preventive Maintenance	\$74,925
2026	R14CB	01	PCC	Preventive Maintenance	\$3,771
2026	R14CB	02	PCC	Preventive Maintenance	\$88
2026	R18CB	01	PCC	Preventive Maintenance	\$1,104
2026	R18CB	02	PCC	Preventive Maintenance	\$34,984
2026	TACB	01	PCC	Preventive Maintenance	\$38,461
2026	TACB	02	PCC	Preventive Maintenance	\$8,812
2026	TACB	03	PCC	Preventive Maintenance	\$9,886
2026	TBCB	01	PCC	Preventive Maintenance	\$12,959
2026	TBCB	02	PCC	Preventive Maintenance	\$10,719
2026	TBCB	03	PCC	Preventive Maintenance	\$19,510
2026	TBCB	04	PCC	Preventive Maintenance	\$86,039
2026	TCCB	01	PCC	Preventive Maintenance	\$8,134
2026	TCCB	02	PCC	Preventive Maintenance	\$20,341
2026	TDCB	01	PCC	Preventive Maintenance	\$25,154
2026	TH01CB	01	PCC	Preventive Maintenance	\$41,290
2026	TH01CB	02	PCC	Preventive Maintenance	\$20,425
2026	TH01CB	03	PCC	Preventive Maintenance	\$10,614

Total Estimated Cost: \$513,000

Table notes:

1. See Figure 3 for the location of the branch and section.
2. Surface type: AC = asphalt cement concrete; AAC = asphalt overlay on AC; PCC = portland cement concrete; APC = asphalt overlay on concrete.
3. Type of repair: major rehabilitation, such as pavement reconstruction or an overlay; localized preventive maintenance, such as crack sealing or patching.
4. The estimated costs provided are of a general nature for the entire State and may require adjustments to reflect specific conditions at Council Bluffs Municipal Airport.

The recommendations made in this report are based on a broad network-level analysis and meant to provide Council Bluffs Municipal Airport with an indication of the type of pavement-related work required during the next 5 years. Further engineering investigation may be necessary to identify which repair action is most appropriate. In addition, the cost estimates provided are based on overall unit costs for the entire State, and Council Bluffs Municipal Airport should adjust the plan to reflect local costs.

Because an unlimited budget was used in the analysis, it is possible that the pavement repair program may need to be adjusted to consider economic or operational constraints. The identification of a project need does not necessarily mean that State or Federal funding will be

available in the year it is indicated. It is important to remember that regardless of the recommendations presented within this report, Council Bluffs Municipal Airport is responsible for repairing pavements where existing conditions pose a hazard to safe operations.

General Maintenance Recommendations

In addition to the specific maintenance actions presented in Appendix F, it is recommended that the following strategies be considered for prolonging pavement life:

1. Regularly inspect all safety areas of the airport and document all inspection activity. A sample form that can be used to perform these inspections is provided in Table 3 of this report.
2. Track all maintenance activities that occur and have the documentation available if requested by the FAA and the Iowa DOT. This is important because this information is used to update the APMS records and is required to remain in compliance with Public Law 103-305 (see the next section of this report for further information on this law).
3. Conduct an aggressive campaign against weed growth through timely herbicide applications and mowing programs of the safety areas. Vegetation growth in pavement cracks is destructive and significantly increases the rate of pavement deterioration.
4. Implement a periodic crack and joint sealing program. Keeping water and debris out of the pavement system by sealing cracks and joints is a proven and cost-effective method for extending the life of the pavement system.
5. Ensure all edges of pavement maintain the required 1.5-inch lip. This enables the water to drain away from the pavement system.
6. Closely monitor the movement of heavy equipment, such as farming, construction, mowing, emergency, and fueling equipment, to ensure such equipment is only operating on pavement designed to accommodate heavy loads. Failure to restrict heavy equipment to appropriate areas may result in the premature failure of airport pavements.
7. Other maintenance necessities include keeping all pavement markings well painted, safety signage clear of debris and weeds, the lighting systems continuously operational, and the operating areas free of debris found.

These recommendations are only a portion of the responsibility each sponsor has in maintaining an airport. Each airport sponsor must provide regular airport maintenance to all its aviation facilities both in the aircraft movement areas and all adjacent areas supporting aviation. It is particularly important to be vigilant in repairing pavements where conditions can pose a hazard to safe operations.

FAA Requirements (Public Law 103-305)

Because Council Bluffs Municipal Airport is in the National Plan of Integrated Airport Systems (NPIAS), the airport sponsor is required to keep the airport in a viable operating condition. This includes maintaining airport pavements in accordance with Public Law 103-305 (GPO 1994). Public Law 103-305 states that after January 1, 1995, NPIAS airport sponsors must provide assurances or certifications that an airport has implemented an effective airport pavement maintenance management system (PMMS) before the airport will be considered for Federal funding of pavement replacement or reconstruction projects. To be in full compliance with Federal law, the PMMS must include the following components at minimum: pavement inventory, pavement inspections, record keeping, information retrieval, and program funding.

By undertaking this project, the Iowa DOT has provided Council Bluffs Municipal Airport with an excellent basis for meeting the requirements of this law. This report serves as a complete

pavement inventory and detailed inspection. To remain in compliance with the law, Council Bluffs Municipal Airport will also need to undertake monthly drive-by inspections of pavement conditions and track pavement-related maintenance activities.

FAA Advisory Circular [150/5380-7B](#) (FAA 2014b) provides detailed guidance pertaining to the requirements for an acceptable pavement management program (PMP). Appendix A of the FAA Advisory Circular outlines what needs to be included in a PMP to remain in compliance with this law and Grant Assurance 11. The following is a copy of this appendix, along with instructions for supplementing this report so that all requirements are met. **Note that the italicized text is a direct quotation from the FAA Advisory Circular.**

FAA Advisory Circular 150/5830-7B, Appendix A. Pavement Management Program (PMP)

A-1.0. An effective PMP specifies the procedures to follow to assure that proper preventative and remedial pavement maintenance is performed. The program should identify funding or anticipated funding and other resources available to provide remedial and preventive maintenance activities. An airport sponsor may use any format deemed appropriate, but the program needs to, as a minimum, include the following:

A-1.1. Pavement Inventory. *The following must be depicted:*

- a. *Identification of all runways, taxiways, and aprons with pavement broken down into sections each having similar properties.*

The network definition map in Figure 3 of this report shows the location of all runways, taxiways, aprons, and T-hangars at Council Bluffs Municipal Airport. If any new pavements are constructed or any pavement areas are permanently closed, this map must be updated. Project plans should be submitted to the Iowa DOT after project completion.

- b. *Dimensions of pavement sections.*

The dimensions of all runways, taxiways, aprons, and T-hangars are stored in the PAVER database. Appendix C provides information on length, width, and area. In addition, the network definition map in Figure 3 is drawn to scale. Any changes to pavement dimensions must be recorded.

- c. *Type of pavement surface.*

The type of pavement for each section at Council Bluffs Municipal Airport is listed in Table 1 of this report and is also stored in the PAVER database. Any changes to the pavement type through an overlay or reconstruction must be recorded.

- d. *Year of construction and/or most recent major rehabilitation.*

Dates for pavement construction, rehabilitation, or reconstruction must be recorded. The current pavement history for Council Bluffs Municipal Airport is in Appendix D of this report.

- e. *Whether AIP [Airport Improvement Program] or PFC [Passenger Facility Charge] funds were used to construct, reconstruct, or repair the pavement.*

Funding sources for all pavement projects should be recorded.

A-1.2. PMP Pavement Inspection Schedule. *Airports must perform a detailed inspection of airfield pavements at least once a year for the PMP. If a pavement condition index (PCI) survey is performed, as set forth in ASTM D5340, Standard Test Method for Airport Pavement Condition Index Surveys, the frequency of the detailed inspection by PCI surveys may be*

extended to three years. Less comprehensive routine daily, weekly, and monthly maintenance inspections required for operations should be addressed.

This report consists of a detailed inspection that will extend the inspection period to 3 years. It is the airport sponsor's responsibility to perform monthly drive-by inspections. A sample pavement inspection report form is provided in Table 3 of this report.

A-1.3. Record Keeping. *The airport must record and keep on file complete information about all detailed inspections and maintenance performed until the pavement system is replaced. The types of distress, their locations, and remedial action, scheduled or performed, must be documented. The minimum information recorded includes:*

- a. Inspection date*
- b. Location*
- c. Distress types*
- d. Maintenance scheduled or performed*

Items *a* through *c* are satisfied by this inspection report. Item *d* is the responsibility of the airport, as is record keeping of the monthly drive-by inspections.

A-1.4. Information Retrieval. *An airport sponsor may use any form of record keeping it deems appropriate so long as the information and records from the pavement survey can generate required reports, as necessary.*

Keep this report, monthly drive-by inspection reports, construction updates, and all records of maintenance activities in a readily accessible location so that they can be easily retrieved as requested by the FAA.

Table 3. Pavement inspection report.

Inspected By: _____

Date Inspected: _____

Branch	Section	Distress Description/Dimensions/Severity/ Recommended Action	Description of Repair	Date Performed	Cost	Funding Source
A01CB	01					
A02CB	01					
A03CB	01					
R14CB	01					
R14CB	02					
R18CB	01					

Table 3. Pavement inspection report (continued).

Inspected By: _____

Date Inspected: _____

Branch	Section	Distress Description/Dimensions/Severity/ Recommended Action	Description of Repair	Date Performed	Cost	Funding Source
R18CB	02					
TACB	01					
TACB	02					
TACB	03					
TB4CB	01					
TBCB	01					

Table 3. Pavement inspection report (continued).

Inspected By: _____

Date Inspected: _____

Branch	Section	Distress Description/Dimensions/Severity/ Recommended Action	Description of Repair	Date Performed	Cost	Funding Source
TBCB	02					
TBCB	03					
TBCB	04					
TCCB	01					
TCCB	02					
TDCB	01					

Table 3. Pavement inspection report (continued).

Inspected By: _____

Date Inspected: _____

Branch	Section	Distress Description/Dimensions/Severity/ Recommended Action	Description of Repair	Date Performed	Cost	Funding Source
TH01CB	01					
TH01CB	02					
TH01CB	03					

Table note: See Figure 3 for the location of the branch and section.

SUMMARY

This report documents the results of the pavement evaluation conducted at Council Bluffs Municipal Airport. A visual inspection of the pavements in 2026 found that the overall condition of the pavement network is a PCI of 90. A 5-year pavement repair program, shown in Table 2, was generated for Council Bluffs Municipal Airport, which revealed that approximately \$513,000 needs to be expended on M&R. Council Bluffs Municipal Airport should utilize these study results to assist in planning for future maintenance needs as part of the airport CIP planning process.

REFERENCES

ASTM International (ASTM). 2024. *Standard Test Method for Airport Pavement Condition Index Surveys*. ASTM D5340. ASTM International, West Conshohocken, PA.

Federal Aviation Administration (FAA). 2014a. [Guidelines and Procedures for Maintenance of Airport Pavements](#). Advisory Circular 150/5380-6C. Federal Aviation Administration, Washington, DC.

Federal Aviation Administration (FAA). 2014b. [Airport Pavement Management Program \(PMP\)](#). Advisory Circular 150/5380-7B. Federal Aviation Administration, Washington, DC.

Government Printing Office (GPO). 1994. *Federal Aviation Administration Authorization Act of 1994*. P.L. 103-305. Vol 108. Stat. 1569.

U.S. Army Corps of Engineers (USACE). 2009a. [Asphalt Surfaced Airfields. PAVER Distress Identification Manual](#). USACE, Washington, DC.

U.S. Army Corps of Engineers (USACE). 2009b. [Concrete Surfaced Airfields. PAVER Distress Identification Manual](#). USACE, Washington, DC.

U.S. Army Corps of Engineers (USACE). 2021. PAVER. (Software). USACE, Transportation Systems Center, Omaha, NE.

APPENDIX A

CAUSE OF DISTRESS TABLES

Table A-1. Cause of pavement distress, asphalt-surfaced pavements (USACE 2009a).

Distress Type	Probable Cause of Distress
Alligator Cracking	Fatigue failure of the asphalt surface under repeated traffic loading.
Bleeding	Excessive amounts of asphalt cement or tars in the mix or low air void content, or both.
Block Cracking	Shrinkage of the asphalt and daily temperature cycling; it is not load associated.
Corrugation	Traffic action combined with an unstable pavement layer.
Depression	Settlement of the foundation soil or can be “built up” during construction.
Jet-Blast Erosion	Bituminous binder has been burned or carbonized.
Joint Reflection Cracking	Movement of the concrete slab beneath the asphalt surface due to thermal and moisture changes.
L&T Cracking	Cracks may be caused by (1) a poorly constructed paving lane joint, (2) shrinkage of the asphalt surface due to low temperatures or hardening of the asphalt, or (3) reflective cracking caused by cracks in an underlying concrete slab.
Oil Spillage	Deterioration or softening of the pavement surface caused by the spilling of oil, fuel, or other solvents.
Patching	N/A
Polished Aggregate	Repeated traffic applications.
Raveling	Asphalt binder may have hardened significantly, causing coarse aggregate pieces to dislodge.
Rutting	Usually caused by consolidation or lateral movement of the materials due to traffic loads.
Shoving	Where concrete pavements adjoin flexible pavements, concrete “growth” may shove the asphalt pavement.
Slippage Cracking	Low-strength surface mix or poor bond between the surface and the next layer of the pavement structure.
Swelling	Usually caused by frost action or by swelling soil.
Weathering	Asphalt binder and/or fine aggregate may wear away as the pavement ages and hardens.

Table A-2. Cause of pavement distress, concrete pavements (USACE 2009b).

Distress Type	Probable Cause of Distress
ASR	Chemical reaction of alkalis in the cement with certain reactive silica minerals. ASR may be accelerated by the use of chemical pavement deicers.
Blowup	Incompressible materials in the joints.
Corner Break	Load repetition combined with loss of support and curling stresses.
Durability Cracking	Concrete's inability to withstand environmental factors, such as freeze–thaw cycles.
Faulting	Upheaval or consolidation.
Joint Seal Damage	Stripping of joint sealant, extrusion of joint sealant, weed growth, hardening of the filler (oxidation), loss of bond to the slab edges, or absence of sealant in the joint.
LTD Cracking	Combination of load repetition, curling stresses, and shrinkage stresses.
Patching (Small and Large)	N/A
Popouts	Freeze–thaw action in combination with expansive aggregates.
Pumping	Poor drainage, poor joint sealant.
Scaling	Over finishing of concrete, deicing salts, improper construction, freeze–thaw cycles, and poor aggregate.
Shattered Slab	Load repetition.
Shrinkage Cracking	Setting and curing of the concrete.
Spalling (Joint and Corner)	Excessive stresses at the joint caused by infiltration of incompressible materials or traffic loads; weak concrete at the joint combined with traffic loads.

APPENDIX B

INSPECTION PHOTOGRAPHS

A01CB-01. Overview.



A01CB-01. Corner Spalling (Sample Unit No. 08).



A01CB-01. LTD Cracking (Sample Unit No. 61).



A02CB-01. Overview.



A02CB-01. Corner Spalling (Sample Unit No. 06).



A02CB-01. Joint Seal Damage (Sample Unit No. 13).




R14CB-01. Overview.



R14CB-01. LTD Cracking (Sample Unit No. 59).



R14CB-01. Shattered Slab (Additional Sample Unit No. 03).

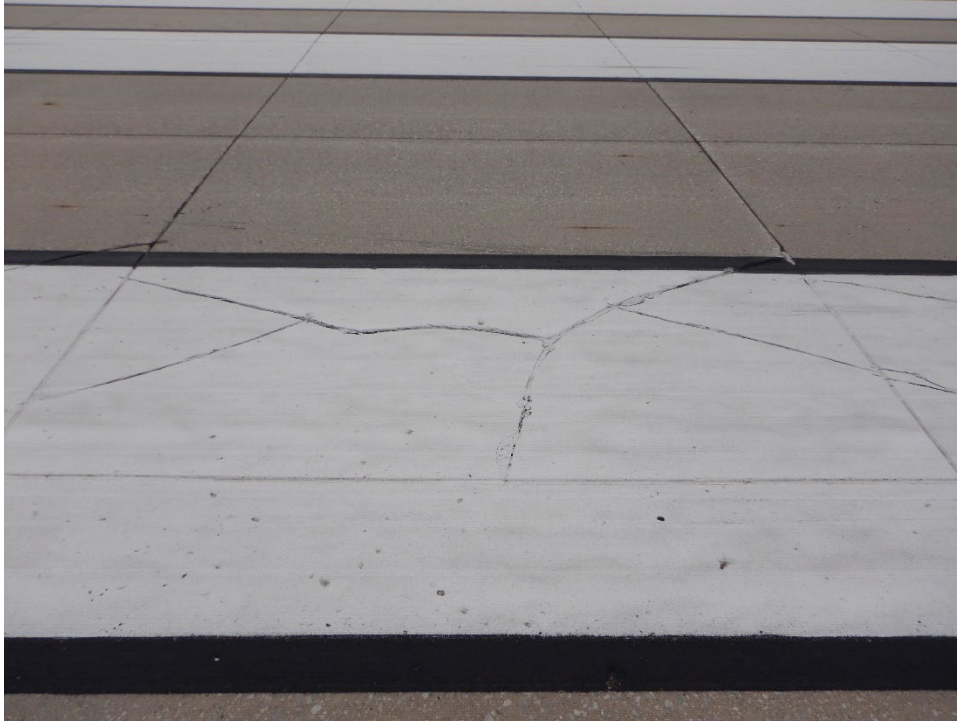

R14CB-02. Overview.



R14CB-02. LTD Cracking (Sample Unit No. 08).



R18CB-01. Overview.



R18CB-01. Faulting (Sample Unit No. 11).



R18CB-01. Small Patching (Sample Unit No. 03).



R18CB-01. Small Patching (Sample Unit No. 119).



R18CB-02. Overview.



R18CB-02. Joint Spalling (Sample Unit No. 18).



TACB-01. Overview.



TACB-01. Faulting (Sample Unit No. 12).




TACB-01. Popouts (Sample Unit No. 15).



TACB-02. Overview.



TACB-02. Corner Spalling (Sample Unit No. 09).

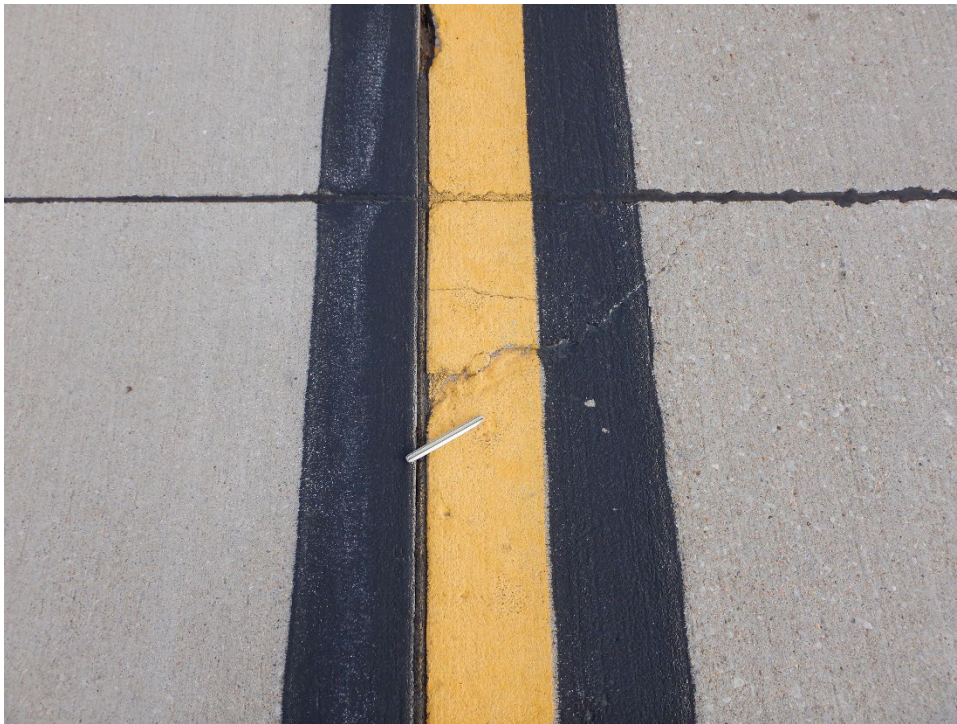

TACB-02. Joint Seal Damage (Sample Unit No. 02).




TACB-03. Overview.



TACB-03. Faulting (Sample Unit No. 01).



TACB-03. Joint Seal Damage (Sample Unit No. 02).

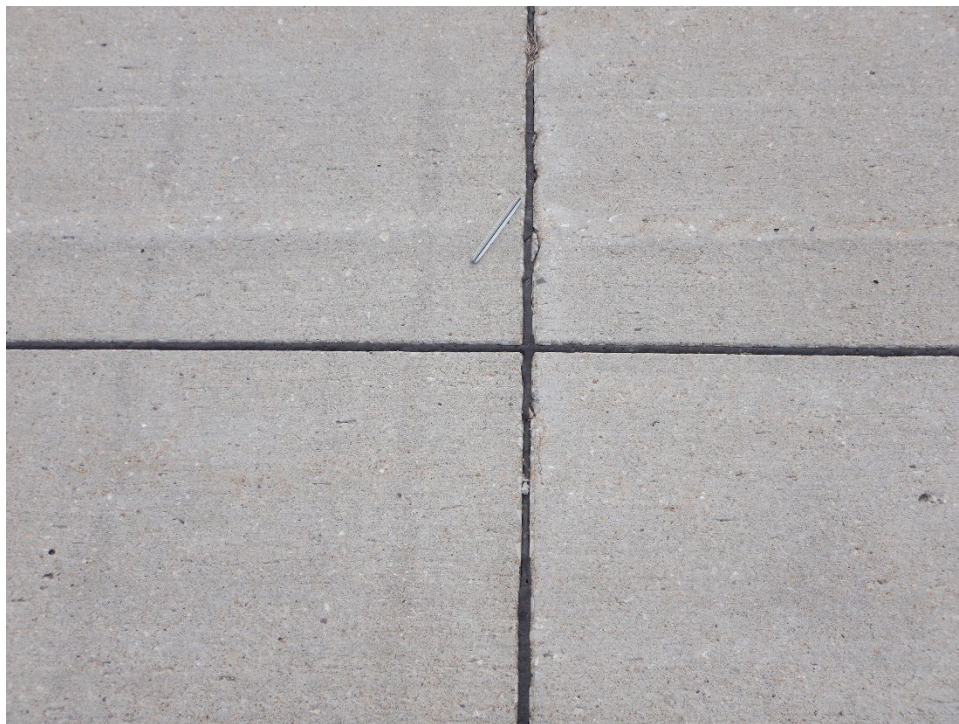

TB4CB-01. Overview.




TBCB-01. Overview.



TBCB-01. Corner Spalling (Sample Unit No. 05).



TBCB-01. Joint Seal Damage (Sample Unit No. 07).

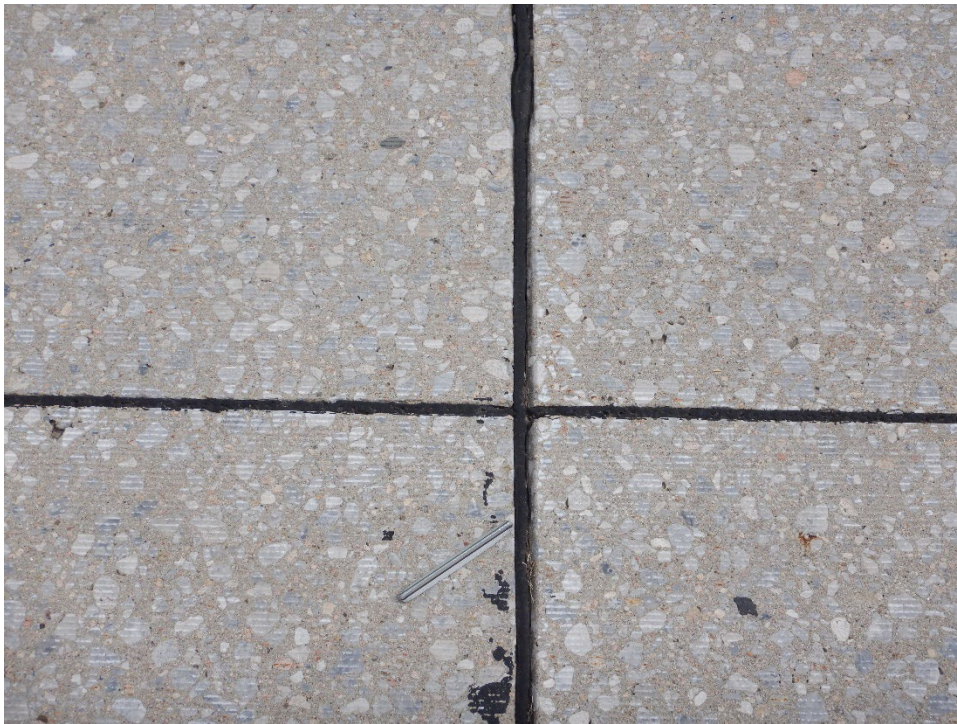

TBCB-02. Overview.




TBCB-02. Corner Spalling (Sample Unit No. 09).



TBCB-03. Overview.



TBCB-03. Faulting (Sample Unit No. 19).

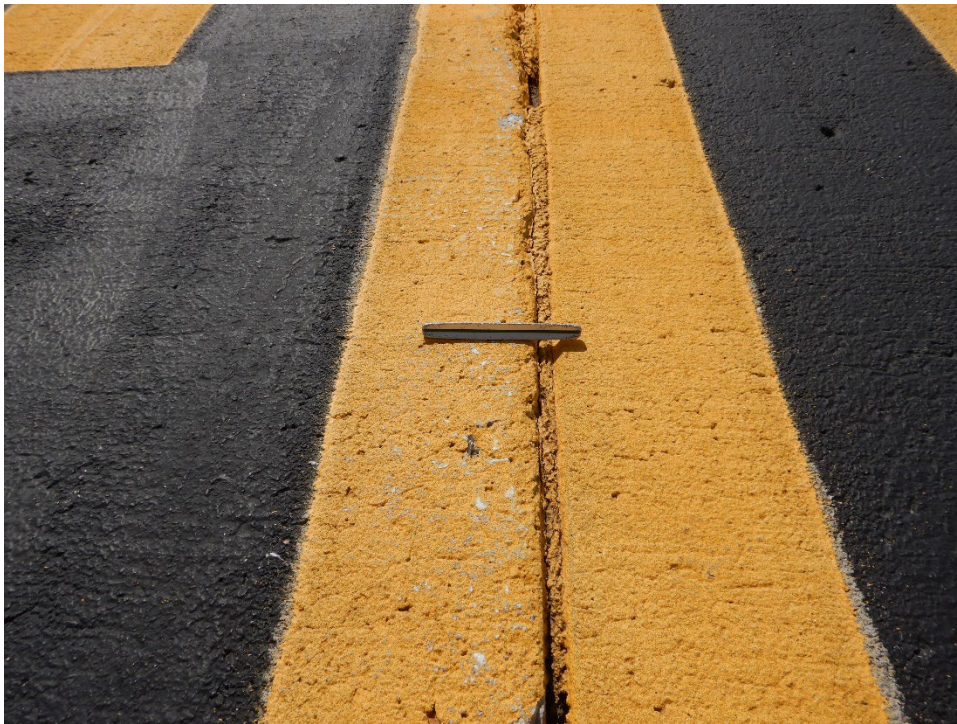

TBCB-03. LTD Cracking (Sample Unit No. 19).



TBCB-03. Small Patching (Sample Unit No. 11).



TBCB-04. Overview.



TBCB-04. Corner Break (Sample Unit No. 55).



TBCB-04. LTD Cracking (Sample Unit No. 55).



TBCB-04. Shrinkage Cracking (Sample Unit No. 19).



TCCB-01. Overview.



TCCB-01. Joint Seal Damage (Sample Unit No. 04).



TCCB-02. Overview.



TCCB-02. Joint Seal Damage (Sample Unit No. 16).



TCCB-02. Popouts (Sample Unit No. 17).



TDCB-01. Overview.



TDCB-01. Joint Seal Damage (Sample Unit No. 21).



TH01CB-01. Overview.



TH01CB-01. Corner Spalling (Sample Unit No. 03).



TH01CB-01. Joint Spalling (Sample Unit No. 03).



TH01CB-01. LTD Cracking (Sample Unit No. 03).



TH01CB-02. Overview.



TH01CB-02. Joint Seal Damage (Sample Unit No. 15).



TH01CB-02. Joint Spalling (Sample Unit No. 15).



TH01CB-03. Overview.



TH01CB-03. Corner Break (Sample Unit No. 03).



TH01CB-03. Shattered Slab (Sample Unit No. 04).



APPENDIX C

INSPECTION REPORT

RE-INSPECTION REPORT

COUNCIL BLUFFS MUNICIPAL AIRPORT

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: CBF

Page 1

Branch - Section ID: A01CB - 001

Branch Name: APRON 01

Use: APRON

LCD: 6/3/2010

PCI Family: IowaPCCAP_SW

Surface Type: PCC

Rank: P

Section Area (sf): 164,387.00

Length (ft): 530.00

Width (ft): 255.00

From: HANGAR

To: TAXIWAY

Slabs: 1,315

Section Comments:

Slab Length (ft): 12.50

Slab Width (ft): 10.00

Joint Length (ft): 28,634.84

Last Insp Date: 3/27/2026

Inspection Comments:

PCI: 91

Total Samples: 68

Surveyed: 9

Sample Number: 05

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

Sample Number: 08

Sample Type: R

Sample Comments:

Sample PCI: 96

Sample Area (Slabs): 20.00

65 JT SEAL DMG

L

20.00 Slabs

75 CORNER SPALL

L

1.00 Slabs

Sample Number: 23

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

Sample Number: 28

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

Sample Number: 35

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

Sample Number: 39

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

RE-INSPECTION REPORT

COUNCIL BLUFFS MUNICIPAL AIRPORT

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: CBF

Page 2

Sample Number: 44

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

Sample Number: 53

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

Sample Number: 61

Sample Type: R

Sample Comments:

Sample PCI: 76

Sample Area (Slabs): 25.00

63 LINEAR CR

M

2.00 Slabs

65 JT SEAL DMG

H

25.00 Slabs

75 CORNER SPALL

L

1.00 Slabs

RE-INSPECTION REPORT

COUNCIL BLUFFS MUNICIPAL AIRPORT

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: CBF

Page 3

Branch - Section ID: A02CB - 001

Branch Name: APRON 02

Use: APRON

LCD: 9/1/1995

PCI Family: IowaPCCAP_SW

Surface Type: PCC

Rank: P

Section Area (sf): 66,015.00

Length (ft): 300.00

Width (ft): 220.00

From: A01CB-01

To: TAXIWAY A

Slabs: 532

Section Comments: avg slab width entered and drawn

Slab Length (ft): 10.00

Slab Width (ft): 12.40

Joint Length (ft): 11,405.17

Last Insp Date: 3/27/2026

Inspection Comments:

PCI: 69

Total Samples: 28

Surveyed: 7

Sample Number: 04

Sample Type: R

Sample Comments:

Sample PCI: 83

Sample Area (Slabs): 20.00

65 JT SEAL DMG

H

20.00 Slabs

74 JOINT SPALL

M

2.00 Slabs

Sample Number: 06

Sample Type: R

Sample Comments:

Sample PCI: 81

Sample Area (Slabs): 20.00

65 JT SEAL DMG

H

20.00 Slabs

73 SHRINKAGE CR

N

1.00 Slabs

74 JOINT SPALL

L

1.00 Slabs

75 CORNER SPALL

M

1.00 Slabs

Sample Number: 10

Sample Type: R

Sample Comments:

Sample PCI: 82

Sample Area (Slabs): 20.00

65 JT SEAL DMG

H

20.00 Slabs

76 ASR

L

3.00 Slabs

Sample Number: 13

Sample Type: R

Sample Comments:

Sample PCI: 88

Sample Area (Slabs): 20.00

65 JT SEAL DMG

H

20.00 Slabs

Sample Number: 18

Sample Type: R

Sample Comments:

Sample PCI: 77

Sample Area (Slabs): 20.00

63 LINEAR CR

M

1.00 Slabs

65 JT SEAL DMG

H

20.00 Slabs

75 CORNER SPALL

M

2.00 Slabs

RE-INSPECTION REPORT

COUNCIL BLUFFS MUNICIPAL AIRPORT

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: CBF

Page 4

Sample Number: 22

Sample Type: R

Sample Comments:

Sample PCI: 42

Sample Area (Slabs): 20.00

63 LINEAR CR	M	1.00 Slabs
65 JT SEAL DMG	H	20.00 Slabs
66 SMALL PATCH	L	1.00 Slabs
71 FAULTING	L	1.00 Slabs
74 JOINT SPALL	H	1.00 Slabs
74 JOINT SPALL	L	1.00 Slabs
74 JOINT SPALL	M	1.00 Slabs
75 CORNER SPALL	H	1.00 Slabs
75 CORNER SPALL	L	1.00 Slabs
75 CORNER SPALL	M	1.00 Slabs
76 ASR	L	14.00 Slabs
76 ASR	M	1.00 Slabs

Sample Number: 25

Sample Type: R

Sample Comments:

Sample PCI: 27

Sample Area (Slabs): 20.00

62 CORNER BREAK	M	5.00 Slabs
63 LINEAR CR	M	7.00 Slabs
65 JT SEAL DMG	H	20.00 Slabs
72 SHAT. SLAB	M	1.00 Slabs
73 SHRINKAGE CR	N	2.00 Slabs
76 ASR	L	3.00 Slabs

RE-INSPECTION REPORT

COUNCIL BLUFFS MUNICIPAL AIRPORT

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: CBF

Page 5

Branch - Section ID: A03CB - 001

Branch Name: APRON 03

Use: APRON

LCD: 6/1/2025

PCI Family: IowaPCCAP_SW

Surface Type: PCC

Rank: P

Section Area (sf): 13,788.00

Length (ft): 110.00

Width (ft): 120.00

From:

To:

Slabs: 132

Section Comments:

Slab Length (ft): 10.00

Slab Width (ft): 10.00

Joint Length (ft): 2,410.00

Last Insp Date: 3/26/2026

Inspection Comments:

PCI: 100

Total Samples: 6

Surveyed: 4

Sample Number: 01

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 20.00

NO DISTRESS

Sample Number: 02

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 26.00

NO DISTRESS

Sample Number: 04

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 28.00

NO DISTRESS

Sample Number: 05

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 20.00

NO DISTRESS

RE-INSPECTION REPORT

COUNCIL BLUFFS MUNICIPAL AIRPORT

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: CBF

Page 6

Branch - Section ID: R14CB - 001

Branch Name: RUNWAY 14/32

Use: RUNWAY

LCD: 6/3/2007

PCI Family: IowaPCCRW_SW_Enhanced

Surface Type: PCC

Rank: S

Section Area (sf): 167,703.00

Length (ft): 2,957.00

Width (ft): 60.00

From: RUNWAY END 14

To: R14CB-02

Slabs: 1,677

Section Comments:

Slab Length (ft): 10.00

Slab Width (ft): 10.00

Joint Length (ft): 30,688.84

Last Insp Date: 3/26/2026

Inspection Comments:

PCI: 93

Total Samples: 70

Surveyed: 10

Sample Number: 03

Sample Type: A

Sample Comments:

Sample PCI: 73

Sample Area (Slabs): 24.00

62 CORNER BREAK

L

1.00 Slabs

62 CORNER BREAK

M

1.00 Slabs

71 FAULTING

L

1.00 Slabs

72 SHAT. SLAB

M

1.00 Slabs

Sample Number: 11

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 24.00

NO DISTRESS

Sample Number: 19

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 24.00

71 FAULTING

L

2.00 Slabs

Sample Number: 27

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 24.00

NO DISTRESS

Sample Number: 36

Sample Type: R

Sample Comments:

Sample PCI: 79

Sample Area (Slabs): 24.00

63 LINEAR CR

M

2.00 Slabs

71 FAULTING

L

2.00 Slabs

RE-INSPECTION REPORT

COUNCIL BLUFFS MUNICIPAL AIRPORT

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: CBF

Page 7

Sample Number: 43

Sample Type: R

Sample Comments:

Sample PCI: 75

Sample Area (Slabs): 24.00

63 LINEAR CR

M

3.00 Slabs

68 POPOUTS

N

1.00 Slabs

Sample Number: 49

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 24.00

71 FAULTING

L

2.00 Slabs

Sample Number: 56

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 24.00

NO DISTRESS

Sample Number: 59

Sample Type: R

Sample Comments:

Sample PCI: 96

Sample Area (Slabs): 24.00

63 LINEAR CR

L

1.00 Slabs

Sample Number: 67

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 24.00

NO DISTRESS

RE-INSPECTION REPORT

COUNCIL BLUFFS MUNICIPAL AIRPORT

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: CBF

Page 8

Branch - Section ID: R14CB - 002

Branch Name: RUNWAY 14/32

Use: RUNWAY

LCD: 6/3/2007

PCI Family: IowaPCCRW_SW_Enhanced

Surface Type: PCC

Rank: S

Section Area (sf): 44,038.00

Length (ft): 711.00

Width (ft): 60.00

From: R14CB-01

To: RUNWAY 18

Slabs: 440

Section Comments:

Slab Length (ft): 10.00

Slab Width (ft): 10.00

Joint Length (ft): 8,011.70

Last Insp Date: 3/26/2026

Inspection Comments:

PCI: 95

Total Samples: 18

Surveyed: 7

Sample Number: 01

Sample Type: R

Sample Comments:

Sample PCI: 90

Sample Area (Slabs): 24.00

71 FAULTING

L

2.00 Slabs

74 JOINT SPALL

L

2.00 Slabs

Sample Number: 04

Sample Type: R

Sample Comments:

Sample PCI: 98

Sample Area (Slabs): 24.00

73 SHRINKAGE CR

N

3.00 Slabs

Sample Number: 06

Sample Type: R

Sample Comments:

Sample PCI: 96

Sample Area (Slabs): 24.00

63 LINEAR CR

L

1.00 Slabs

Sample Number: 08

Sample Type: R

Sample Comments:

Sample PCI: 87

Sample Area (Slabs): 24.00

63 LINEAR CR

L

1.00 Slabs

63 LINEAR CR

M

1.00 Slabs

Sample Number: 11

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 24.00

NO DISTRESS

Sample Number: 13

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 24.00

NO DISTRESS

RE-INSPECTION REPORT

COUNCIL BLUFFS MUNICIPAL AIRPORT

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: CBF

Page 9

Sample Number: 15

Sample Type: R

Sample Comments:

Sample PCI: 96

Sample Area (Slabs): 24.00

71 FAULTING

L

1.00 Slabs

RE-INSPECTION REPORT

COUNCIL BLUFFS MUNICIPAL AIRPORT

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: CBF

Page 10

Branch - Section ID: R18CB - 001

Branch Name: RUNWAY 18/36

Use: RUNWAY

LCD: 6/3/2006

PCI Family: IowaPCCRW_SW_Enhanced

Surface Type: PCC

Rank: P

Section Area (sf): 400,000.00

Length (ft): 4,000.00

Width (ft): 100.00

From: 18 APPROACH END

To: R18CB-02

Slabs: 2,560

Section Comments:

Slab Length (ft): 12.50

Slab Width (ft): 12.50

Joint Length (ft): 59,900.00

Last Insp Date: 3/26/2026

Inspection Comments:

PCI: 96

Total Samples: 128

Surveyed: 13

Sample Number: 003

Sample Type: R

Sample Comments:

Sample PCI: 99

Sample Area (Slabs): 20.00

66 SMALL PATCH

L

1.00 Slabs

Sample Number: 011

Sample Type: R

Sample Comments:

Sample PCI: 89

Sample Area (Slabs): 20.00

71 FAULTING

L

2.00 Slabs

75 CORNER SPALL

L

1.00 Slabs

Sample Number: 021

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 20.00

63 LINEAR CR

L

1.00 Slabs

66 SMALL PATCH

L

3.00 Slabs

Sample Number: 031

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 20.00

NO DISTRESS

Sample Number: 041

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 20.00

NO DISTRESS

Sample Number: 051

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 20.00

NO DISTRESS

RE-INSPECTION REPORT

COUNCIL BLUFFS MUNICIPAL AIRPORT

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: CBF

Page 11

Sample Number: 061

Sample Type: R

Sample Comments:

Sample PCI: 98

Sample Area (Slabs): 20.00

66 SMALL PATCH

L

1.00 Slabs

70 SCALING

L

1.00 Slabs

Sample Number: 069

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 20.00

NO DISTRESS

Sample Number: 079

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 20.00

NO DISTRESS

Sample Number: 089

Sample Type: R

Sample Comments:

Sample PCI: 96

Sample Area (Slabs): 20.00

75 CORNER SPALL

M

1.00 Slabs

Sample Number: 099

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 20.00

NO DISTRESS

Sample Number: 109

Sample Type: R

Sample Comments:

Sample PCI: 90

Sample Area (Slabs): 20.00

71 FAULTING

L

2.00 Slabs

74 JOINT SPALL

L

1.00 Slabs

Sample Number: 119

Sample Type: R

Sample Comments:

Sample PCI: 82

Sample Area (Slabs): 20.00

66 SMALL PATCH

L

1.00 Slabs

67 LARGE PATCH

L

1.00 Slabs

71 FAULTING

L

3.00 Slabs

74 JOINT SPALL

L

1.00 Slabs

RE-INSPECTION REPORT

COUNCIL BLUFFS MUNICIPAL AIRPORT

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: CBF

Page 12

Branch - Section ID: R18CB - 002

Branch Name: RUNWAY 18/36

Use: RUNWAY

LCD: 6/3/2007

PCI Family: IowaPCCRW_SW_Enhanced

Surface Type: PCC

Rank: P

Section Area (sf): 150,000.00

Length (ft): 1,500.00

Width (ft): 100.00

From: R18CB-01

To: 36 APPROACH END

Slabs: 960

Section Comments:

Slab Length (ft): 12.50

Slab Width (ft): 12.50

Joint Length (ft): 22,400.00

Last Insp Date: 3/26/2026

Inspection Comments:

PCI: 92

Total Samples: 48

Surveyed: 8

Sample Number: 03

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 20.00

NO DISTRESS

Sample Number: 14

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 20.00

NO DISTRESS

Sample Number: 18

Sample Type: R

Sample Comments:

Sample PCI: 98

Sample Area (Slabs): 20.00

74 JOINT SPALL

L

1.00 Slabs

Sample Number: 23

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 20.00

NO DISTRESS

Sample Number: 27

Sample Type: R

Sample Comments:

Sample PCI: 57

Sample Area (Slabs): 20.00

68 POPOUTS

N

2.00 Slabs

71 FAULTING

H

2.00 Slabs

71 FAULTING

M

3.00 Slabs

73 SHRINKAGE CR

N

1.00 Slabs

RE-INSPECTION REPORT

COUNCIL BLUFFS MUNICIPAL AIRPORT

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: CBF

Page 13

Sample Number: 32

Sample Type: R
Sample PCI: 95
Sample Area (Slabs): 20.00

Sample Comments:

71 FAULTING	L	1.00 Slabs
-------------	---	------------

Sample Number: 36

Sample Type: R
Sample PCI: 98
Sample Area (Slabs): 20.00

Sample Comments:

75 CORNER SPALL	L	1.00 Slabs
-----------------	---	------------

Sample Number: 47

Sample Type: R
Sample PCI: 88
Sample Area (Slabs): 20.00

Sample Comments:

68 POPOUTS	N	2.00 Slabs
71 FAULTING	L	1.00 Slabs

RE-INSPECTION REPORT

COUNCIL BLUFFS MUNICIPAL AIRPORT

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: CBF

Page 14

Branch - Section ID: TACB - 001

Branch Name: TAXIWAY A

Use: TAXIWAY

LCD: 6/3/2007

PCI Family: IowaPCCTW_SW_Enhanced

Surface Type: PCC

Rank: P

Section Area (sf): 62,015.00

Length (ft): 1,720.00

Width (ft): 35.00

From: 14 APPROACH END

To: TAXIWAY C

Slabs: 709

Section Comments:

Slab Length (ft): 10.00

Slab Width (ft): 8.75

Joint Length (ft): 11,481.02

Last Insp Date: 3/26/2026

Inspection Comments:

PCI: 87

Total Samples: 35

Surveyed: 8

Sample Number: 03

Sample Type: R

Sample Comments:

Sample PCI: 86

Sample Area (Slabs): 20.00

65 JT SEAL DMG

H

20.00 Slabs

74 JOINT SPALL

L

1.00 Slabs

Sample Number: 09

Sample Type: R

Sample Comments:

Sample PCI: 89

Sample Area (Slabs): 25.00

65 JT SEAL DMG

M

25.00 Slabs

71 FAULTING

L

1.00 Slabs

Sample Number: 12

Sample Type: R

Sample Comments:

Sample PCI: 88

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

71 FAULTING

L

1.00 Slabs

Sample Number: 15

Sample Type: R

Sample Comments:

Sample PCI: 89

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

68 POPOUTS

N

1.00 Slabs

Sample Number: 21

Sample Type: R

Sample Comments:

Sample PCI: 91

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

73 SHRINKAGE CR

N

2.00 Slabs

RE-INSPECTION REPORT

COUNCIL BLUFFS MUNICIPAL AIRPORT

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: CBF

Page 15

Sample Number: 24

Sample Type: R

Sample Comments:

Sample PCI: 80

Sample Area (Slabs): 20.00

65 JT SEAL DMG	M	20.00 Slabs
71 FAULTING	L	3.00 Slabs
73 SHRINKAGE CR	N	1.00 Slabs
75 CORNER SPALL	L	1.00 Slabs

Sample Number: 27

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 20.00

65 JT SEAL DMG	M	20.00 Slabs
----------------	---	-------------

Sample Number: 31

Sample Type: R

Sample Comments:

Sample PCI: 82

Sample Area (Slabs): 20.00

63 LINEAR CR	L	1.00 Slabs
65 JT SEAL DMG	M	20.00 Slabs
71 FAULTING	L	2.00 Slabs

RE-INSPECTION REPORT

COUNCIL BLUFFS MUNICIPAL AIRPORT

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: CBF

Page 16

Branch - Section ID: TACB - 002

Branch Name: TAXIWAY A

Use: TAXIWAY

LCD: 11/3/2009

PCI Family: IowaPCCTW_SW_Enhanced

Surface Type: PCC

Rank: P

Section Area (sf): 27,570.00

Length (ft): 790.00

Width (ft): 35.00

From: TAXIWAY C

To: TACB-03

Slabs: 315

Section Comments:

Slab Length (ft): 10.00

Slab Width (ft): 8.75

Joint Length (ft): 5,085.24

Last Insp Date: 3/26/2026

Inspection Comments:

PCI: 94

Total Samples: 16

Surveyed: 6

Sample Number: 02

Sample Type: R

Sample Comments:

Sample PCI: 98

Sample Area (Slabs): 20.00

65 JT SEAL DMG

L

20.00 Slabs

Sample Number: 04

Sample Type: R

Sample Comments:

Sample PCI: 98

Sample Area (Slabs): 20.00

65 JT SEAL DMG

L

20.00 Slabs

Sample Number: 07

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

Sample Number: 09

Sample Type: R

Sample Comments:

Sample PCI: 89

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

75 CORNER SPALL

M

1.00 Slabs

Sample Number: 12

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 20.00

63 LINEAR CR

L

1.00 Slabs

65 JT SEAL DMG

L

20.00 Slabs

Sample Number: 15

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

RE-INSPECTION REPORT

COUNCIL BLUFFS MUNICIPAL AIRPORT

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: CBF

Page 17

Branch - Section ID: TACB - 003

Branch Name: TAXIWAY A

Use: TAXIWAY

LCD: 6/3/2007

PCI Family: IowaPCCTW_SW_Enhanced

Surface Type: PCC

Rank: P

Section Area (sf): 14,392.00

Length (ft): 330.00

Width (ft): 35.00

From: TACB-02

To: TAXIWAY B

Slabs: 164

Section Comments:

Slab Length (ft): 10.00

Slab Width (ft): 8.75

Joint Length (ft): 2,629.19

Last Insp Date: 3/26/2026

Inspection Comments:

PCI: 82

Total Samples: 9

Surveyed: 5

Sample Number: 01

Sample Type: R

Sample Comments:

Sample PCI: 74

Sample Area (Slabs): 20.00

65 JT SEAL DMG

H

20.00 Slabs

71 FAULTING

L

2.00 Slabs

71 FAULTING

M

2.00 Slabs

Sample Number: 02

Sample Type: R

Sample Comments:

Sample PCI: 83

Sample Area (Slabs): 20.00

65 JT SEAL DMG

H

20.00 Slabs

71 FAULTING

L

2.00 Slabs

Sample Number: 03

Sample Type: R

Sample Comments:

Sample PCI: 84

Sample Area (Slabs): 20.00

65 JT SEAL DMG

H

20.00 Slabs

74 JOINT SPALL

M

1.00 Slabs

Sample Number: 04

Sample Type: R

Sample Comments:

Sample PCI: 84

Sample Area (Slabs): 20.00

65 JT SEAL DMG

H

20.00 Slabs

75 CORNER SPALL

M

1.00 Slabs

Sample Number: 05

Sample Type: R

Sample Comments:

Sample PCI: 84

Sample Area (Slabs): 20.00

65 JT SEAL DMG

H

20.00 Slabs

74 JOINT SPALL

M

1.00 Slabs

RE-INSPECTION REPORT

COUNCIL BLUFFS MUNICIPAL AIRPORT

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: CBF

Page 18

Branch - Section ID: TB4CB - 001

Branch Name: TAXIWAY B4

Use: TAXIWAY

LCD: 5/3/2024

PCI Family: IowaPCCTW_SW_Enhanced

Surface Type: PCC

Rank: P

Section Area (sf): 38,040.00

Length (ft): 727.00

Width (ft): 35.00

From: SEE MAP

To: SEE MAP

Slabs: 435

Section Comments:

Slab Length (ft): 10.00

Slab Width (ft): 8.75

Joint Length (ft): 7,012.25

Last Insp Date: 3/26/2026

Inspection Comments:

PCI: 100

Total Samples: 24

Surveyed: 7

Sample Number: 07

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 20.00

NO DISTRESS

Sample Number: 12

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 18.00

NO DISTRESS

Sample Number: 15

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 18.00

NO DISTRESS

Sample Number: 17

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 20.00

NO DISTRESS

Sample Number: 19

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 20.00

NO DISTRESS

Sample Number: 21

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 20.00

NO DISTRESS

RE-INSPECTION REPORT

COUNCIL BLUFFS MUNICIPAL AIRPORT

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: CBF

Page 19

Sample Number: 23

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 20.00

NO DISTRESS

RE-INSPECTION REPORT

COUNCIL BLUFFS MUNICIPAL AIRPORT

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: CBF

Page 20

Branch - Section ID: TBCB - 001

Branch Name: TAXIWAY B

Use: TAXIWAY

LCD: 6/3/2009

PCI Family: IowaPCCTW_SW_Enhanced

Surface Type: PCC

Rank: P

Section Area (sf): 21,182.00

Length (ft): 323.00

Width (ft): 35.00

From: RUNWAY 14-32

To: TAXIWAY A

Slabs: 242

Section Comments:

Slab Length (ft): 10.00

Slab Width (ft): 8.75

Joint Length (ft): 3,868.22

Last Insp Date: 3/26/2026

Inspection Comments:

PCI: 93

Total Samples: 13

Surveyed: 6

Sample Number: 04

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

Sample Number: 05

Sample Type: R

Sample Comments:

Sample PCI: 91

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

75 CORNER SPALL

L

1.00 Slabs

Sample Number: 07

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 23.00

65 JT SEAL DMG

M

23.00 Slabs

Sample Number: 08

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

Sample Number: 09

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

Sample Number: 11

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

RE-INSPECTION REPORT

COUNCIL BLUFFS MUNICIPAL AIRPORT

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: CBF

Page 21

Branch - Section ID: TBCB - 002

Branch Name: TAXIWAY B

Use: TAXIWAY

LCD: 6/3/2009

PCI Family: IowaPCCTW_SW_Enhanced

Surface Type: PCC

Rank: P

Section Area (sf): 16,800.00

Length (ft): 500.00

Width (ft): 35.00

From: TBCB-03

To: TBCB-01

Slabs: 192

Section Comments:

Slab Length (ft): 10.00

Slab Width (ft): 8.75

Joint Length (ft): 3,086.40

Last Insp Date: 3/26/2026

Inspection Comments:

PCI: 82

Total Samples: 10

Surveyed: 5

Sample Number: 02

Sample Type: R

Sample Comments:

Sample PCI: 88

Sample Area (Slabs): 16.00

65 JT SEAL DMG

M

16.00 Slabs

71 FAULTING

L

1.00 Slabs

Sample Number: 04

Sample Type: R

Sample Comments:

Sample PCI: 79

Sample Area (Slabs): 20.00

62 CORNER BREAK

L

1.00 Slabs

65 JT SEAL DMG

H

20.00 Slabs

71 FAULTING

L

1.00 Slabs

Sample Number: 06

Sample Type: R

Sample Comments:

Sample PCI: 78

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

71 FAULTING

L

5.00 Slabs

Sample Number: 08

Sample Type: R

Sample Comments:

Sample PCI: 80

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

71 FAULTING

L

3.00 Slabs

73 SHRINKAGE CR

N

1.00 Slabs

75 CORNER SPALL

L

1.00 Slabs

RE-INSPECTION REPORT

COUNCIL BLUFFS MUNICIPAL AIRPORT

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: CBF

Page 22

Sample Number: 09

Sample Type: R

Sample Comments:

Sample PCI: 85

Sample Area (Slabs): 20.00

65 JT SEAL DMG	M	20.00 Slabs
66 SMALL PATCH	M	1.00 Slabs
75 CORNER SPALL	L	1.00 Slabs
75 CORNER SPALL	M	1.00 Slabs

RE-INSPECTION REPORT

COUNCIL BLUFFS MUNICIPAL AIRPORT

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: CBF

Page 23

Branch - Section ID: TBCB - 003

Branch Name: TAXIWAY B

Use: TAXIWAY

LCD: 6/3/2006

PCI Family: IowaPCCTW_SW_Enhanced

Surface Type: PCC

Rank: P

Section Area (sf): 41,805.00

Length (ft): 1,060.00

Width (ft): 35.00

From: TBCB-02

To: 36 APPROACH END

Slabs: 478

Section Comments:

Slab Length (ft): 10.00

Slab Width (ft): 8.75

Joint Length (ft): 7,724.35

Last Insp Date: 3/26/2026

Inspection Comments:

PCI: 88

Total Samples: 24

Surveyed: 7

Sample Number: 03

Sample Type: R

Sample Comments:

Sample PCI: 90

Sample Area (Slabs): 20.00

65 JT SEAL DMG	M	20.00 Slabs
66 SMALL PATCH	L	1.00 Slabs
75 CORNER SPALL	L	1.00 Slabs

Sample Number: 05

Sample Type: R

Sample Comments:

Sample PCI: 84

Sample Area (Slabs): 20.00

63 LINEAR CR	L	1.00 Slabs
65 JT SEAL DMG	M	20.00 Slabs
73 SHRINKAGE CR	N	2.00 Slabs
75 CORNER SPALL	L	1.00 Slabs

Sample Number: 08

Sample Type: R

Sample Comments:

Sample PCI: 92

Sample Area (Slabs): 20.00

65 JT SEAL DMG	M	20.00 Slabs
73 SHRINKAGE CR	N	1.00 Slabs

Sample Number: 11

Sample Type: R

Sample Comments:

Sample PCI: 91

Sample Area (Slabs): 20.00

65 JT SEAL DMG	M	20.00 Slabs
66 SMALL PATCH	L	2.00 Slabs

RE-INSPECTION REPORT

COUNCIL BLUFFS MUNICIPAL AIRPORT

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: CBF

Page 24

Sample Number: 14

Sample Type: R

Sample Comments:

Sample PCI: 84

Sample Area (Slabs): 20.00

65 JT SEAL DMG	H	20.00 Slabs
66 SMALL PATCH	L	3.00 Slabs
74 JOINT SPALL	L	1.00 Slabs

Sample Number: 19

Sample Type: R

Sample Comments:

Sample PCI: 72

Sample Area (Slabs): 20.00

63 LINEAR CR	L	1.00 Slabs
63 LINEAR CR	M	1.00 Slabs
71 FAULTING	L	4.00 Slabs
74 JOINT SPALL	M	1.00 Slabs

Sample Number: 21

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 20.00

NO DISTRESS

RE-INSPECTION REPORT

COUNCIL BLUFFS MUNICIPAL AIRPORT

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: CBF

Page 25

Branch - Section ID: TBCB - 004

Branch Name: TAXIWAY B

Use: TAXIWAY

LCD: 6/3/2006

PCI Family: IowaPCCTW_SW_Enhanced

Surface Type: PCC

Rank: P

Section Area (sf): 125,508.00

Length (ft): 3,364.00

Width (ft): 35.00

From: 18 APPROACH END

To: TAXIWAY C

Slabs: 1,420

Section Comments: avg length of slabs entered and drawn on map

Slab Length (ft): 10.10

Slab Width (ft): 8.75

Joint Length (ft): 23,147.05

Last Insp Date: 3/26/2026

Inspection Comments:

PCI: 87

Total Samples: 71

Surveyed: 9

Sample Number: 06

Sample Type: R

Sample Comments:

Sample PCI: 88

Sample Area (Slabs): 20.00

65 JT SEAL DMG

H

20.00 Slabs

Sample Number: 11

Sample Type: R

Sample Comments:

Sample PCI: 88

Sample Area (Slabs): 20.00

65 JT SEAL DMG

H

20.00 Slabs

Sample Number: 19

Sample Type: R

Sample Comments:

Sample PCI: 92

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

73 SHRINKAGE CR

N

1.00 Slabs

Sample Number: 27

Sample Type: R

Sample Comments:

Sample PCI: 91

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

75 CORNER SPALL

L

1.00 Slabs

Sample Number: 35

Sample Type: R

Sample Comments:

Sample PCI: 87

Sample Area (Slabs): 20.00

63 LINEAR CR

L

1.00 Slabs

65 JT SEAL DMG

M

20.00 Slabs

73 SHRINKAGE CR

N

1.00 Slabs

RE-INSPECTION REPORT

COUNCIL BLUFFS MUNICIPAL AIRPORT

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: CBF

Page 26

Sample Number: 43

Sample Type: R
Sample PCI: 93
Sample Area (Slabs): 20.00
65 JT SEAL DMG

Sample Comments:

M 20.00 Slabs

Sample Number: 51

Sample Type: R
Sample PCI: 93
Sample Area (Slabs): 20.00
65 JT SEAL DMG

Sample Comments:

M 20.00 Slabs

Sample Number: 55

Sample Type: R
Sample PCI: 56
Sample Area (Slabs): 20.00
62 CORNER BREAK
63 LINEAR CR
65 JT SEAL DMG
73 SHRINKAGE CR
74 JOINT SPALL
74 JOINT SPALL
75 CORNER SPALL

Sample Comments:

M 1.00 Slabs
M 3.00 Slabs
M 20.00 Slabs
N 1.00 Slabs
L 2.00 Slabs
M 1.00 Slabs
M 1.00 Slabs

Sample Number: 66

Sample Type: R
Sample PCI: 93
Sample Area (Slabs): 20.00
65 JT SEAL DMG

Sample Comments:

M 20.00 Slabs

RE-INSPECTION REPORT

COUNCIL BLUFFS MUNICIPAL AIRPORT

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: CBF

Page 27

Branch - Section ID: TCCB - 001

Branch Name: TAXIWAY C

Use: TAXIWAY

LCD: 6/3/2007

PCI Family: IowaPCCTW_SW_Enhanced

Surface Type: PCC

Rank: P

Section Area (sf): 13,340.00

Length (ft): 270.00

Width (ft): 35.00

From: TAXIWAY A

To: RUNWAY 14-32

Slabs: 152

Section Comments:

Slab Length (ft): 10.00

Slab Width (ft): 8.75

Joint Length (ft): 2,428.02

Last Insp Date: 3/26/2026

Inspection Comments:

PCI: 91

Total Samples: 7

Surveyed: 4

Sample Number: 02

Sample Type: R

Sample Comments:

Sample PCI: 88

Sample Area (Slabs): 20.00

65 JT SEAL DMG

H

20.00 Slabs

Sample Number: 03

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 24.00

65 JT SEAL DMG

M

24.00 Slabs

Sample Number: 04

Sample Type: R

Sample Comments:

Sample PCI: 88

Sample Area (Slabs): 24.00

65 JT SEAL DMG

H

24.00 Slabs

Sample Number: 05

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 30.00

65 JT SEAL DMG

M

30.00 Slabs

RE-INSPECTION REPORT

COUNCIL BLUFFS MUNICIPAL AIRPORT

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: CBF

Page 28

Branch - Section ID: TCCB - 002

Branch Name: TAXIWAY C

Use: TAXIWAY

LCD: 6/3/2007

PCI Family: IowaPCCTW_SW_Enhanced

Surface Type: PCC

Rank: P

Section Area (sf): 32,471.00

Length (ft): 725.00

Width (ft): 35.00

From: RUNWAY 14-32

To: TAXIWAY B

Slabs: 371

Section Comments:

Slab Length (ft): 10.00

Slab Width (ft): 8.75

Joint Length (ft): 5,985.54

Last Insp Date: 3/26/2026

Inspection Comments:

PCI: 91

Total Samples: 19

Surveyed: 7

Sample Number: 04

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

Sample Number: 08

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

Sample Number: 10

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

Sample Number: 12

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

Sample Number: 14

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

Sample Number: 16

Sample Type: R

Sample Comments:

Sample PCI: 84

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

68 POPOUTS

N

2.00 Slabs

75 CORNER SPALL

M

1.00 Slabs

RE-INSPECTION REPORT

COUNCIL BLUFFS MUNICIPAL AIRPORT

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: CBF

Page 29

Sample Number: 17

Sample Type: R

Sample Comments:

Sample PCI: 89

Sample Area (Slabs): 24.00

65 JT SEAL DMG

M

24.00 Slabs

68 POPOUTS

N

1.00 Slabs

RE-INSPECTION REPORT

COUNCIL BLUFFS MUNICIPAL AIRPORT

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: CBF

Page 30

Branch - Section ID: TDCB - 001

Branch Name: TAXIWAY D

Use: TAXIWAY

LCD: 9/3/2009

PCI Family: IowaPCCTW_SW_Enhanced

Surface Type: PCC

Rank: P

Section Area (sf): 40,675.00

Length (ft): 900.00

Width (ft): 35.00

From: 32 APPROACH END

To: 36 APPROACH END

Slabs: 465

Section Comments:

Slab Length (ft): 10.00

Slab Width (ft): 8.75

Joint Length (ft): 7,508.73

Last Insp Date: 3/26/2026

Inspection Comments:

PCI: 89

Total Samples: 23

Surveyed: 7

Sample Number: 04

Sample Type: R

Sample Comments:

Sample PCI: 88

Sample Area (Slabs): 20.00

65 JT SEAL DMG

H

20.00 Slabs

Sample Number: 07

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

Sample Number: 12

Sample Type: R

Sample Comments:

Sample PCI: 88

Sample Area (Slabs): 22.00

65 JT SEAL DMG

H

22.00 Slabs

Sample Number: 14

Sample Type: R

Sample Comments:

Sample PCI: 88

Sample Area (Slabs): 25.00

65 JT SEAL DMG

H

25.00 Slabs

Sample Number: 16

Sample Type: R

Sample Comments:

Sample PCI: 88

Sample Area (Slabs): 20.00

65 JT SEAL DMG

H

20.00 Slabs

Sample Number: 19

Sample Type: R

Sample Comments:

Sample PCI: 88

Sample Area (Slabs): 23.00

65 JT SEAL DMG

H

23.00 Slabs

RE-INSPECTION REPORT

COUNCIL BLUFFS MUNICIPAL AIRPORT

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: CBF

Page 31

Sample Number: 21

Sample Type: R

Sample Comments:

Sample PCI: 88

Sample Area (Slabs): 20.00

65 JT SEAL DMG

H

20.00 Slabs

RE-INSPECTION REPORT

COUNCIL BLUFFS MUNICIPAL AIRPORT

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: CBF

Page 32

Branch - Section ID: TH01CB - 001

Branch Name: T-HANGAR 01

Use: T-HANGAR

LCD: 6/1/2004

PCI Family: IowaPCCTH_SW

Surface Type: PCC

Rank: P

Section Area (sf): 56,846.00

Length (ft): 1,512.00

Width (ft): 35.00

From: .

To: .

Slabs: 395

Section Comments:

Slab Length (ft): 12.50

Slab Width (ft): 11.50

Joint Length (ft): 7,829.04

Last Insp Date: 3/27/2026

Inspection Comments:

PCI: 65

Total Samples: 21

Surveyed: 7

Sample Number: 03

Sample Type: R

Sample Comments:

Sample PCI: 46

Sample Area (Slabs): 21.00

63 LINEAR CR	M	4.00 Slabs
65 JT SEAL DMG	H	21.00 Slabs
72 SHAT. SLAB	M	1.00 Slabs
74 JOINT SPALL	M	1.00 Slabs
75 CORNER SPALL	M	1.00 Slabs
76 ASR	L	2.00 Slabs

Sample Number: 05

Sample Type: R

Sample Comments:

Sample PCI: 41

Sample Area (Slabs): 21.00

63 LINEAR CR	L	3.00 Slabs
63 LINEAR CR	M	14.00 Slabs
65 JT SEAL DMG	H	21.00 Slabs

Sample Number: 07

Sample Type: R

Sample Comments:

Sample PCI: 78

Sample Area (Slabs): 21.00

65 JT SEAL DMG	H	21.00 Slabs
66 SMALL PATCH	L	1.00 Slabs
74 JOINT SPALL	M	1.00 Slabs
75 CORNER SPALL	L	1.00 Slabs
75 CORNER SPALL	M	1.00 Slabs

Sample Number: 11

Sample Type: R

Sample Comments:

Sample PCI: 88

Sample Area (Slabs): 21.00

65 JT SEAL DMG	H	21.00 Slabs
----------------	---	-------------

RE-INSPECTION REPORT

COUNCIL BLUFFS MUNICIPAL AIRPORT

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: CBF

Page 33

Sample Number: 15

Sample Type: R

Sample Comments:

Sample PCI: 64

Sample Area (Slabs): 21.00

63 LINEAR CR	L	1.00 Slabs
63 LINEAR CR	M	1.00 Slabs
65 JT SEAL DMG	H	21.00 Slabs
73 SHRINKAGE CR	N	1.00 Slabs
74 JOINT SPALL	H	1.00 Slabs
74 JOINT SPALL	M	1.00 Slabs
75 CORNER SPALL	M	1.00 Slabs

Sample Number: 17

Sample Type: R

Sample Comments:

Sample PCI: 67

Sample Area (Slabs): 21.00

63 LINEAR CR	L	1.00 Slabs
63 LINEAR CR	M	2.00 Slabs
65 JT SEAL DMG	H	21.00 Slabs
73 SHRINKAGE CR	N	2.00 Slabs
75 CORNER SPALL	M	1.00 Slabs

Sample Number: 19

Sample Type: R

Sample Comments:

Sample PCI: 73

Sample Area (Slabs): 21.00

65 JT SEAL DMG	H	21.00 Slabs
73 SHRINKAGE CR	N	3.00 Slabs
74 JOINT SPALL	M	1.00 Slabs
75 CORNER SPALL	L	4.00 Slabs
75 CORNER SPALL	M	2.00 Slabs

RE-INSPECTION REPORT

COUNCIL BLUFFS MUNICIPAL AIRPORT

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: CBF

Page 34

Branch - Section ID: TH01CB - 002

Branch Name: T-HANGAR 01

Use: T-HANGAR

LCD: 11/3/2008

PCI Family: IowaPCCTH_SW

Surface Type: PCC

Rank: P

Section Area (sf): 33,456.00

Length (ft): 1,120.00

Width (ft): 30.00

From: .

To: .

Slabs: 335

Section Comments:

Slab Length (ft): 10.00

Slab Width (ft): 10.00

Joint Length (ft): 5,546.13

Last Insp Date: 3/27/2026

Inspection Comments:

PCI: 81

Total Samples: 16

Surveyed: 6

Sample Number: 03

Sample Type: R

Sample Comments:

Sample PCI: 83

Sample Area (Slabs): 21.00

63 LINEAR CR

L

1.00 Slabs

65 JT SEAL DMG

H

21.00 Slabs

Sample Number: 05

Sample Type: R

Sample Comments:

Sample PCI: 79

Sample Area (Slabs): 21.00

62 CORNER BREAK

L

1.00 Slabs

63 LINEAR CR

M

1.00 Slabs

65 JT SEAL DMG

H

21.00 Slabs

Sample Number: 07

Sample Type: R

Sample Comments:

Sample PCI: 88

Sample Area (Slabs): 21.00

65 JT SEAL DMG

H

21.00 Slabs

Sample Number: 10

Sample Type: R

Sample Comments:

Sample PCI: 65

Sample Area (Slabs): 21.00

62 CORNER BREAK

L

1.00 Slabs

65 JT SEAL DMG

H

21.00 Slabs

71 FAULTING

L

4.00 Slabs

73 SHRINKAGE CR

N

1.00 Slabs

74 JOINT SPALL

H

1.00 Slabs

74 JOINT SPALL

L

3.00 Slabs

RE-INSPECTION REPORT

COUNCIL BLUFFS MUNICIPAL AIRPORT

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: CBF

Page 35

Sample Number: 13

Sample Type: R

Sample Comments:

Sample PCI: 87

Sample Area (Slabs): 21.00

65 JT SEAL DMG

H

21.00 Slabs

73 SHRINKAGE CR

N

1.00 Slabs

Sample Number: 15

Sample Type: R

Sample Comments:

Sample PCI: 82

Sample Area (Slabs): 21.00

65 JT SEAL DMG

H

21.00 Slabs

74 JOINT SPALL

M

1.00 Slabs

75 CORNER SPALL

L

1.00 Slabs

RE-INSPECTION REPORT

COUNCIL BLUFFS MUNICIPAL AIRPORT

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: CBF

Page 36

Branch - Section ID: TH01CB - 003

Branch Name: T-HANGAR 01

Use: T-HANGAR

LCD: 1/1/1995

PCI Family: IowaPCCTH_SW

Surface Type: PCC

Rank: P

Section Area (sf): 10,500.00

Length (ft): 525.00

Width (ft): 20.00

From: .

To: .

Slabs: 84

Section Comments:

Slab Length (ft): 12.50

Slab Width (ft): 10.00

Joint Length (ft): 1,345.00

Last Insp Date: 3/27/2026

Inspection Comments:

PCI: 63

Total Samples: 4

Surveyed: 3

Sample Number: 01

Sample Type: R

Sample Comments:

Sample PCI: 75

Sample Area (Slabs): 20.00

63 LINEAR CR	L	1.00 Slabs
65 JT SEAL DMG	H	20.00 Slabs
71 FAULTING	M	2.00 Slabs

Sample Number: 03

Sample Type: R

Sample Comments:

Sample PCI: 70

Sample Area (Slabs): 20.00

62 CORNER BREAK	M	2.00 Slabs
63 LINEAR CR	L	1.00 Slabs
63 LINEAR CR	M	1.00 Slabs
65 JT SEAL DMG	M	20.00 Slabs

Sample Number: 04

Sample Type: R

Sample Comments:

Sample PCI: 45

Sample Area (Slabs): 20.00

62 CORNER BREAK	M	1.00 Slabs
63 LINEAR CR	L	1.00 Slabs
63 LINEAR CR	M	5.00 Slabs
65 JT SEAL DMG	M	20.00 Slabs
72 SHAT. SLAB	M	1.00 Slabs
73 SHRINKAGE CR	N	1.00 Slabs

APPENDIX D

WORK HISTORY REPORT

WORK HISTORY

Pavement Database: IA 2025

Generate Date: 6/29/2026

Network ID: CBF

Page 1

Network: COUNCIL BLUFFS MUNICIPAL AIRPORT

Branch - Section ID: A01CB - 001

LCD: 6/3/2010

Use: APRON

Rank: P

Surface: PCC

Length (ft): 530.00

Width (ft): 255.00

True Area (sf): 164,387.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-03-2010	CR-PC	Complete Reconstruction - PCC	-	8.00	True	8" P-501 PCC
06-02-2010	BA-AG	Base Course - Aggregate	-	6.00	False	6" P-208 base
06-01-2010	SG-CO	Subgrade - Compacted	-	12.00	False	12" P-152 Compacted SG
06-01-1965	NC-PC	New Construction - PCC	-	-	True	-

Branch - Section ID: A02CB - 001

LCD: 9/1/1995

Use: APRON

Rank: P

Surface: PCC

Length (ft): 300.00

Width (ft): 220.00

True Area (sf): 66,015.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
09-01-1995	CR-PC	Complete Reconstruction - PCC	-	6.00	True	6" PCC, 4" P209
06-01-1975	NC-AC	New Construction - AC	-	1.50	True	1.5" P401/6.5" P201/subgrade

Branch - Section ID: A03CB - 001

LCD: 6/1/2025

Use: APRON

Rank: P

Surface: PCC

Length (ft): 110.00

Width (ft): 120.00

True Area (sf): 13,788.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-01-2025	NC-PC	New Construction - PCC	-	8.00	True	8" PCC

Branch - Section ID: R14CB - 001

LCD: 6/3/2007

Use: RUNWAY

Rank: S

Surface: PCC

Length (ft): 2,957.00

Width (ft): 60.00

True Area (sf): 167,703.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-01-2024	JS-LC	Joint Seal (Localized)	-	-	False	field est.
06-03-2007	CR-PC	Complete Reconstruction - PCC	-	6.00	True	6" P-501
06-02-2007	BA-AG	Base Course - Aggregate	-	6.00	False	6" P-208
06-01-2007	SG-CO	Subgrade - Compacted	-	12.00	False	12" P-152 Compacted SG
06-01-1983	CR-PC	Complete Reconstruction - PCC	-	-	True	ESTIMATED CONSTRUCTION DATE
06-02-1967	NC-PC	New Construction - PCC	-	6.00	True	6" P-501
06-01-1967	SB-AG	Subbase - Aggregate	-	6.00	False	6" P-154

WORK HISTORY

Pavement Database: IA 2025

Generate Date: 6/29/2026

Network ID: CBF

Page 2

Branch - Section ID: R14CB - 002

LCD: 6/3/2007
Use: RUNWAY
Rank: S
Surface: PCC

Length (ft): 711.00
Width (ft): 60.00
True Area (sf): 44,038.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-01-2024	JS-LC	Joint Seal (Localized)	-	-	False	field est.
06-03-2007	CR-PC	Complete Reconstruction - PCC	-	6.00	True	6" P-501
06-02-2007	BA-AG	Base Course - Aggregate	-	6.00	False	6" P-208
06-01-2007	SG-CO	Subgrade - Compacted	-	12.00	False	6" P-152 Compacted SG
07-01-1983	NC-PC	New Construction - PCC	-	-	True	-

Branch - Section ID: R18CB - 001

LCD: 6/3/2006
Use: RUNWAY
Rank: P
Surface: PCC

Length (ft): 4,000.00
Width (ft): 100.00
True Area (sf): 400,000.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-01-2024	JS-LC	Joint Seal (Localized)	-	-	False	field est.
06-03-2006	CR-PC	Complete Reconstruction - PCC	-	8.00	True	-
06-02-2006	BA-AG	Base Course - Aggregate	-	6.00	False	-
06-01-2006	SB-AG	Subbase - Aggregate	-	12.00	False	-
01-01-1997	NC-PC	New Construction - PCC	-	-	True	-

Branch - Section ID: R18CB - 002

LCD: 6/3/2007
Use: RUNWAY
Rank: P
Surface: PCC

Length (ft): 1,500.00
Width (ft): 100.00
True Area (sf): 150,000.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-01-2024	JS-LC	Joint Seal (Localized)	-	-	False	field est.
06-01-2011	JS-LC	Joint Seal (Localized)	-	-	False	-
06-03-2007	CR-PC	Complete Reconstruction - PCC	-	8.00	True	-
06-02-2007	BA-AG	Base Course - Aggregate	-	6.00	False	-
06-01-2007	SB-AG	Subbase - Aggregate	-	12.00	False	-
01-01-1997	NC-PC	New Construction - PCC	-	-	True	-

Branch - Section ID: TACB - 001

LCD: 6/3/2007
Use: TAXIWAY
Rank: P
Surface: PCC

Length (ft): 1,720.00
Width (ft): 35.00
True Area (sf): 62,015.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-03-2007	CR-PC	Complete Reconstruction - PCC	-	6.00	True	-
06-02-2007	BA-AG	Base Course - Aggregate	-	6.00	False	-
06-01-2007	SB-AG	Subbase - Aggregate	-	12.00	False	-
01-01-1997	CR-PC	Complete Reconstruction - PCC	-	-	True	-
06-01-1983	NC-AC	New Construction - AC	-	-	True	-

WORK HISTORY

Pavement Database: IA 2025

Generate Date: 6/29/2026

Network ID: CBF

Page 3

Branch - Section ID: TACB - 002

LCD: 11/3/2009
Use: TAXIWAY
Rank: P
Surface: PCC

Length (ft): 790.00
Width (ft): 35.00
True Area (sf): 27,570.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
11-03-2009	CR-PC	Complete Reconstruction - PCC	-	8.00	True	-
11-02-2009	BA-AG	Base Course - Aggregate	-	6.00	False	-
11-01-2009	SG-CO	Subgrade - Compacted	-	12.00	False	-
06-01-2007	CR-AC	Complete Reconstruction - AC	-	-	True	-
10-01-1995	CR-PC	Complete Reconstruction - PCC	-	-	True	-
06-01-1983	NC-AC	New Construction - AC	-	-	True	-

Branch - Section ID: TACB - 003

LCD: 6/3/2007
Use: TAXIWAY
Rank: P
Surface: PCC

Length (ft): 330.00
Width (ft): 35.00
True Area (sf): 14,392.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-03-2007	CR-PC	Complete Reconstruction - PCC	-	8.00	True	-
06-02-2007	BA-AG	Base Course - Aggregate	-	6.00	False	-
06-01-2007	SB-AG	Subbase - Aggregate	-	12.00	False	-
06-01-1995	NC-PC	New Construction - PCC	-	-	True	-

Branch - Section ID: TB4CB - 001

LCD: 5/3/2024
Use: TAXIWAY
Rank: P
Surface: PCC

Length (ft): 727.00
Width (ft): 35.00
True Area (sf): 38,040.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
05-03-2024	NC-PC	New Construction - PCC	-	8.00	True	5" P-501
05-02-2024	SB-AG	Subbase - Aggregate	-	6.00	False	6" P-208
05-01-2024	SG-CO	Subgrade - Compacted	-	-	False	EXISTING SUBGRADE

Branch - Section ID: TBCB - 001

LCD: 6/3/2009
Use: TAXIWAY
Rank: P
Surface: PCC

Length (ft): 323.00
Width (ft): 35.00
True Area (sf): 21,182.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-03-2009	CR-PC	Complete Reconstruction - PCC	-	8.00	True	-
06-02-2009	BA-AG	Base Course - Aggregate	-	6.00	False	-
06-01-2009	SB-AG	Subbase - Aggregate	-	12.00	False	-
10-01-1995	CR-PC	Complete Reconstruction - PCC	-	-	True	-
06-01-1983	NC-AC	New Construction - AC	-	-	True	-

WORK HISTORY

Pavement Database: IA 2025

Generate Date: 6/29/2026

Network ID: CBF

Page 4

Branch - Section ID: TBCB - 002

LCD: 6/3/2009
Use: TAXIWAY
Rank: P
Surface: PCC

Length (ft): 500.00
Width (ft): 35.00
True Area (sf): 16,800.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-03-2009	NC-PC	New Construction - PCC	-	6.00	True	-
06-02-2009	BA-AG	Base Course - Aggregate	-	6.00	False	-
06-01-2009	SB-AG	Subbase - Aggregate	-	12.00	False	-

Branch - Section ID: TBCB - 003

LCD: 6/3/2006
Use: TAXIWAY
Rank: P
Surface: PCC

Length (ft): 1,060.00
Width (ft): 35.00
True Area (sf): 41,805.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-03-2006	NC-PC	New Construction - PCC	-	8.00	True	-
06-02-2006	BA-AG	Base Course - Aggregate	-	6.00	False	-
06-01-2006	SB-AG	Subbase - Aggregate	-	12.00	False	-

Branch - Section ID: TBCB - 004

LCD: 6/3/2006
Use: TAXIWAY
Rank: P
Surface: PCC

Length (ft): 3,364.00
Width (ft): 35.00
True Area (sf): 125,508.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-03-2006	CR-PC	Complete Reconstruction - PCC	-	8.00	True	-
06-02-2006	BA-AG	Base Course - Aggregate	-	6.00	False	-
06-01-2006	SB-AG	Subbase - Aggregate	-	12.00	False	-
06-01-1965	NC-PC	New Construction - PCC	-	-	True	-

Branch - Section ID: TCCB - 001

LCD: 6/3/2007
Use: TAXIWAY
Rank: P
Surface: PCC

Length (ft): 270.00
Width (ft): 35.00
True Area (sf): 13,340.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-03-2007	CR-PC	Complete Reconstruction - PCC	-	8.00	True	-
06-02-2007	BA-AG	Base Course - Aggregate	-	6.00	False	-
06-01-2007	SB-AG	Subbase - Aggregate	-	12.00	False	-
06-01-2005	CR-AC	Complete Reconstruction - AC	-	-	True	-
06-01-1983	NC-AC	New Construction - AC	-	-	True	-

WORK HISTORY

Pavement Database: IA 2025

Generate Date: 6/29/2026

Network ID: CBF

Page 5

Branch - Section ID: TCCB - 002

LCD: 6/3/2007
Use: TAXIWAY
Rank: P
Surface: PCC

Length (ft): 725.00
Width (ft): 35.00
True Area (sf): 32,471.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-03-2007	CR-PC	Complete Reconstruction - PCC	-	8.00	True	-
06-02-2007	BA-AG	Base Course - Aggregate	-	6.00	False	-
06-01-2007	SB-AG	Subbase - Aggregate	-	12.00	False	-
06-01-2005	NC-AC	New Construction - AC	-	-	True	-

Branch - Section ID: TDCB - 001

LCD: 9/3/2009
Use: TAXIWAY
Rank: P
Surface: PCC

Length (ft): 900.00
Width (ft): 35.00
True Area (sf): 40,675.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
09-03-2009	NC-PC	New Construction - PCC	-	6.00	True	-
09-02-2009	BA-AG	Base Course - Aggregate	-	6.00	False	-
09-01-2009	SB-AG	Subbase - Aggregate	-	12.00	False	-

Branch - Section ID: TH01CB - 001

LCD: 6/1/2004
Use: T-HANGAR
Rank: P
Surface: PCC

Length (ft): 1,512.00
Width (ft): 35.00
True Area (sf): 56,846.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-01-2004	NC-IN	New Construction - Initial	-	-	True	ESTIMATED

Branch - Section ID: TH01CB - 002

LCD: 11/3/2008
Use: T-HANGAR
Rank: P
Surface: PCC

Length (ft): 1,120.00
Width (ft): 30.00
True Area (sf): 33,456.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
11-03-2008	NC-IN	New Construction - Initial	-	6.00	True	6" P-505 PCC
11-02-2008	SB-AG	Subbase - Aggregate	-	6.00	False	6" P-154 Subbase
11-01-2008	SG-CO	Subgrade - Compacted	-	12.00	False	12" P-152 Compacted SG

Branch - Section ID: TH01CB - 003

LCD: 1/1/1995
Use: T-HANGAR
Rank: P
Surface: PCC

Length (ft): 525.00
Width (ft): 20.00
True Area (sf): 10,500.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
01-01-1995	NC-IN	New Construction - Initial	-	-	True	UNKNOWN, BETWEEN 1990 AND 2002

APPENDIX E

LOCALIZED PREVENTIVE MAINTENANCE POLICIES AND UNIT COST TABLES

Table E-1. Localized preventive maintenance policy, asphalt-surfaced pavements.

Distress Type	Severity Level	Maintenance Action
Alligator Cracking	Low	Monitor
Alligator Cracking	Medium	Asphalt Patch
Alligator Cracking	High	Asphalt Patch
Bleeding	N/A	Monitor
Block Cracking	Low	Monitor
Block Cracking	Medium	Crack Seal—Asphalt
Block Cracking	High	Crack Seal—Asphalt
Corrugation	Low	Monitor
Corrugation	Medium	Asphalt Patch
Corrugation	High	Asphalt Patch
Depression	Low	Monitor
Depression	Medium	Monitor
Depression	High	Asphalt Patch
Jet-Blast Erosion	N/A	Asphalt Patch
Joint Reflection Cracking	Low	Monitor
Joint Reflection Cracking	Medium	Crack Seal—Asphalt
Joint Reflection Cracking	High	Crack Seal—Asphalt
L&T Cracking	Low	Monitor
L&T Cracking	Medium	Crack Seal—Asphalt
L&T Cracking	High	Crack Seal—Asphalt
Oil Spillage	N/A	Asphalt Patch
Patching	Low	Monitor
Patching	Medium	Asphalt Patch
Patching	High	Asphalt Patch
Polished Aggregate	N/A	Monitor
Raveling	Low	Monitor
Raveling	Medium	Asphalt Patch
Raveling	High	Asphalt Patch
Rutting	Low	Monitor
Rutting	Medium	Monitor
Rutting	High	Asphalt Patch
Shoving	Low	Monitor
Shoving	Medium	Asphalt Patch
Shoving	High	Asphalt Patch
Slippage Cracking	N/A	Asphalt Patch
Swelling	Low	Monitor
Swelling	Medium	Monitor
Swelling	High	Asphalt Patch
Weathering	Low	Monitor
Weathering	Medium	Monitor
Weathering	High	Asphalt Patch

Table E-2. Localized preventive maintenance policy, concrete pavements.

Distress Type	Severity Level	Maintenance Action
ASR	Low	Monitor
ASR	Medium	Slab Replacement
ASR	High	Slab Replacement
Blowup	Low	Slab Replacement
Blowup	Medium	Slab Replacement
Blowup	High	Slab Replacement
Corner Break	Low	Crack Seal—Concrete
Corner Break	Medium	Full-Depth Concrete Patch
Corner Break	High	Full-Depth Concrete Patch
Durability Cracking	Low	Monitor
Durability Cracking	Medium	Full-Depth Concrete Patch
Durability Cracking	High	Slab Replacement
Faulting	Low	Monitor
Faulting	Medium	Grinding
Faulting	High	Slab Replacement
Joint Seal Damage	Low	Monitor
Joint Seal Damage	Medium	Joint Seal
Joint Seal Damage	High	Joint Seal
LTD Cracking	Low	Monitor
LTD Cracking	Medium	Crack Seal—Concrete
LTD Cracking	High	Slab Replacement
Patching (Small and Large)	Low	Monitor
Patching (Small and Large)	Medium	Full-Depth Concrete Patch
Patching (Small and Large)	High	Full-Depth Concrete Patch
Popouts	N/A	Monitor
Pumping	N/A	Monitor
Scaling	Low	Monitor
Scaling	Medium	Partial-Depth Concrete Patch
Scaling	High	Slab Replacement
Shattered Slab	Low	Crack Seal—Concrete
Shattered Slab	Medium	Slab Replacement
Shattered Slab	High	Slab Replacement
Shrinkage Cracking	N/A	Monitor
Spalling (Joint and Corner)	Low	Monitor
Spalling (Joint and Corner)	Medium	Partial-Depth Concrete Patch
Spalling (Joint and Corner)	High	Partial-Depth Concrete Patch

Table E-3. 2026 unit costs for localized preventive maintenance actions.

Maintenance Action	Unit Cost
Asphalt Patch—Asphalt-Surfaced Pavement	\$16.27/sf
Crack Sealing—Asphalt-Surfaced Pavement	\$2.78/lf
Partial-Depth Concrete Patch—Concrete Pavement	\$41.68/sf
Full-Depth Concrete Patch—Concrete Pavement	\$18.61/sf
Crack Sealing—Concrete Pavement	\$3.35/lf
Joint Sealing—Concrete Pavement	\$3.35/lf
Grinding—Concrete Pavement	\$0.40/sf
Slab Replacement—Concrete Pavement	\$18.61/sf

Table note: The unit cost estimates are based on broad statewide numbers and should be adjusted to reflect local costs.

Table E-4. 2026 unit costs (per square foot) based on pavement type and PCI ranges.

Pavement Type	PCI Range 0–40	PCI Range 40–50	PCI Range 50–60	PCI Range 60–70	PCI Range 70–80	PCI Range 80–90	PCI Range 90–100
Asphalt-Surfaced	\$11.55	\$5.46	\$5.46	\$5.46	\$0.00	\$0.00	\$0.00
Concrete	\$19.30	\$9.13	\$9.13	\$9.13	\$0.00	\$0.00	\$0.00

Table notes:

1. The unit cost estimates are based on broad statewide numbers and should be adjusted to reflect local costs.
2. Pavement type: asphalt-surfaced = AC (asphalt cement concrete), AAC (asphalt overlay on AC), or APC (asphalt overlay on concrete).

APPENDIX F

YEAR 2026 LOCALIZED PREVENTIVE MAINTENANCE DETAILS

Table F-1. Year 2026 localized preventive maintenance details.

Branch	Section	Distress Type	Severity	Distress Quantity	Distress Unit	Maintenance Action	Unit Cost	2026 Estimated Cost
A01CB	01	Joint Seal Damage	Medium	995	Slabs	Joint Seal (Localized)	\$3.35	\$72,593
A01CB	01	Joint Seal Damage	High	178	Slabs	Joint Seal (Localized)	\$3.35	\$12,963
A01CB	01	LTD Cracking	Medium	14	Slabs	Crack Sealing - PCC	\$3.35	\$536
A02CB	01	ASR	Medium	4	Slabs	Slab Replacement - PCC	\$18.61	\$8,769
A02CB	01	Corner Break	Medium	19	Slabs	Patching - PCC Full Depth	\$18.61	\$11,418
A02CB	01	Corner Spalling	Medium	15	Slabs	Patching - PCC Partial Depth	\$41.68	\$1,705
A02CB	01	Corner Spalling	High	4	Slabs	Patching - PCC Partial Depth	\$41.68	\$426
A02CB	01	Joint Seal Damage	High	532	Slabs	Joint Seal (Localized)	\$3.35	\$38,207
A02CB	01	Joint Spalling	Medium	11	Slabs	Patching - PCC Partial Depth	\$41.68	\$3,069
A02CB	01	Joint Spalling	High	4	Slabs	Patching - PCC Partial Depth	\$41.68	\$1,279
A02CB	01	LTD Cracking	Medium	34	Slabs	Crack Sealing - PCC	\$3.35	\$1,283
A02CB	01	Shattered Slab	Medium	4	Slabs	Slab Replacement - PCC	\$18.61	\$8,769
R14CB	01	Corner Break	Low	1	Slabs	Crack Sealing - PCC	\$3.35	\$27
R14CB	01	Corner Break	Medium	1	Slabs	Patching - PCC Full Depth	\$18.61	\$601
R14CB	01	LTD Cracking	Medium	38	Slabs	Crack Sealing - PCC	\$3.35	\$1,282
R14CB	01	Shattered Slab	Medium	1	Slabs	Slab Replacement - PCC	\$18.61	\$1,861
R14CB	02	LTD Cracking	Medium	3	Slabs	Crack Sealing - PCC	\$3.35	\$88
R18CB	01	Corner Spalling	Medium	10	Slabs	Patching - PCC Partial Depth	\$41.68	\$1,104
R18CB	02	Faulting	Medium	18	Slabs	Grinding (Localized)	\$0.40	\$90
R18CB	02	Faulting	High	12	Slabs	Slab Replacement - PCC	\$18.61	\$34,894
TACB	01	Joint Seal Damage	Medium	623	Slabs	Joint Seal (Localized)	\$3.35	\$33,799
TACB	01	Joint Seal Damage	High	86	Slabs	Joint Seal (Localized)	\$3.35	\$4,662

Table F-1. Year 2026 localized preventive maintenance details (continued).

Branch	Section	Distress Type	Severity	Distress Quantity	Distress Unit	Maintenance Action	Unit Cost	2026 Estimated Cost
TACB	02	Corner Spalling	Medium	3	Slabs	Patching - PCC Partial Depth	\$41.68	\$294
TACB	02	Joint Seal Damage	Medium	158	Slabs	Joint Seal (Localized)	\$3.35	\$8,518
TACB	03	Corner Spalling	Medium	2	Slabs	Patching - PCC Partial Depth	\$41.68	\$184
TACB	03	Faulting	Medium	3	Slabs	Grinding (Localized)	\$0.40	\$11
TACB	03	Joint Seal Damage	High	164	Slabs	Joint Seal (Localized)	\$3.35	\$8,808
TACB	03	Joint Spalling	Medium	3	Slabs	Patching - PCC Partial Depth	\$41.68	\$883
TBCB	01	Joint Seal Damage	Medium	242	Slabs	Joint Seal (Localized)	\$3.35	\$12,959
TBCB	02	Corner Break	Low	2	Slabs	Crack Sealing - PCC	\$3.35	\$55
TBCB	02	Corner Spalling	Medium	2	Slabs	Patching - PCC Partial Depth	\$41.68	\$224
TBCB	02	Joint Seal Damage	Medium	152	Slabs	Joint Seal (Localized)	\$3.35	\$8,185
TBCB	02	Joint Seal Damage	High	40	Slabs	Joint Seal (Localized)	\$3.35	\$2,154
TBCB	02	Small Patch	Medium	2	Slabs	Patching - PCC Full Depth	\$18.61	\$100
TBCB	03	Joint Seal Damage	Medium	273	Slabs	Joint Seal (Localized)	\$3.35	\$14,787
TBCB	03	Joint Seal Damage	High	68	Slabs	Joint Seal (Localized)	\$3.35	\$3,697
TBCB	03	Joint Spalling	Medium	3	Slabs	Patching - PCC Partial Depth	\$41.68	\$919
TBCB	03	LTD Cracking	Medium	3	Slabs	Crack Sealing - PCC	\$3.35	\$107
TBCB	04	Corner Break	Medium	8	Slabs	Patching - PCC Full Depth	\$18.61	\$4,741
TBCB	04	Corner Spalling	Medium	8	Slabs	Patching - PCC Partial Depth	\$41.68	\$885
TBCB	04	Joint Seal Damage	Medium	1,104	Slabs	Joint Seal (Localized)	\$3.35	\$60,311
TBCB	04	Joint Seal Damage	High	316	Slabs	Joint Seal (Localized)	\$3.35	\$17,232
TBCB	04	Joint Spalling	Medium	8	Slabs	Patching - PCC Partial Depth	\$41.68	\$2,124
TBCB	04	LTD Cracking	Medium	24	Slabs	Crack Sealing - PCC	\$3.35	\$747
TCCB	01	Joint Seal Damage	Medium	84	Slabs	Joint Seal (Localized)	\$3.35	\$4,482

Table F-1. Year 2026 localized preventive maintenance details (continued).

Branch	Section	Distress Type	Severity	Distress Quantity	Distress Unit	Maintenance Action	Unit Cost	2026 Estimated Cost
TCCB	01	Joint Seal Damage	High	68	Slabs	Joint Seal (Localized)	\$3.35	\$3,652
TCCB	02	Corner Spalling	Medium	3	Slabs	Patching - PCC Partial Depth	\$41.68	\$289
TCCB	02	Joint Seal Damage	Medium	371	Slabs	Joint Seal (Localized)	\$3.35	\$20,052
TDCB	01	Joint Seal Damage	Medium	62	Slabs	Joint Seal (Localized)	\$3.35	\$3,354
TDCB	01	Joint Seal Damage	High	403	Slabs	Joint Seal (Localized)	\$3.35	\$21,800
TH01CB	01	Corner Spalling	Medium	16	Slabs	Patching - PCC Partial Depth	\$41.68	\$1,808
TH01CB	01	Joint Seal Damage	High	395	Slabs	Joint Seal (Localized)	\$3.35	\$26,227
TH01CB	01	Joint Spalling	Medium	11	Slabs	Patching - PCC Partial Depth	\$41.68	\$2,893
TH01CB	01	Joint Spalling	High	3	Slabs	Patching - PCC Partial Depth	\$41.68	\$904
TH01CB	01	LTD Cracking	Medium	56	Slabs	Crack Sealing - PCC	\$3.35	\$2,268
TH01CB	01	Shattered Slab	Medium	3	Slabs	Slab Replacement - PCC	\$18.61	\$7,188
TH01CB	02	Corner Break	Low	5	Slabs	Crack Sealing - PCC	\$3.35	\$146
TH01CB	02	Joint Seal Damage	High	335	Slabs	Joint Seal (Localized)	\$3.35	\$18,580
TH01CB	02	Joint Spalling	Medium	3	Slabs	Patching - PCC Partial Depth	\$41.68	\$716
TH01CB	02	Joint Spalling	High	3	Slabs	Patching - PCC Partial Depth	\$41.68	\$895
TH01CB	02	LTD Cracking	Medium	3	Slabs	Crack Sealing - PCC	\$3.35	\$89
TH01CB	03	Corner Break	Medium	4	Slabs	Patching - PCC Full Depth	\$18.61	\$2,524
TH01CB	03	Faulting	Medium	3	Slabs	Grinding (Localized)	\$0.40	\$11
TH01CB	03	Joint Seal Damage	Medium	56	Slabs	Joint Seal (Localized)	\$3.35	\$3,004
TH01CB	03	Joint Seal Damage	High	28	Slabs	Joint Seal (Localized)	\$3.35	\$1,502
TH01CB	03	LTD Cracking	Medium	8	Slabs	Crack Sealing - PCC	\$3.35	\$317
TH01CB	03	Shattered Slab	Medium	1	Slabs	Slab Replacement - PCC	\$18.61	\$3,257

Table F-1. Year 2026 localized preventive maintenance details (continued).

Table notes:

1. See Figure 3 for the location of the branch and section.
2. Distress types are defined by ASTM D5340. L&T cracking = longitudinal and transverse cracking; LTD cracking = longitudinal, transverse, and diagonal cracking; ASR = alkali-silica reaction.
3. The costs provided are of a general nature for the entire State and may require adjustments to reflect specific conditions at Council Bluffs Municipal Airport.



PREPARED FOR

Iowa Department of Transportation
Modal Transportation Bureau
800 Lincoln Way
Ames, Iowa 50010
515-239-1691
<https://iowadot.gov/modes-travel/aviation>

AUGUST 2026