

Forest City Municipal Airport/Trimble Field



Pavement Management Report

PREPARED BY

Applied Pavement Technology, Inc.
1908 South First Street, Suite 201
Champaign, Illinois 61820
(217) 398-3977
www.appliedpavement.com

AUGUST 2026



The preparation of this document was financed in part through an Airport Improvement Program grant from the Federal Aviation Administration (Project Number 3-19-0000-033-2025) as provided under Section 505 of the Airport and Airway Improvement Act of 1982, as amended. The contents do not necessarily reflect the DOT's official views or the policy of the FAA. Acceptance of this report by the FAA does not in any way constitute a commitment on the part of the United States to participate in any development depicted therein nor does it indicate the proposed development is environmentally acceptable in accordance with appropriate public laws

FOREST CITY MUNICIPAL AIRPORT/ TRIMBLE FIELD PAVEMENT MANAGEMENT REPORT

Prepared For:




Iowa Department of Transportation
Modal Transportation Bureau
800 Lincoln Way
Ames, Iowa 50010
515-239-1691
<https://iowadot.gov/modes-travel/aviation>

Prepared By:



Applied Pavement Technology, Inc.
1908 South First Street, Suite 201
Champaign, Illinois 61820
217-398-3977
<https://www.appliedpavement.com>

In Association With:



Robinson Engineering Company
Consulting Engineers
1545 Dalton Street
Jesup, Iowa 50648
319-334-7211

TABLE OF CONTENTS

INTRODUCTION.....	1
PAVEMENT INVENTORY.....	3
PAVEMENT EVALUATION.....	6
Pavement Evaluation Procedure	6
Pavement Evaluation Results.....	8
Inspection Comments.....	13
Runways	13
Taxiways	13
Apron	13
T-Hangar.....	13
PAVEMENT MAINTENANCE AND REHABILITATION PROGRAM	15
Analysis Parameters.....	15
Critical PCIs	15
Localized Preventive Maintenance Policies and Unit Costs.....	15
Major Rehabilitation Unit Costs.....	15
Budget and Inflation Rate.....	15
Analysis Approach.....	15
Analysis Results	16
General Maintenance Recommendations.....	17
FAA Requirements (Public Law 103-305).....	17
FAA Advisory Circular 150/5830-7B, Appendix A. Pavement Management Program (PMP)	18
SUMMARY	23
REFERENCES.....	24

LIST OF FIGURES

Figure 1. Pavement condition versus cost of repair.	1
Figure 2. Pavement area by branch use at Forest City Municipal Airport/Trimble Field..	4
Figure 3. Forest City Municipal Airport/Trimble Field network definition map.....	5
Figure 4. Visual representation of PCI scale on typical pavement surfaces.	7
Figure 5. PCI versus repair type.....	8
Figure 6. Pavement area by PCI range at Forest City Municipal Airport/Trimble Field....	9
Figure 7. Area-weighted PCI by branch use at Forest City Municipal Airport/Trimble Field.	9
Figure 8. Forest City Municipal Airport/Trimble Field PCI map.....	10

LIST OF TABLES

Table 1. 2026 pavement evaluation results.	11
Table 2. 5-year M&R program under an unlimited funding analysis scenario.	16
Table 3. Pavement inspection report.....	20

APPENDICES

Appendix A. Cause of Distress TablesA-1

Appendix B. Inspection PhotographsB-1

Appendix C. Inspection Report..... C-1

Appendix D. Work History Report D-1

Appendix E. Localized Preventive Maintenance Policies and Unit Cost Tables.....E-1

Appendix F. Year 2026 Localized Preventive Maintenance Details F-1


INTRODUCTION

Applied Pavement Technology, Inc. (APTech), with assistance from Robinson Engineering Company Consulting Engineers (Robinson), updated the airport pavement management system (APMS) for the Iowa Department of Transportation, Modal Transportation Bureau (Iowa DOT). The APMS provides a means to monitor the condition of the pavements in the State of Iowa and to proactively plan for their preservation.

As part of this project, pavement conditions at Forest City Municipal Airport/Trimble Field were visually assessed in February 2026 using the Pavement Condition Index (PCI) procedure. During a PCI inspection, the types, severities, and amounts of distress present on the pavement surface are quantified. This information is then used to develop a composite index that represents the overall condition of the pavement in numerical terms, ranging from 0 (*Failed*) to 100 (*Excellent*). The PCI provides an overall measure of condition and an indication of the level of work that will be required to maintain or repair a pavement. The distress information also provides insight into what is causing the pavement to deteriorate, which is the first step in selecting the appropriate repair action to correct the problem.

Programmed into an APMS, PCI data and results are used to determine when preventive maintenance actions (such as crack or joint sealing) are advisable and to identify the most cost-effective time to perform major rehabilitation (such as an overlay or whitetopping). Delaying maintenance and rehabilitation (M&R) until a pavement structure has seriously degraded can cost many times more than if M&R was applied earlier in a pavement's life cycle, as shown in Figure 1. From a safety perspective, pavement distresses, such as cracks and loose debris, may pose risks in terms of the potential for aircraft tire damage and the ability of a pilot to safely control aircraft.

Figure 1. Pavement condition versus cost of repair.

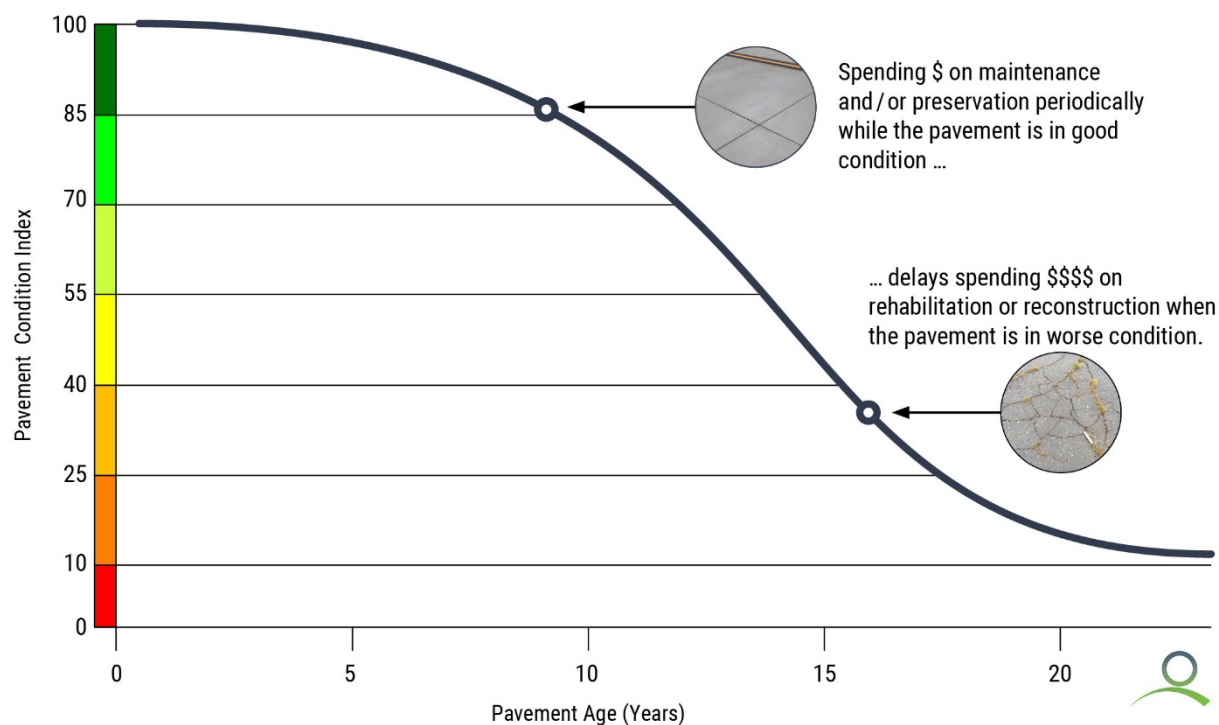

The pavement evaluation results for Forest City Municipal Airport/Trimble Field are presented in this report and can be used by Forest City Municipal Airport/Trimble Field, the Iowa DOT, and the Federal Aviation Administration (FAA) to identify, prioritize, and schedule pavement M&R actions at the airport. In addition to this report, the web-based interactive pavement data visualization tool IDEA, containing the information collected during this project, was updated and may be accessed from the [Iowa DOT's website](#) or directly ([Iowa APMS IDEA](#)).

PAVEMENT INVENTORY

The project began with a review of the existing inventory information pertaining to the pavements at Forest City Municipal Airport/Trimble Field. The date of original construction, along with the date of any subsequent rehabilitation; the location of completed work; and the type of work undertaken were gathered. The information was used to update the pavement management database and associated maps, as necessary, to account for pavement-related work that had been undertaken since the last time the airport was evaluated in 2022.


The pavement network at Forest City Municipal Airport/Trimble Field was then divided into branches, sections, and sample units. A branch is a single entity that serves a distinct function. For example, a runway is considered a branch because it serves a single function (allowing aircraft to take off and land). Taxiways, aprons, and T-hangars are also separate branches.

Each branch was further divided into sections. Traditionally, sections are defined as parts of the branch that share common attributes, such as cross section, date of last construction, traffic level, and performance. Using this approach, if a runway was built in 1968 and then extended in 1984, it would contain two separate sections.

To estimate the overall condition of a pavement section, each section was subdivided into sample units. Portions of these sample units were evaluated during the pavement inspection, and the collected information was extrapolated to predict the overall section condition and quantities of distress.

Approximately 954,700 square feet of pavement were evaluated at Forest City Municipal Airport/Trimble Field, as illustrated in Figure 2. This figure also shows the area-weighted age in years of the pavements at the time of the inspection. Figure 3 is a map that details how the pavement network was divided into management units and identifies the sample units that were evaluated during the pavement inspection at Forest City Municipal Airport/Trimble Field.

Figure 2. Pavement area by branch use at Forest City Municipal Airport/Trimble Field.

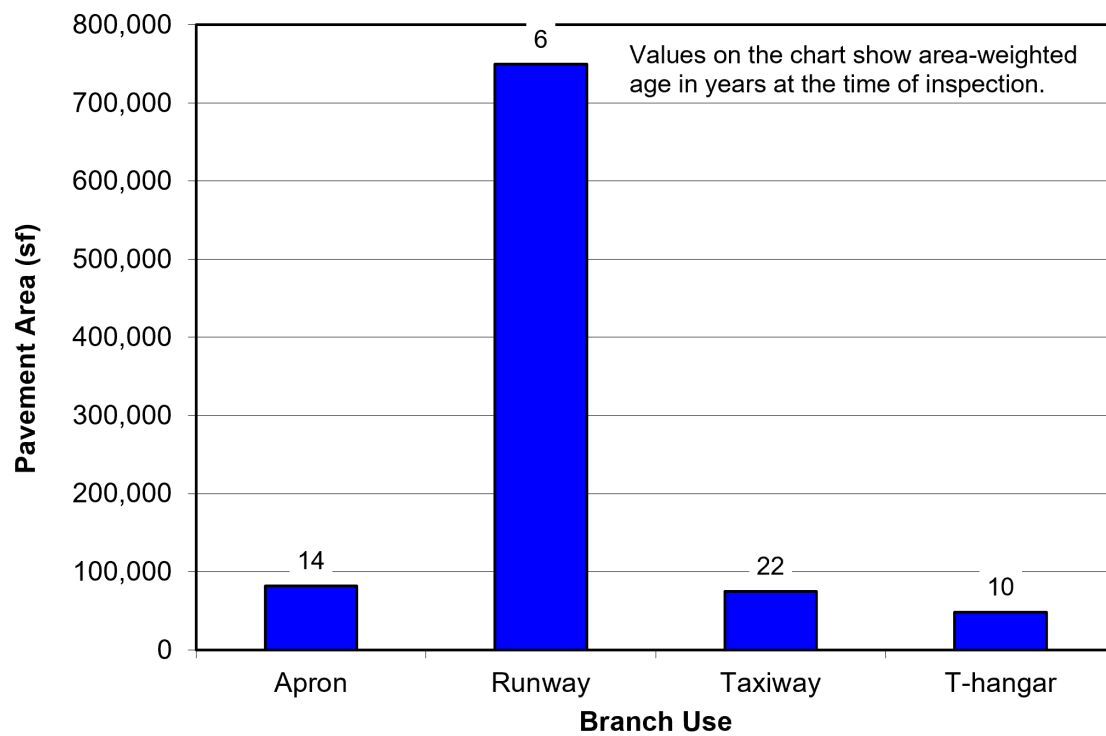



NETWORK DEFINITION LEGEND

	BRANCH IDENTIFIER
	SECTION IDENTIFIER
	PCI VALUE
R15FC-01 (54)	
	SECTION BREAK LINE
	SAMPLE UNIT BREAK LINE
	SLAB JOINT
03	SAMPLE UNIT NUMBER
03	SAMPLE UNIT INSPECTED
03	ADDITIONAL SAMPLE UNIT

PAVEMENT EVALUATION

Pavement Evaluation Procedure

APTech visually inspected the pavements at Forest City Municipal Airport/Trimble Field using the PCI procedure described in the following publications:

- FAA Advisory Circular 150/5380-6C, *Guidelines and Procedures for Maintenance of Airport Pavements* (FAA 2014a).
- FAA Advisory Circular 150/5380-7B, *Airport Pavement Management Program (PMP)*; (FAA 2014b).
- ASTM D5340, *Standard Test Method for Airport Pavement Condition Index Surveys* (ASTM 2024).
- USACE *PAVER Distress Identification Manuals* (USACE 2009a, 2009b).

During the PCI inspection, a cursory inspection of the entirety of a pavement section was performed. Sample units identified for more detailed inspection were verified, and adjustments to the selected sample units for inspection were made as needed to ensure an accurate assessment of the pavement's condition. Data pertaining to the types, severities, and quantities of observed pavement distresses were then collected within each sample unit. These data were then used to calculate the composite PCI of each pavement section. The PCI provides a numerical indication of overall pavement condition, as illustrated in Figure 4. The PCI ranges from a value of 0, which represents a pavement in a *Failed* condition, to a value of 100, which represents a pavement in *Excellent* condition with no visible signs of deterioration. It is important to note that factors other than overall PCI need to be considered when identifying the appropriate type of repair, including types of distress present and rate of deterioration. Also, since the PCI does not assess the structural integrity or capacity of the pavement structure, further testing may be needed to validate and refine the treatment strategy.


Figure 4. Visual representation of PCI scale on typical pavement surfaces.



Note: Photographs shown are not specific to Forest City Municipal Airport/Trimble Field.

Generally, pavements with relatively high PCIs that are not exhibiting significant load-related distress will benefit from preventive maintenance actions, such as crack sealing or joint resealing. As the PCI drops, the pavements may require major rehabilitation, such as an overlay or whitetopping. In some situations where the PCI has dropped low enough, reconstruction may be the only viable alternative due to the substantial damage to the pavement structure. Figure 5 illustrates how the appropriate repair type varies with the PCI of a pavement section and provides the corresponding colors used on the maps and charts in this report for each PCI range.

Figure 5. PCI versus repair type.

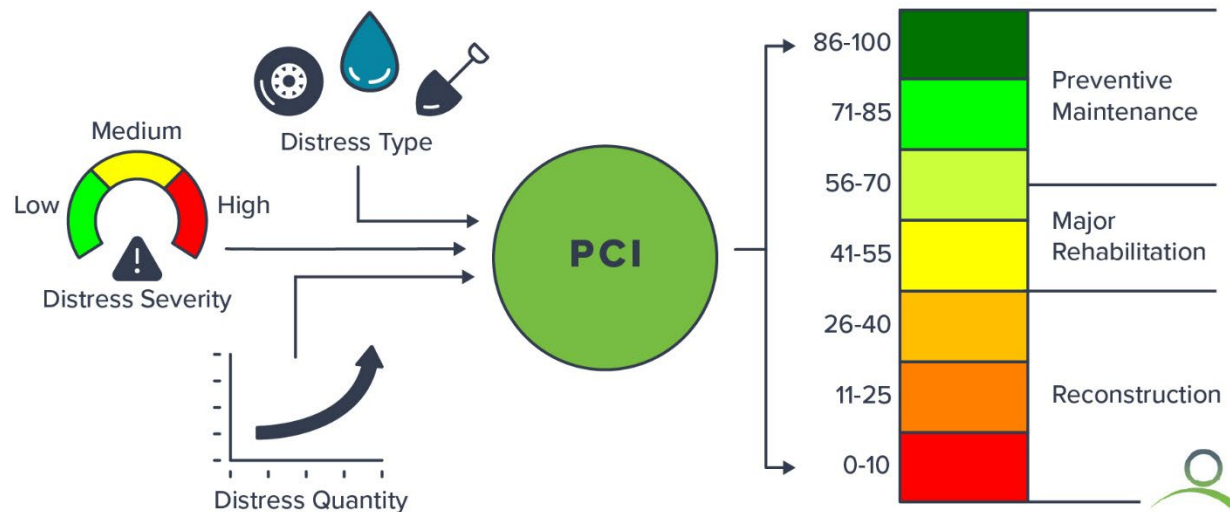

The types of distress identified during the PCI inspection provide insight into the cause of pavement deterioration, which is useful when selecting M&R strategies. Understanding the cause of distress helps in selecting a rehabilitation alternative that corrects the cause and thus eliminates or delays its recurrence. Appendix A identifies the distress types considered during a PCI inspection and describes the likely cause of each distress type. The PCI procedure is based on visual signs of pavement deterioration and does not provide a measure of structural capacity. PCI distress types are characterized as follows:

- Load-related distress types are caused by aircraft or vehicular traffic and may indicate a structural deficiency. Examples of load-related distress include alligator cracking on asphalt-surfaced pavements and shattered slabs or corner breaks on concrete pavements.
- Climate- and durability-related distress types often signify the presence of aged or environmentally susceptible (or both) material and include durability-related issues. Examples of climate- and durability-related distress include weathering on asphalt-surfaced pavements, which is climate related, and durability cracking on concrete pavements, which is durability related.
- Other distress types cannot be attributed solely to load or climate/durability. Examples of this type of distress include depressions on asphalt-surfaced pavements and shrinkage cracking on concrete pavements.

Pavement Evaluation Results

The pavements at Forest City Municipal Airport/Trimble Field were inspected in February 2026. The 2026 area-weighted condition of Forest City Municipal Airport/Trimble Field is 80, with conditions ranging from 40 to 100 (on a scale of 0 [*Failed*] to 100 [*Excellent*]). During the previous pavement inspection in 2022, the area-weighted PCI of the airport was 56.

Figure 6 summarizes the overall condition of the pavements at Forest City Municipal Airport/Trimble Field, and Figure 7 presents area-weighted condition (average PCI adjusted to account for the relative size of the pavement sections) by branch use. Figure 8 is a map that displays the condition of the evaluated pavements. Table 1 summarizes the results of the pavement evaluation. Appendix B presents photographs taken during the PCI inspection, and Appendix C contains detailed information on the distress types observed during the visual

survey. Appendix D includes detailed work history information that was collected during the record review process.

Figure 6. Pavement area by PCI range at Forest City Municipal Airport/Trimble Field.

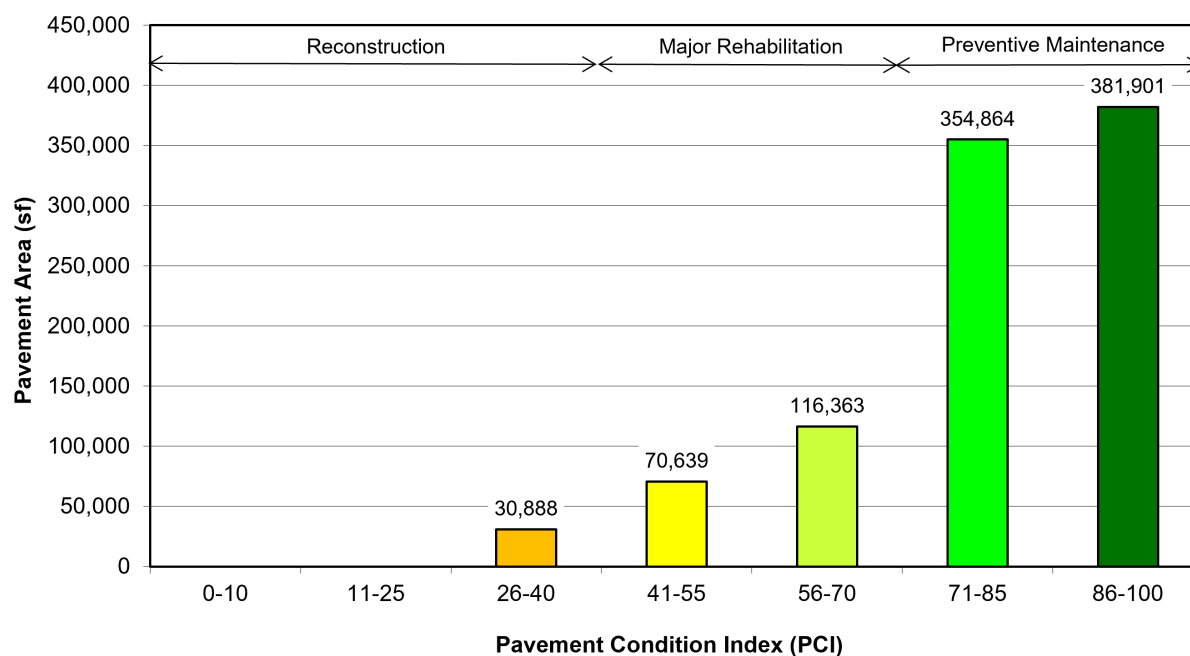


Figure 7. Area-weighted PCI by branch use at Forest City Municipal Airport/Trimble Field.
(Values on chart are area weighted.)



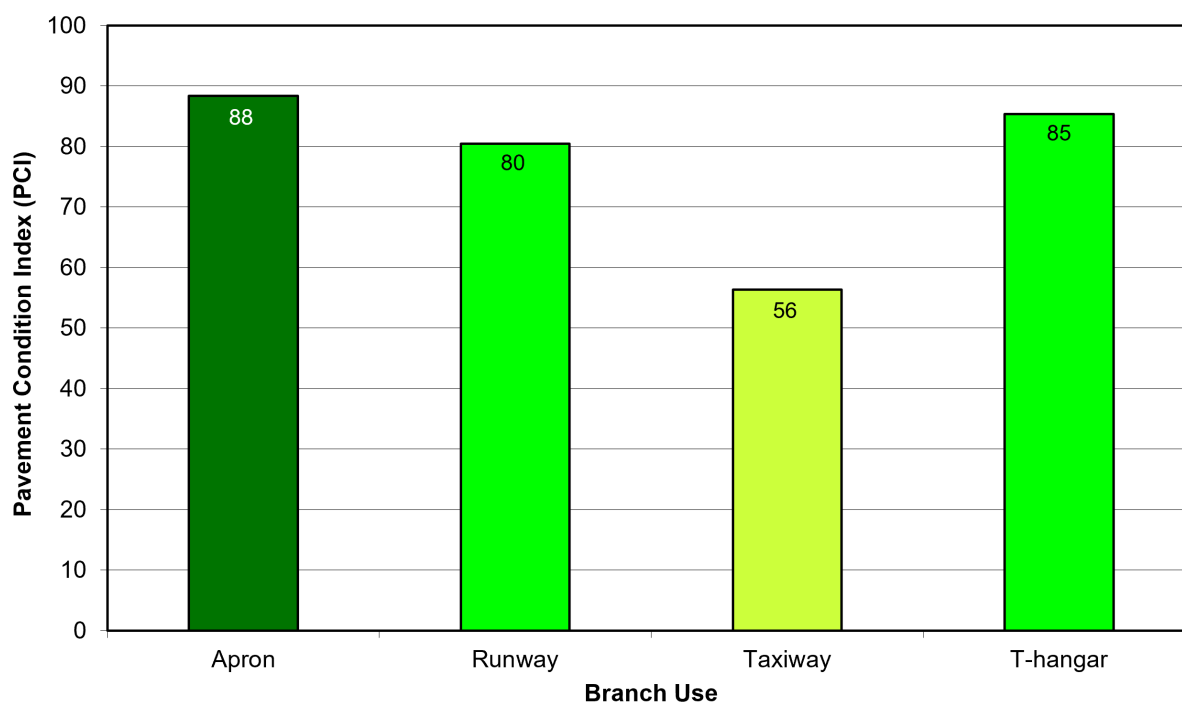


FIGURE 8. PCI MAP.

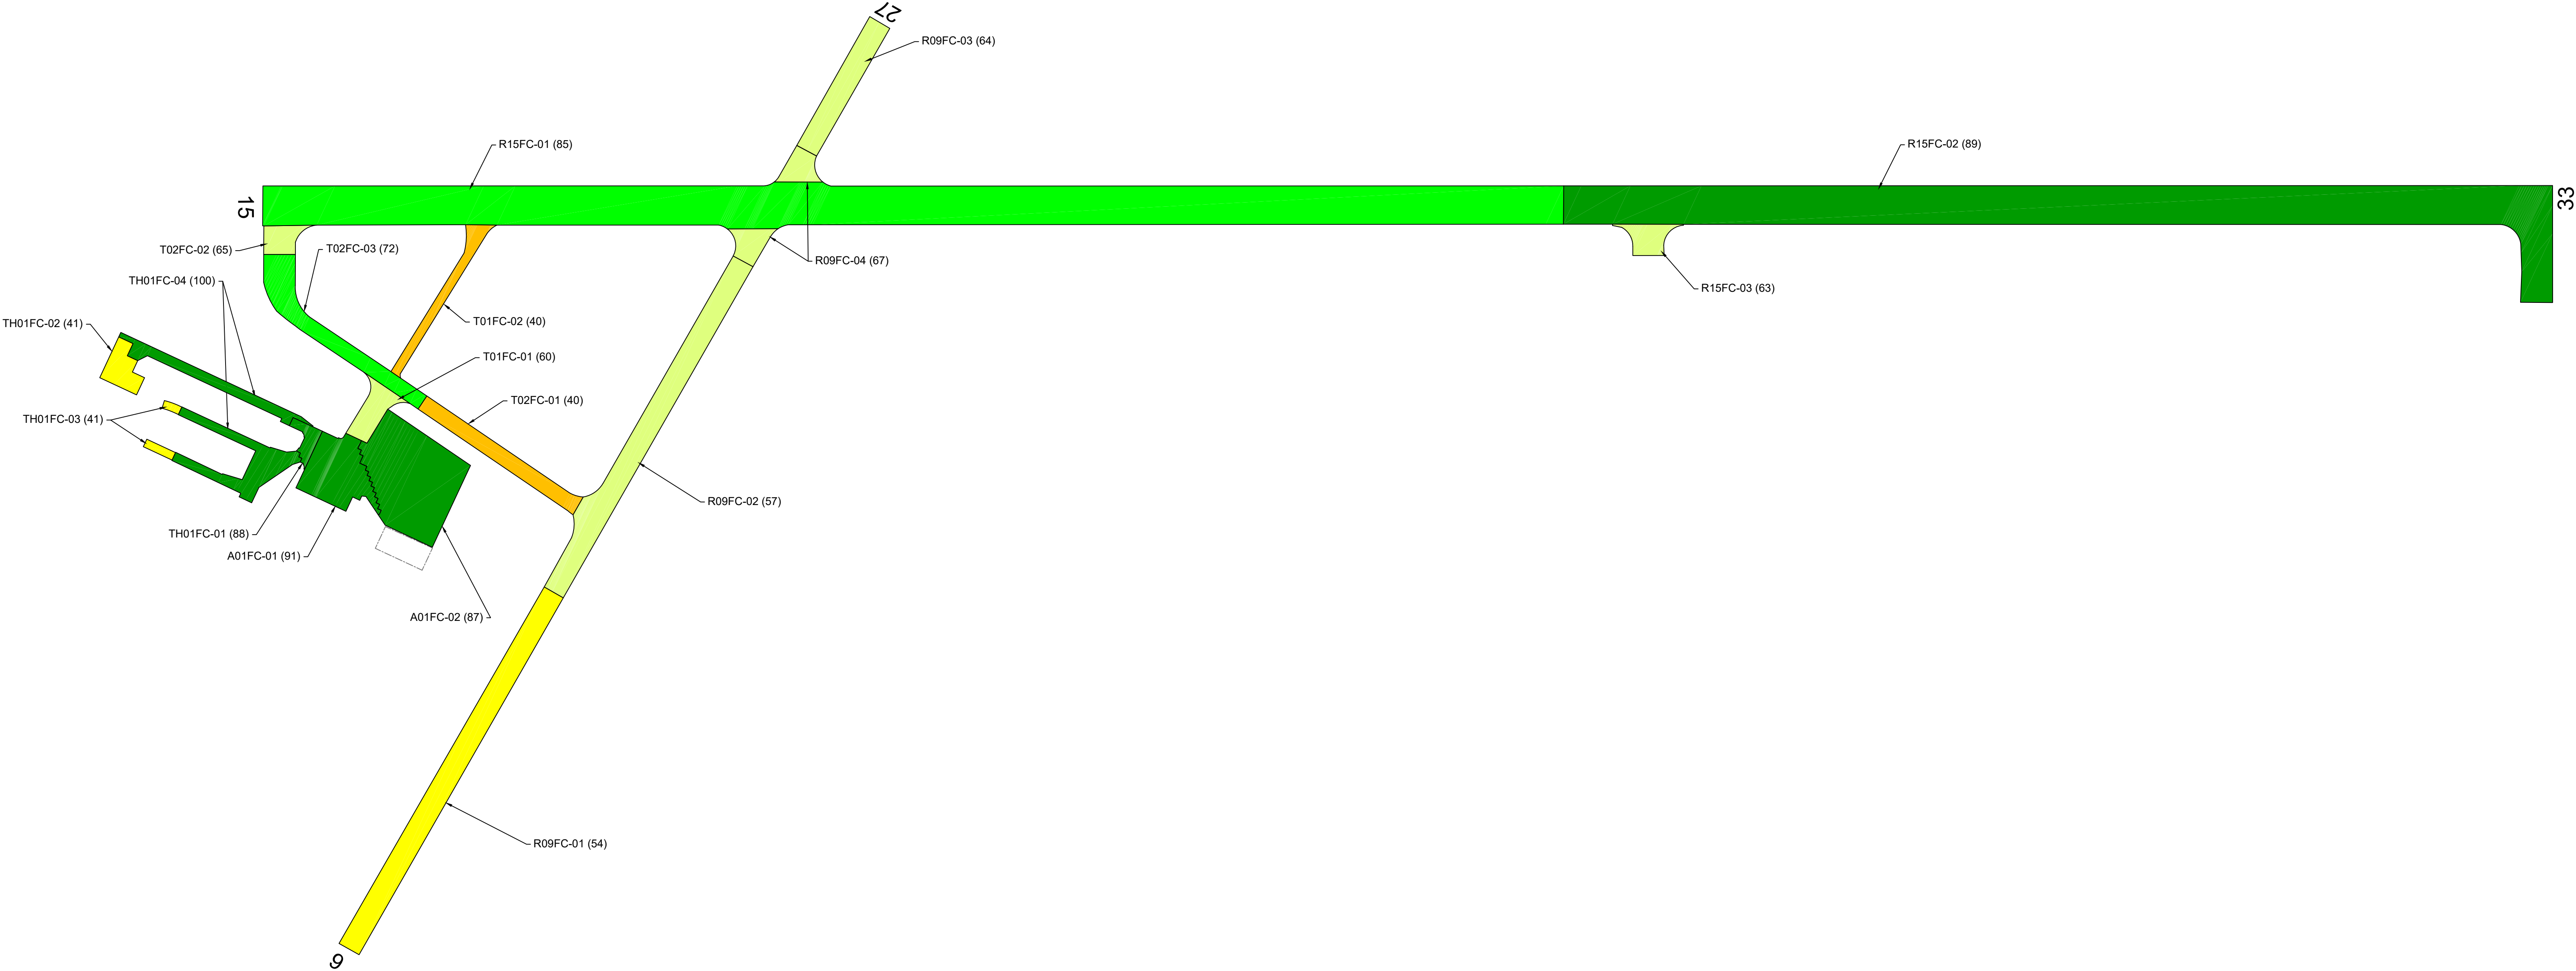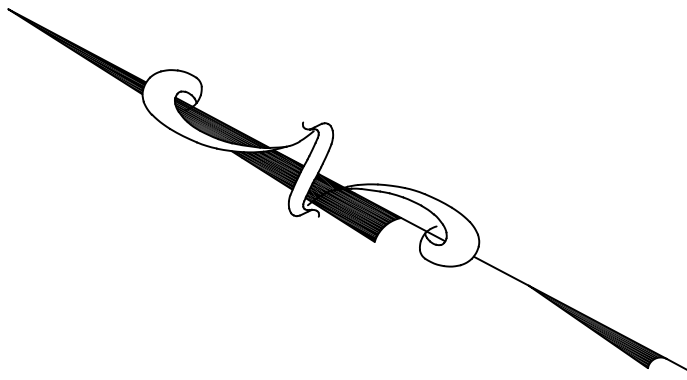

LEGEND

BRANCH IDENTIFIER

SECTION IDENTIFIER

PCI VALUE

SECTION BREAK LINE

PAVEMENT CONDITION INDEX

PCI

86-100
71-85
56-70
41-55
26-40
11-25
0-10



1908 South First Street, Suite 201
Champaign, Illinois 61820
Tel: 217-398-3977
Fax: 217-398-4027

Robinson Engineering Company
Consulting Engineers

1545 Dalton Street
Jesup, Iowa 50648
563-920-5382

Table 1. 2026 pavement evaluation results.

Branch	Section	Surface Type	Section Area (sf)	LCD	2026 PCI	% Distress Due to Load	% Distress Due to Climate/Durability	% Distress Due to Other	Type of Distress
A01FC	01	PCC	25,521	6/1/2007	91	23	65	12	Corner Spalling, Joint Spalling, Joint Seal Damage, LTD Cracking
A01FC	02	PCC	56,548	6/3/2014	87	38	39	23	Corner Break, Faulting, Joint Spalling, Joint Seal Damage, LTD Cracking
R09FC	01	AAC	59,477	6/1/2004	54	0	100	0	L&T Cracking, Raveling, Weathering
R09FC	02	AAC	57,466	6/1/2004	57	0	100	0	L&T Cracking, Weathering
R09FC	03	AAC	21,667	6/1/2004	64	17	83	0	Alligator Cracking, L&T Cracking, Weathering
R09FC	04	AAC	13,202	6/1/2007	67	0	100	0	L&T Cracking, Raveling, Weathering
R15FC	01	AAC	327,248	10/2/2024	85	0	100	0	L&T Cracking
R15FC	02	AAC	262,494	10/2/2024	89	0	100	0	L&T Cracking
R15FC	03	AAC	7,689	8/1/2007	63	0	100	0	L&T Cracking, Raveling, Weathering
T01FC	01	AAC	9,807	6/1/2012	60	0	100	0	L&T Cracking, Raveling, Weathering
T01FC	02	AC	11,766	11/1/2004	40	20	76	4	Alligator Cracking, Depression, L&T Cracking, Patching, Raveling, Weathering
T02FC	01	AC	19,122	7/1/1985	40	8	61	31	Alligator Cracking, Bleeding, L&T Cracking, Patching, Raveling, Weathering
T02FC	02	AAC	6,532	6/1/2012	65	0	100	0	L&T Cracking, Raveling, Weathering
T02FC	03	AAC	27,616	6/1/2012	72	0	100	0	L&T Cracking, Raveling, Weathering
TH01FC	01	PCC	4,229	6/1/2006	88	0	100	0	Joint Seal Damage
TH01FC	02	PCC	8,516	1/1/1991	41	83	12	5	Joint Spalling, Joint Seal Damage, LTD Cracking, Shattered Slab, Shrinkage Cracking
TH01FC	03	AC	2,646	1/1/1994	41	44	56	0	Alligator Cracking, L&T Cracking, Weathering
TH01FC	04	PCC	33,109	8/3/2025	100	0	0	0	No Distress

Table 1. 2026 pavement evaluation results (continued).

- Table notes:
- 1. See Figure 3 for the location of the branch and section.
 - 2. Surface type: AC = asphalt cement concrete; AAC = asphalt overlay on AC; PCC = portland cement concrete; APC = asphalt overlay on concrete.
 - 3. LCD = last construction date.
 - 4. Distress due to load includes distress types that are attributed to a structural deficiency in the pavement, such as alligator cracking or rutting on asphalt-surfaced pavements or shattered slabs on concrete pavements.
 - 5. Distress due to climate or durability includes distress types that are attributed to either the aging of the pavement and the effects of the environment (such as weathering, raveling, or block cracking on asphalt-surfaced pavements) or to a materials-related problem (such as durability cracking or alkali-silica reaction [ASR] on concrete pavements). If materials-related distresses were recorded during the inspection, further laboratory testing is required to definitively determine the type present.
 - 6. Distress due to other refers to distress types that are not attributed to one factor but rather may be caused by a combination of factors.
 - 7. Distress types are defined by ASTM D5340. L&T cracking = longitudinal and transverse cracking; LTD cracking = longitudinal, transverse, and diagonal cracking; ASR = alkali-silica reaction.

Inspection Comments

Forest City Municipal Airport/Trimble Field was inspected on February 26, 2026. Eighteen pavement sections were defined during the inspection.

Runways

Runway 09/27 consisted of four sections. Section 01 contained all severities of longitudinal and transverse (L&T) cracking, low- and high-severity raveling, and low-severity weathering. All severities of L&T cracking and low-severity weathering were identified in Section 02. Section 03 had medium-severity alligator cracking, all severities of L&T cracking, and low-severity weathering recorded. All severities of L&T cracking, low-severity raveling, and medium-severity weathering were noted in Section 04. The low-severity L&T cracking on Runway 09/27 was unsealed, the medium-severity L&T cracking was recorded where either crack sealant was unsatisfactory or unsealed crack widths were greater than $\frac{1}{4}$ inch, and the high-severity L&T cracking was noted where either secondary cracking was wider than 1 foot or crack widths were greater than 3 inches.

Runway 15/33 was defined by three sections. Sections 01, 02, and 03 had low- and medium-severity L&T cracking noted throughout. The low-severity L&T cracking was unsealed, and the medium-severity L&T cracking was due to unsealed crack widths that exceeded $\frac{1}{4}$ inch. Section 03 also contained areas of low-severity raveling and medium-severity weathering.

Taxiways

Taxiway 01 contained two sections. Low- and medium-severity L&T cracking and medium-severity weathering and raveling were identified in Section 01. Section 02 had areas of low- and medium-severity alligator cracking and depression, all severities of L&T cracking, low-severity patching, low- and high-severity raveling, and medium-severity weathering recorded during the inspection. The low-severity L&T cracking on Taxiway 01 was unsealed, the medium-severity L&T cracking was due to unsealed crack widths greater than $\frac{1}{4}$ inch, and the high-severity L&T cracking was recorded in areas where either the development of secondary cracking was wider than 1 foot or crack widths exceeded 3 inches.

Taxiway 02 consisted of three sections. Section 01 was in *Poor* condition with medium-severity alligator cracking, bleeding, all severities of L&T cracking, low-severity patching and raveling, and medium-severity weathering observed. Section 02 contained all severities of L&T cracking and low-severity raveling and weathering. Low- and medium-severity L&T cracking and weathering and low-severity raveling were identified in Section 03. The low-severity L&T cracking on Taxiway 02 was both sealed and unsealed, the medium-severity L&T cracking was due to unsealed crack widths greater than $\frac{1}{4}$ inch, and the high-severity L&T cracking was recorded in areas where either secondary cracking was wider than 1 foot or crack widths exceeded 3 inches.

Apron

The apron area was defined by two sections. Low-severity corner spalling and medium-severity joint seal damage, joint spalling, and longitudinal, transverse, and diagonal (LTD) cracking were observed in Section 01. Section 02 contained medium-severity faulting and joint seal damage and low- and medium-severity corner break, joint spalling, and LTD cracking.

T-Hangar

The T-hangar area consisted of four sections. Section 01 had only high-severity joint seal damage noted. Section 02 contained high-severity joint seal damage, medium-severity joint spalling, low- and medium-severity LTD cracking and shattered slab, and shrinkage cracking.

Medium-severity alligator cracking and weathering and low- and medium-severity L&T cracking were recorded in Section 03. Section 04 was in *Excellent* condition with no distress noted at the time of inspection.

PAVEMENT MAINTENANCE AND REHABILITATION PROGRAM

Using the information collected during the pavement inspection, the PAVER pavement management software was used to develop a 5-year M&R program for Forest City Municipal Airport/Trimble Field (USACE 2021). In addition, a 1-year plan for localized preventive maintenance (such as crack sealing and patching) was prepared.

Analysis Parameters

Critical PCIs

PAVER uses critical PCIs to determine whether localized preventive maintenance or major rehabilitation is the appropriate repair action. Above the critical PCI, localized preventive maintenance activities are recommended. Below the critical PCI, major rehabilitation actions, such as an overlay or reconstruction, are recommended. The Iowa DOT set the critical PCIs at 65 for runways, 60 for taxiways, and 55 for aprons and T-hangars.

Localized Preventive Maintenance Policies and Unit Costs

Localized preventive maintenance policies were developed for asphalt-surfaced and concrete pavements. These policies, shown in Appendix E, identify the localized preventive maintenance actions that the Iowa DOT considered appropriate to correct the various distress types and severities. The Iowa DOT provided unit costs for each of the localized preventive maintenance actions included in these policies. These costs are detailed in Appendix E. This information is of a general nature for the entire State. The localized preventive maintenance policies and unit costs may require adjustments to reflect specific conditions at Forest City Municipal Airport/Trimble Field.

Major Rehabilitation Unit Costs

PAVER estimates the cost of major rehabilitation based on the predicted PCI of the pavement section. The Iowa DOT provided the costs for major rehabilitation. These costs are detailed in Appendix E. If major rehabilitation is recommended in the 5-year program, further engineering investigation will be needed to identify the most appropriate rehabilitation action and to estimate the cost of such work more accurately.

Budget and Inflation Rate

An unlimited budget with a start date of August 1, 2026, and an inflation rate of 2.3 percent was used during the analysis.

Analysis Approach

The 5-year M&R program was prepared with the goal of maintaining the pavements above established critical PCIs. During this analysis, major rehabilitation was recommended for pavements in the year they dropped below their critical PCI. For the first year (2026) of the analysis only, a localized preventive maintenance plan was developed for those pavement sections that were above their critical PCI. If major rehabilitation was triggered for a section in 2027 or 2028, then localized preventive maintenance was not recommended for 2026. While localized preventive maintenance should be an annual undertaking at Forest City Municipal Airport/Trimble Field, it is not possible to accurately predict the propagation of cracking and other distress types. Therefore, the airport should budget for maintenance every year and can use the 2026 localized preventive maintenance plan as a baseline for that work. As the pavements age, it can be assumed that the amount of localized preventive maintenance required will increase.

Analysis Results

A summary of the M&R program for Forest City Municipal Airport/Trimble Field is presented in Table 2. Detailed information on the recommended localized preventive maintenance plan for 2026 is in Appendix F.

Table 2. 5-year M&R program under an unlimited funding analysis scenario.

Year	Branch	Section	Surface Type	Type of Repair	Estimated Cost
2026	A01FC	01	PCC	Preventive Maintenance	\$16,582
2026	A01FC	02	PCC	Preventive Maintenance	\$42,415
2026	R09FC	01	AAC	Major Rehabilitation	\$324,745
2026	R09FC	02	AAC	Major Rehabilitation	\$313,765
2026	R09FC	03	AAC	Major Rehabilitation	\$118,302
2026	R15FC	01	AAC	Preventive Maintenance	\$8,214
2026	R15FC	02	AAC	Preventive Maintenance	\$5,609
2026	R15FC	03	AAC	Major Rehabilitation	\$41,982
2026	T01FC	01	AAC	Major Rehabilitation	\$53,546
2026	T01FC	02	AC	Major Rehabilitation	\$135,897
2026	T02FC	01	AC	Major Rehabilitation	\$220,859
2026	T02FC	03	AAC	Preventive Maintenance	\$945
2026	TH01FC	01	PCC	Preventive Maintenance	\$2,362
2026	TH01FC	02	PCC	Major Rehabilitation	\$161,241
2026	TH01FC	03	AC	Major Rehabilitation	\$30,561
2027	R09FC	04	AAC	Major Rehabilitation	\$73,741
2028	T02FC	02	AAC	Major Rehabilitation	\$37,324

Total Estimated Cost: \$1,588,000

Table notes:

1. See Figure 3 for the location of the branch and section.
2. Surface type: AC = asphalt cement concrete; AAC = asphalt overlay on AC; PCC = portland cement concrete; APC = asphalt overlay on concrete.
3. Type of repair: major rehabilitation, such as pavement reconstruction or an overlay; localized preventive maintenance, such as crack sealing or patching.
4. The estimated costs provided are of a general nature for the entire State and may require adjustments to reflect specific conditions at Forest City Municipal Airport/Trimble Field.

The recommendations made in this report are based on a broad network-level analysis and meant to provide Forest City Municipal Airport/Trimble Field with an indication of the type of pavement-related work required during the next 5 years. Further engineering investigation may be necessary to identify which repair action is most appropriate. In addition, the cost estimates provided are based on overall unit costs for the entire State, and Forest City Municipal Airport/Trimble Field should adjust the plan to reflect local costs.

Because an unlimited budget was used in the analysis, it is possible that the pavement repair program may need to be adjusted to consider economic or operational constraints. The identification of a project need does not necessarily mean that State or Federal funding will be available in the year it is indicated. It is important to remember that regardless of the

recommendations presented within this report, Forest City Municipal Airport/Trimble Field is responsible for repairing pavements where existing conditions pose a hazard to safe operations.

General Maintenance Recommendations

In addition to the specific maintenance actions presented in Appendix F, it is recommended that the following strategies be considered for prolonging pavement life:

1. Regularly inspect all safety areas of the airport and document all inspection activity. A sample form that can be used to perform these inspections is provided in Table 3 of this report.
2. Track all maintenance activities that occur and have the documentation available if requested by the FAA and the Iowa DOT. This is important because this information is used to update the APMS records and is required to remain in compliance with Public Law 103-305 (see the next section of this report for further information on this law).
3. Conduct an aggressive campaign against weed growth through timely herbicide applications and mowing programs of the safety areas. Vegetation growth in pavement cracks is destructive and significantly increases the rate of pavement deterioration.
4. Implement a periodic crack and joint sealing program. Keeping water and debris out of the pavement system by sealing cracks and joints is a proven and cost-effective method for extending the life of the pavement system.
5. Ensure all edges of pavement maintain the required 1.5-inch lip. This enables the water to drain away from the pavement system.
6. Closely monitor the movement of heavy equipment, such as farming, construction, mowing, emergency, and fueling equipment, to ensure such equipment is only operating on pavement designed to accommodate heavy loads. Failure to restrict heavy equipment to appropriate areas may result in the premature failure of airport pavements.
7. Other maintenance necessities include keeping all pavement markings well painted, safety signage clear of debris and weeds, the lighting systems continuously operational, and the operating areas free of debris found.

These recommendations are only a portion of the responsibility each sponsor has in maintaining an airport. Each airport sponsor must provide regular airport maintenance to all its aviation facilities both in the aircraft movement areas and all adjacent areas supporting aviation. It is particularly important to be vigilant in repairing pavements where conditions can pose a hazard to safe operations.

FAA Requirements (Public Law 103-305)

Because Forest City Municipal Airport/Trimble Field is in the National Plan of Integrated Airport Systems (NPIAS), the airport sponsor is required to keep the airport in a viable operating condition. This includes maintaining airport pavements in accordance with Public Law 103-305 (GPO 1994). Public Law 103-305 states that after January 1, 1995, NPIAS airport sponsors must provide assurances or certifications that an airport has implemented an effective airport pavement maintenance management system (PMMS) before the airport will be considered for Federal funding of pavement replacement or reconstruction projects. To be in full compliance with Federal law, the PMMS must include the following components at minimum: pavement inventory, pavement inspections, record keeping, information retrieval, and program funding.

By undertaking this project, the Iowa DOT has provided Forest City Municipal Airport/Trimble Field with an excellent basis for meeting the requirements of this law. This report serves as a complete pavement inventory and detailed inspection. To remain in compliance with the law,

Forest City Municipal Airport/Trimble Field will also need to undertake monthly drive-by inspections of pavement conditions and track pavement-related maintenance activities.

FAA Advisory Circular [150/5380-7B](#) (FAA 2014b) provides detailed guidance pertaining to the requirements for an acceptable pavement management program (PMP). Appendix A of the FAA Advisory Circular outlines what needs to be included in a PMP to remain in compliance with this law and Grant Assurance 11. The following is a copy of this appendix, along with instructions for supplementing this report so that all requirements are met. **Note that the italicized text is a direct quotation from the FAA Advisory Circular.**

FAA Advisory Circular 150/5830-7B, Appendix A. Pavement Management Program (PMP)

A-1.0. An effective PMP specifies the procedures to follow to assure that proper preventative and remedial pavement maintenance is performed. The program should identify funding or anticipated funding and other resources available to provide remedial and preventive maintenance activities. An airport sponsor may use any format deemed appropriate, but the program needs to, as a minimum, include the following:

A-1.1. Pavement Inventory. *The following must be depicted:*

- a. *Identification of all runways, taxiways, and aprons with pavement broken down into sections each having similar properties.*

The network definition map in Figure 3 of this report shows the location of all runways, taxiways, aprons, and T-hangars at Forest City Municipal Airport/Trimble *Field*. If any new pavements are constructed or any pavement areas are permanently closed, this map must be updated. Project plans should be submitted to the Iowa DOT after project completion.

- b. *Dimensions of pavement sections.*

The dimensions of all runways, taxiways, aprons, and T-hangars are stored in the PAVER database. Appendix C provides information on length, width, and area. In addition, the network definition map in Figure 3 is drawn to scale. Any changes to pavement dimensions must be recorded.

- c. *Type of pavement surface.*

The type of pavement for each section at Forest City Municipal Airport/Trimble *Field* is listed in Table 1 of this report and is also stored in the PAVER database. Any changes to the pavement type through an overlay or reconstruction must be recorded.

- d. *Year of construction and/or most recent major rehabilitation.*

Dates for pavement construction, rehabilitation, or reconstruction must be recorded. The current pavement history for Forest City Municipal Airport/Trimble *Field* is in Appendix D of this report.

- e. *Whether AIP [Airport Improvement Program] or PFC [Passenger Facility Charge] funds were used to construct, reconstruct, or repair the pavement.*

Funding sources for all pavement projects should be recorded.

A-1.2. PMP Pavement Inspection Schedule. *Airports must perform a detailed inspection of airfield pavements at least once a year for the PMP. If a pavement condition index (PCI) survey is performed, as set forth in ASTM D5340, Standard Test Method for Airport Pavement Condition Index Surveys, the frequency of the detailed inspection by PCI surveys may be*

extended to three years. Less comprehensive routine daily, weekly, and monthly maintenance inspections required for operations should be addressed.

This report consists of a detailed inspection that will extend the inspection period to 3 years. It is the airport sponsor's responsibility to perform monthly drive-by inspections. A sample pavement inspection report form is provided in Table 3 of this report.

A-1.3. Record Keeping. *The airport must record and keep on file complete information about all detailed inspections and maintenance performed until the pavement system is replaced. The types of distress, their locations, and remedial action, scheduled or performed, must be documented. The minimum information recorded includes:*

- a. Inspection date*
- b. Location*
- c. Distress types*
- d. Maintenance scheduled or performed*

Items *a* through *c* are satisfied by this inspection report. Item *d* is the responsibility of the airport, as is record keeping of the monthly drive-by inspections.

A-1.4. Information Retrieval. *An airport sponsor may use any form of record keeping it deems appropriate so long as the information and records from the pavement survey can generate required reports, as necessary.*

Keep this report, monthly drive-by inspection reports, construction updates, and all records of maintenance activities in a readily accessible location so that they can be easily retrieved as requested by the FAA.

Table 3. Pavement inspection report.

Inspected By: _____

Date Inspected: _____

Branch	Section	Distress Description/Dimensions/Severity/ Recommended Action	Description of Repair	Date Performed	Cost	Funding Source
A01FC	01					
A01FC	02					
R09FC	01					
R09FC	02					
R09FC	03					
R09FC	04					

Table 3. Pavement inspection report (continued).

Inspected By: _____

Date Inspected: _____

Branch	Section	Distress Description/Dimensions/Severity/ Recommended Action	Description of Repair	Date Performed	Cost	Funding Source
R15FC	01					
R15FC	02					
R15FC	03					
T01FC	01					
T01FC	02					
T02FC	01					

Table 3. Pavement inspection report (continued).

Inspected By: _____

Date Inspected: _____

Branch	Section	Distress Description/Dimensions/Severity/ Recommended Action	Description of Repair	Date Performed	Cost	Funding Source
T02FC	02					
T02FC	03					
TH01FC	01					
TH01FC	02					
TH01FC	03					
TH01FC	04					

Table note: See Figure 3 for the location of the branch and section.

SUMMARY

This report documents the results of the pavement evaluation conducted at Forest City Municipal Airport/Trimble Field. A visual inspection of the pavements in 2026 found that the overall condition of the pavement network is a PCI of 80. A 5-year pavement repair program, shown in Table 2, was generated for Forest City Municipal Airport/Trimble Field, which revealed that approximately \$1,588,000 needs to be expended on M&R. Forest City Municipal Airport/Trimble Field should utilize these study results to assist in planning for future maintenance needs as part of the airport CIP planning process.

REFERENCES

ASTM International (ASTM). 2024. *Standard Test Method for Airport Pavement Condition Index Surveys*. ASTM D5340. ASTM International, West Conshohocken, PA.

Federal Aviation Administration (FAA). 2014a. [*Guidelines and Procedures for Maintenance of Airport Pavements*](#). Advisory Circular 150/5380-6C. Federal Aviation Administration, Washington, DC.

Federal Aviation Administration (FAA). 2014b. [*Airport Pavement Management Program \(PMP\)*](#). Advisory Circular 150/5380-7B. Federal Aviation Administration, Washington, DC.

Government Printing Office (GPO). 1994. *Federal Aviation Administration Authorization Act of 1994*. P.L. 103-305. Vol 108. Stat. 1569.

U.S. Army Corps of Engineers (USACE). 2009a. [*Asphalt Surfaced Airfields. PAVER Distress Identification Manual*](#). USACE, Washington, DC.

U.S. Army Corps of Engineers (USACE). 2009b. [*Concrete Surfaced Airfields. PAVER Distress Identification Manual*](#). USACE, Washington, DC.

U.S. Army Corps of Engineers (USACE). 2021. PAVER. (Software). USACE, Transportation Systems Center, Omaha, NE.

APPENDIX A

CAUSE OF DISTRESS TABLES

Table A-1. Cause of pavement distress, asphalt-surfaced pavements (USACE 2009a).

Distress Type	Probable Cause of Distress
Alligator Cracking	Fatigue failure of the asphalt surface under repeated traffic loading.
Bleeding	Excessive amounts of asphalt cement or tars in the mix or low air void content, or both.
Block Cracking	Shrinkage of the asphalt and daily temperature cycling; it is not load associated.
Corrugation	Traffic action combined with an unstable pavement layer.
Depression	Settlement of the foundation soil or can be “built up” during construction.
Jet-Blast Erosion	Bituminous binder has been burned or carbonized.
Joint Reflection Cracking	Movement of the concrete slab beneath the asphalt surface due to thermal and moisture changes.
L&T Cracking	Cracks may be caused by (1) a poorly constructed paving lane joint, (2) shrinkage of the asphalt surface due to low temperatures or hardening of the asphalt, or (3) reflective cracking caused by cracks in an underlying concrete slab.
Oil Spillage	Deterioration or softening of the pavement surface caused by the spilling of oil, fuel, or other solvents.
Patching	N/A
Polished Aggregate	Repeated traffic applications.
Raveling	Asphalt binder may have hardened significantly, causing coarse aggregate pieces to dislodge.
Rutting	Usually caused by consolidation or lateral movement of the materials due to traffic loads.
Shoving	Where concrete pavements adjoin flexible pavements, concrete “growth” may shove the asphalt pavement.
Slippage Cracking	Low-strength surface mix or poor bond between the surface and the next layer of the pavement structure.
Swelling	Usually caused by frost action or by swelling soil.
Weathering	Asphalt binder and/or fine aggregate may wear away as the pavement ages and hardens.

Table A-2. Cause of pavement distress, concrete pavements (USACE 2009b).

Distress Type	Probable Cause of Distress
ASR	Chemical reaction of alkalis in the cement with certain reactive silica minerals. ASR may be accelerated by the use of chemical pavement deicers.
Blowup	Incompressible materials in the joints.
Corner Break	Load repetition combined with loss of support and curling stresses.
Durability Cracking	Concrete's inability to withstand environmental factors, such as freeze-thaw cycles.
Faulting	Upheaval or consolidation.
Joint Seal Damage	Stripping of joint sealant, extrusion of joint sealant, weed growth, hardening of the filler (oxidation), loss of bond to the slab edges, or absence of sealant in the joint.
LTD Cracking	Combination of load repetition, curling stresses, and shrinkage stresses.
Patching (Small and Large)	N/A
Popouts	Freeze-thaw action in combination with expansive aggregates.
Pumping	Poor drainage, poor joint sealant.
Scaling	Over finishing of concrete, deicing salts, improper construction, freeze-thaw cycles, and poor aggregate.
Shattered Slab	Load repetition.
Shrinkage Cracking	Setting and curing of the concrete.
Spalling (Joint and Corner)	Excessive stresses at the joint caused by infiltration of incompressible materials or traffic loads; weak concrete at the joint combined with traffic loads.

APPENDIX B

INSPECTION PHOTOGRAPHS

A01FC-01. Overview.



A01FC-01. Joint Seal Damage (Sample Unit No. 01).



A01FC-01. LTD Cracking (Sample Unit No. 10).



A01FC-02. Overview.



A01FC-02. Joint Spalling (Sample Unit No. 16).



A01FC-02. LTD Cracking (Sample Unit No. 16).



R09FC-01. Overview.



R09FC-01. L&T Cracking (Sample Unit No. 11).



R09FC-01. Weathering (Sample Unit No. 11).



R09FC-02. Overview.



R09FC-02. L&T Cracking (Sample Unit No. 08).



R09FC-02. Weathering (Sample Unit No. 08).



R09FC-03. Overview.



R09FC-03. L&T Cracking (Sample Unit No. 03).



R09FC-03. Weathering (Sample Unit No. 03).



R09FC-04. Overview.



R09FC-04. L&T Cracking (Sample Unit No. 04).



R09FC-04. Raveling (Sample Unit No. 04).



R15FC-01. Overview.



R15FC-01. L&T Cracking (Sample Unit No. 23).



R15FC-02. Overview.



R15FC-02. L&T Cracking (Sample Unit No. 047) (1).



R15FC-02. L&T Cracking (Sample Unit No. 047) (2).



R15FC-03. Overview.



R15FC-03. L&T Cracking (Sample Unit No. 01).



R15FC-03. Weathering (Sample Unit No. 01).



T01FC-01. Overview.



T01FC-01. L&T Cracking (Sample Unit No. 01).



T01FC-01. Weathering (Sample Unit No. 01).



T01FC-02. Overview.



T01FC-02. Depression (Sample Unit No. 01).



T01FC-02. L&T Cracking (Sample Unit No. 01).



T01FC-02. Raveling (Sample Unit No. 02).



T01FC-02. Weathering and Raveling (Sample Unit No. 01).



T02FC-01. Overview (1).



T02FC-01. Overview (2).



T02FC-01. Bleeding (Sample Unit No. 02) (1).



T02FC-01. Bleeding (Sample Unit No. 02) (2).



T02FC-01. Bleeding (Sample Unit No. 03) (1).



T02FC-01. Bleeding (Sample Unit No. 03) (2).



T02FC-01. Bleeding (Sample Unit No. 04).



T02FC-01. L&T Cracking (Sample Unit No. 02).



T02FC-02. Overview.



T02FC-02. L&T Cracking (Sample Unit No. 01).



T02FC-02. Weathering (Sample Unit No. 01).



T02FC-03. Overview.



T02FC-03. L&T Cracking (Sample Unit No. 01).



T02FC-03. Weathering and Raveling (Sample Unit No. 01).



TH01FC-01. Overview.



TH01FC-01. Joint Seal Damage (Sample Unit No. 01).



TH01FC-02. Overview.



TH01FC-02. Joint Seal Damage (Sample Unit No. 01).



TH01FC-02. Shattered Slab (Sample Unit No. 01).



TH01FC-03. Overview.



TH01FC-03. Alligator Cracking (Sample Unit No. 01).



TH01FC-03. Weathering (Sample Unit No. 01).



TH01FC-04. Overview.



APPENDIX C

INSPECTION REPORT

RE-INSPECTION REPORT

FOREST CITY MUNICIPAL AIRPORT/TRIMBLE FIELD

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: FXY

Page 1

Branch - Section ID: A01FC - 001

Branch Name: APRON 01

Use: APRON

LCD: 6/1/2007

PCI Family: IowaPCCAP_NCE_General

Surface Type: PCC

Rank: P

Section Area (sf): 25,521.00

Length (ft): 140.00

Width (ft): 160.00

From: HANGARS

To: TAXIWAY 01

Slabs: 255

Section Comments:

Slab Length (ft): 10.00

Slab Width (ft): 10.00

Joint Length (ft): 4,762.40

Last Insp Date: 2/26/2026

Inspection Comments:

PCI: 91

Total Samples: 11

Surveyed: 6

Sample Number: 01

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

Sample Number: 03

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

Sample Number: 05

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

Sample Number: 07

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 24.00

65 JT SEAL DMG

M

24.00 Slabs

Sample Number: 08

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 24.00

65 JT SEAL DMG

M

24.00 Slabs

RE-INSPECTION REPORT
FOREST CITY MUNICIPAL AIRPORT/TRIMBLE FIELD

Pavement Database: IA 2025
Network ID: FXY

Generate Date: 7/15/2026
Page 2

Sample Number: 10

Sample Type: R
Sample PCI: 73
Sample Area (Slabs): 15.00

Sample Comments:

63 LINEAR CR	M	1.00 Slabs
65 JT SEAL DMG	M	15.00 Slabs
74 JOINT SPALL	M	1.00 Slabs
75 CORNER SPALL	L	1.00 Slabs

RE-INSPECTION REPORT

FOREST CITY MUNICIPAL AIRPORT/TRIMBLE FIELD

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: FXY

Page 3

Branch - Section ID: A01FC - 002

Branch Name: APRON 01

Use: APRON

LCD: 6/3/2014

PCI Family: IowaPCCAP_NCE_General

Surface Type: PCC

Rank: P

Section Area (sf): 56,548.00

Length (ft): 230.00

Width (ft): 220.00

From: .

To: TAXIWAY 01

Slabs: 565

Section Comments:

Slab Length (ft): 10.00

Slab Width (ft): 10.00

Joint Length (ft): 10,806.70

Last Insp Date: 2/26/2026

Inspection Comments:

PCI: 87

Total Samples: 27

Surveyed: 7

Sample Number: 03

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

Sample Number: 06

Sample Type: R

Sample Comments:

Sample PCI: 78

Sample Area (Slabs): 20.00

63 LINEAR CR

L

2.00 Slabs

65 JT SEAL DMG

M

20.00 Slabs

74 JOINT SPALL

L

2.00 Slabs

74 JOINT SPALL

M

2.00 Slabs

Sample Number: 09

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

Sample Number: 13

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

Sample Number: 15

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

RE-INSPECTION REPORT

FOREST CITY MUNICIPAL AIRPORT/TRIMBLE FIELD

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: FXY

Page 4

Sample Number: 16

Sample Type: R

Sample Comments:

Sample PCI: 60

Sample Area (Slabs): 14.00

62 CORNER BREAK	L	1.00 Slabs
62 CORNER BREAK	M	1.00 Slabs
63 LINEAR CR	M	1.00 Slabs
65 JT SEAL DMG	M	14.00 Slabs
71 FAULTING	M	1.00 Slabs
74 JOINT SPALL	M	1.00 Slabs

Sample Number: 19

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 20.00

65 JT SEAL DMG	M	20.00 Slabs
----------------	---	-------------

RE-INSPECTION REPORT

FOREST CITY MUNICIPAL AIRPORT/TRIMBLE FIELD

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: FXY

Page 5

Branch - Section ID: R09FC - 001

Branch Name: RUNWAY 09/27

Use: RUNWAY

LCD: 6/1/2004

PCI Family: IowaAACRW_NE&NCE

Surface Type: AAC

Rank: S

Section Area (sf): 59,477.00

Length (ft): 1,048.00

Width (ft): 60.00

From: RUNWAY END 09

To: RUNWAY SECT 02

Slabs:

Section Comments:

Slab Length (ft):

Slab Width (ft):

Joint Length (ft):

Last Insp Date: 2/26/2026

Inspection Comments:

PCI: 54

Total Samples: 11

Surveyed: 5

Sample Number: 001

Sample Type: R

Sample Comments:

Sample PCI: 51

Sample Area (SF): 6,000.00

48 L & T CR	H	65.00 FT	3in
48 L & T CR	L	70.00 FT	lu
48 L & T CR	M	328.00 FT	fs w
52 RAVELING	H	5.00 SF	
52 RAVELING	L	450.00 SF	
57 WEATHERING	L	5,995.00 SF	

Sample Number: 003

Sample Type: R

Sample Comments:

Sample PCI: 54

Sample Area (SF): 6,000.00

48 L & T CR	H	24.00 FT	3in 2ndy
48 L & T CR	L	127.00 FT	lu
48 L & T CR	M	347.00 FT	fs w
52 RAVELING	L	500.00 SF	
57 WEATHERING	L	6,000.00 SF	

Sample Number: 006

Sample Type: R

Sample Comments:

Sample PCI: 55

Sample Area (SF): 6,000.00

48 L & T CR	H	46.00 FT	3in 1ft
48 L & T CR	L	39.00 FT	lu
48 L & T CR	M	404.00 FT	fs w
52 RAVELING	L	500.00 SF	
57 WEATHERING	L	6,000.00 SF	

RE-INSPECTION REPORT
FOREST CITY MUNICIPAL AIRPORT/TRIMBLE FIELD

Sample Number: 009

Sample Type: R	Sample Comments:		
Sample PCI: 53			
Sample Area (SF): 4,800.00			
48 L & T CR	H	76.00 FT	3in 1ft
48 L & T CR	L	58.00 FT	lu
48 L & T CR	M	303.00 FT	fs w
52 RAVELING	L	500.00 SF	
57 WEATHERING	L	4,800.00 SF	

Sample Number: 011

Sample Type: R	Sample Comments:		
Sample PCI: 56			
Sample Area (SF): 5,040.00			
48 L & T CR	H	71.00 FT	3in 1ft
48 L & T CR	L	31.00 FT	lu
48 L & T CR	M	300.00 FT	fs w
52 RAVELING	L	500.00 SF	
57 WEATHERING	L	5,040.00 SF	

RE-INSPECTION REPORT

FOREST CITY MUNICIPAL AIRPORT/TRIMBLE FIELD

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: FXY

Page 7

Branch - Section ID: R09FC - 002

Branch Name: RUNWAY 09/27

Use: RUNWAY

LCD: 6/1/2004

PCI Family: IowaAACRW_NE&NCE

Surface Type: AAC

Rank: S

Section Area (sf): 57,466.00

Length (ft): 964.00

Width (ft): 60.00

From: RUNWAY SECT 01

To: SEE MAP

Slabs:

Section Comments:

Slab Length (ft):

Slab Width (ft):

Joint Length (ft):

Last Insp Date: 2/26/2026

Inspection Comments:

PCI: 57

Total Samples: 10

Surveyed: 5

Sample Number: 001

Sample Type: R

Sample Comments:

Sample PCI: 53

Sample Area (SF): 6,000.00

48 L & T CR	H	65.00 FT	3in 2ndy 1ft
48 L & T CR	L	74.00 FT	lu
48 L & T CR	M	546.00 FT	fs w
57 WEATHERING	L	6,000.00 SF	

Sample Number: 003

Sample Type: R

Sample Comments:

Sample PCI: 57

Sample Area (SF): 7,476.00

48 L & T CR	H	52.00 FT	2ndy 3in 1ft
48 L & T CR	L	142.00 FT	lu
48 L & T CR	M	476.00 FT	fs w
57 WEATHERING	L	7,476.00 SF	

Sample Number: 005

Sample Type: R

Sample Comments:

Sample PCI: 59

Sample Area (SF): 6,000.00

48 L & T CR	H	32.00 FT	1ft 3in 2nd
48 L & T CR	L	96.00 FT	lu
48 L & T CR	M	361.00 FT	fs w
57 WEATHERING	L	6,000.00 SF	

Sample Number: 007

Sample Type: R

Sample Comments:

Sample PCI: 60

Sample Area (SF): 6,000.00

48 L & T CR	H	62.00 FT	3in 2ndy
48 L & T CR	L	146.00 FT	lu
48 L & T CR	M	289.00 FT	fs w
57 WEATHERING	L	6,000.00 SF	

RE-INSPECTION REPORT
FOREST CITY MUNICIPAL AIRPORT/TRIMBLE FIELD

Sample Number: 008

Sample Type: R	Sample Comments:		
Sample PCI: 54			
Sample Area (SF): 6,000.00			
48 L & T CR	H	21.00 FT	3in 1ft
48 L & T CR	L	140.00 FT	lu
48 L & T CR	M	452.00 FT	fs w
57 WEATHERING	L	6,000.00 SF	

RE-INSPECTION REPORT

FOREST CITY MUNICIPAL AIRPORT/TRIMBLE FIELD

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: FXY

Page 9

Branch - Section ID: R09FC - 003

Branch Name: RUNWAY 09/27

Use: RUNWAY

LCD: 6/1/2004

PCI Family: IowaAACRW_NE&NCE

Surface Type: AAC

Rank: S

Section Area (sf): 21,667.00

Length (ft): 372.00

Width (ft): 60.00

From: SEE MAP

To: RUNWAY END 27

Slabs:

Section Comments:

Slab Length (ft):

Slab Width (ft):

Joint Length (ft):

Last Insp Date: 2/26/2026

Inspection Comments:

PCI: 64

Total Samples: 4

Surveyed: 3

Sample Number: 002

Sample Type: R

Sample Comments:

Sample PCI: 60

Sample Area (SF): 6,000.00

41 ALLIGATOR CR

M

5.00 SF

48 L & T CR

H

60.00 FT

2ndy 3in

48 L & T CR

L

43.00 FT

lu

48 L & T CR

M

247.00 FT

fs w

57 WEATHERING

L

6,000.00 SF

Sample Number: 003

Sample Type: R

Sample Comments:

Sample PCI: 62

Sample Area (SF): 6,000.00

41 ALLIGATOR CR

M

10.00 SF

48 L & T CR

H

45.00 FT

3in 2ndy

48 L & T CR

L

25.00 FT

lu

48 L & T CR

M

251.00 FT

fs w

57 WEATHERING

L

6,000.00 SF

Sample Number: 004

Sample Type: R

Sample Comments:

Sample PCI: 69

Sample Area (SF): 6,000.00

48 L & T CR

H

34.00 FT

3in 2ndy

48 L & T CR

L

24.00 FT

lu

48 L & T CR

M

204.00 FT

fs w

57 WEATHERING

L

6,000.00 SF

RE-INSPECTION REPORT

FOREST CITY MUNICIPAL AIRPORT/TRIMBLE FIELD

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: FXY

Page 10

Branch - Section ID: R09FC - 004

Branch Name: RUNWAY 09/27

Use: RUNWAY

LCD: 6/1/2007

PCI Family: IowaAACRW_NE&NCE

Surface Type: AAC

Rank: S

Section Area (sf): 13,202.00

Length (ft): 190.00

Width (ft): 60.00

From: .

To: .

Slabs:

Section Comments:

Slab Length (ft):

Slab Width (ft):

Joint Length (ft):

Last Insp Date: 2/26/2026

Inspection Comments:

PCI: 67

Total Samples: 4

Surveyed: 3

Sample Number: 01

Sample Type: R

Sample Comments:

Sample PCI: 70

Sample Area (SF): 3,543.00

48 L & T CR

H

8.00 FT

2ndy 3in

48 L & T CR

M

60.00 FT

fs w

57 WEATHERING

M

3,543.00 SF

Sample Number: 02

Sample Type: R

Sample Comments:

Sample PCI: 70

Sample Area (SF): 4,933.00

48 L & T CR

H

14.00 FT

2ndy 3 in

48 L & T CR

L

7.00 FT

lu

48 L & T CR

M

115.00 FT

fs w

57 WEATHERING

M

4,933.00 SF

Sample Number: 04

Sample Type: R

Sample Comments:

Sample PCI: 58

Sample Area (SF): 3,300.00

48 L & T CR

L

37.00 FT

lu

48 L & T CR

M

81.00 FT

fs w

52 RAVELING

L

3,300.00 SF

57 WEATHERING

M

3,300.00 SF

RE-INSPECTION REPORT

FOREST CITY MUNICIPAL AIRPORT/TRIMBLE FIELD

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: FXY

Page 11

Branch - Section ID: R15FC - 001

Branch Name: RUNWAY 15/33

Use: RUNWAY

LCD: 10/2/2024

PCI Family: IowaAACRW_NE&NCE

Surface Type: AAC

Rank: P

Section Area (sf): 327,248.00

Length (ft): 3,300.00

Width (ft): 100.00

From: RUNWAY END 15

To: RUNWAY SECT 02

Slabs:

Section Comments:

Slab Length (ft):

Slab Width (ft):

Joint Length (ft):

Last Insp Date: 2/26/2026

Inspection Comments:

PCI: 85

Total Samples: 66

Surveyed: 7

Sample Number: 005

Sample Type: R

Sample Comments:

Sample PCI: 87

Sample Area (SF): 5,000.00

48 L & T CR

L

74.00 FT

lu

48 L & T CR

M

22.00 FT

w

Sample Number: 014

Sample Type: R

Sample Comments:

Sample PCI: 87

Sample Area (SF): 5,000.00

48 L & T CR

L

50.00 FT

lu

48 L & T CR

M

24.00 FT

w

Sample Number: 023

Sample Type: R

Sample Comments:

Sample PCI: 86

Sample Area (SF): 5,000.00

48 L & T CR

L

123.00 FT

lu

48 L & T CR

M

20.00 FT

w

Sample Number: 032

Sample Type: R

Sample Comments:

Sample PCI: 84

Sample Area (SF): 5,000.00

48 L & T CR

L

128.00 FT

lu

48 L & T CR

M

51.00 FT

w

Sample Number: 041

Sample Type: R

Sample Comments:

Sample PCI: 84

Sample Area (SF): 5,000.00

48 L & T CR

L

101.00 FT

lu

48 L & T CR

M

48.00 FT

w

RE-INSPECTION REPORT
FOREST CITY MUNICIPAL AIRPORT/TRIMBLE FIELD

Pavement Database: IA 2025
Network ID: FXY

Generate Date: 7/15/2026
Page 12

Sample Number: 050

Sample Type: R	Sample Comments:		
Sample PCI: 79			
Sample Area (SF): 5,000.00			
48 L & T CR	L	81.00 FT	lu
48 L & T CR	M	100.00 FT	w

Sample Number: 059

Sample Type: R	Sample Comments:		
Sample PCI: 88			
Sample Area (SF): 5,000.00			
48 L & T CR	L	4.00 FT	lu
48 L & T CR	M	51.00 FT	w

RE-INSPECTION REPORT

FOREST CITY MUNICIPAL AIRPORT/TRIMBLE FIELD

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: FXY

Page 13

Branch - Section ID: R15FC - 002

Branch Name: RUNWAY 15/33

Use: RUNWAY

LCD: 10/2/2024

PCI Family: IowaAACRW_NE&NCE

Surface Type: AAC

Rank: P

Section Area (sf): 262,494.00

Length (ft): 2,498.00

Width (ft): 100.00

From: RUNWAY SECT 01

To: RUNWAY END 33

Slabs:

Section Comments:

Slab Length (ft):

Slab Width (ft):

Joint Length (ft):

Last Insp Date: 2/26/2026

Inspection Comments:

PCI: 89

Total Samples: 54

Surveyed: 7

Sample Number: 004

Sample Type: R

Sample Comments:

Sample PCI: 89

Sample Area (SF): 5,000.00

48 L & T CR

L

15.00 FT

lu

48 L & T CR

M

36.00 FT

w

Sample Number: 011

Sample Type: R

Sample Comments:

Sample PCI: 89

Sample Area (SF): 5,000.00

48 L & T CR

L

24.00 FT

lu

48 L & T CR

M

28.00 FT

w

Sample Number: 020

Sample Type: R

Sample Comments:

Sample PCI: 89

Sample Area (SF): 5,000.00

48 L & T CR

L

11.00 FT

lu

48 L & T CR

M

40.00 FT

w

Sample Number: 021

Sample Type: R

Sample Comments:

Sample PCI: 88

Sample Area (SF): 5,000.00

48 L & T CR

L

12.00 FT

lu

48 L & T CR

M

49.00 FT

w

Sample Number: 029

Sample Type: R

Sample Comments:

Sample PCI: 98

Sample Area (SF): 5,000.00

48 L & T CR

L

5.00 FT

lu

RE-INSPECTION REPORT
FOREST CITY MUNICIPAL AIRPORT/TRIMBLE FIELD

Pavement Database: IA 2025
Network ID: FXY

Generate Date: 7/15/2026
Page 14

Sample Number: 038

Sample Type: R	Sample Comments:		
Sample PCI: 84			
Sample Area (SF): 5,000.00			
48 L & T CR	L	32.00 FT	lu
48 L & T CR	M	71.00 FT	w

Sample Number: 047

Sample Type: R	Sample Comments:		
Sample PCI: 85			
Sample Area (SF): 5,000.00			
48 L & T CR	L	46.00 FT	lu
48 L & T CR	M	45.00 FT	

RE-INSPECTION REPORT

FOREST CITY MUNICIPAL AIRPORT/TRIMBLE FIELD

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: FXY

Page 15

Branch - Section ID: R15FC - 003

Branch Name: RUNWAY 15/33

Use: RUNWAY

LCD: 8/1/2007

PCI Family: IowaAACRW_NE&NCE

Surface Type: AAC

Rank: P

Section Area (sf): 7,689.00

Length (ft): 79.00

Width (ft): 79.00

From: SEE MAP

To: SEE MAP

Slabs:

Section Comments:

Slab Length (ft):

Slab Width (ft):

Joint Length (ft):

Last Insp Date: 2/26/2026

Inspection Comments:

PCI: 63

Total Samples: 2

Surveyed: 2

Sample Number: 01

Sample Type: R

Sample Comments:

Sample PCI: 63

Sample Area (SF): 3,839.00

48 L & T CR

L

51.00 FT

lu

48 L & T CR

M

19.00 FT

w

52 RAVELING

L

3,839.00 SF

57 WEATHERING

M

3,839.00 SF

Sample Number: 02

Sample Type: R

Sample Comments:

Sample PCI: 64

Sample Area (SF): 3,850.00

48 L & T CR

L

32.00 FT

lu

48 L & T CR

M

12.00 FT

w

52 RAVELING

L

3,850.00 SF

57 WEATHERING

M

3,850.00 SF

RE-INSPECTION REPORT

FOREST CITY MUNICIPAL AIRPORT/TRIMBLE FIELD

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: FXY

Page 16

Branch - Section ID: T01FC - 001

Branch Name: TAXIWAY 01

Use: TAXIWAY

LCD: 6/1/2012

PCI Family: IowaAACTW_NCE

Surface Type: AAC

Rank: P

Section Area (sf): 9,807.00

Length (ft): 150.00

Width (ft): 60.00

From: APRON 01 SECTS 01, 02, 03

To: TAXIWAY 02

Slabs:

Section Comments:

Slab Length (ft):

Slab Width (ft):

Joint Length (ft):

Last Insp Date: 2/26/2026

Inspection Comments:

PCI: 60

Total Samples: 2

Surveyed: 2

Sample Number: 01

Sample Type: R

Sample Comments:

Sample PCI: 59

Sample Area (SF): 4,404.00

48 L & T CR

L

27.00 FT

lu

48 L & T CR

M

70.00 FT

w

52 RAVELING

M

1,000.00 SF

57 WEATHERING

M

4,404.00 SF

Sample Number: 02

Sample Type: R

Sample Comments:

Sample PCI: 60

Sample Area (SF): 5,403.00

48 L & T CR

L

36.00 FT

lu

48 L & T CR

M

109.00 FT

w

52 RAVELING

M

1,000.00 SF

57 WEATHERING

M

5,403.00 SF

RE-INSPECTION REPORT

FOREST CITY MUNICIPAL AIRPORT/TRIMBLE FIELD

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: FXY

Page 17

Branch - Section ID: T01FC - 002

Branch Name: TAXIWAY 01

Use: TAXIWAY

LCD: 11/1/2004

PCI Family: IowaACTW_NCE

Surface Type: AC

Rank: P

Section Area (sf): 11,766.00

Length (ft): 430.00

Width (ft): 25.00

From: .

To: .

Slabs:

Section Comments:

Slab Length (ft):

Slab Width (ft):

Joint Length (ft):

Last Insp Date: 2/26/2026

Inspection Comments:

PCI: 40

Total Samples: 2

Surveyed: 2

Sample Number: 01

Sample Type: R

Sample Comments:

Sample PCI: 48

Sample Area (SF): 4,705.00

41 ALLIGATOR CR	L	28.00 SF	edge
45 DEPRESSION	L	12.00 SF	
48 L & T CR	H	21.00 FT	2ndy
48 L & T CR	L	36.00 FT	lu
48 L & T CR	M	162.00 FT	w
52 RAVELING	H	1.00 SF	
52 RAVELING	L	2,500.00 SF	
57 WEATHERING	M	4,704.00 SF	

Sample Number: 02

Sample Type: R

Sample Comments:

Sample PCI: 35

Sample Area (SF): 7,061.00

41 ALLIGATOR CR	M	15.00 SF	edge
41 ALLIGATOR CR	M	18.00 SF	
45 DEPRESSION	M	1.00 SF	
48 L & T CR	H	14.00 FT	3in
48 L & T CR	L	60.00 FT	lu
48 L & T CR	M	154.00 FT	w
50 PATCHING	L	1,350.00 SF	
52 RAVELING	H	100.00 SF	
52 RAVELING	L	2,500.00 SF	
57 WEATHERING	M	5,611.00 SF	

RE-INSPECTION REPORT

FOREST CITY MUNICIPAL AIRPORT/TRIMBLE FIELD

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: FXY

Page 18

Branch - Section ID: T02FC - 001

Branch Name: TAXIWAY 02

Use: TAXIWAY

LCD: 7/1/1985

PCI Family: IowaACTW_NCE

Surface Type: AC

Rank: P

Section Area (sf): 19,122.00

Length (ft): 470.00

Width (ft): 40.00

From: T02FC-03

To: RUNWAY 09/27

Slabs:

Section Comments:

Slab Length (ft):

Slab Width (ft):

Joint Length (ft):

Last Insp Date: 2/26/2026

Inspection Comments:

PCI: 40

Total Samples: 4

Surveyed: 3

Sample Number: 02

Sample Type: R

Sample Comments:

Sample PCI: 31

Sample Area (SF): 4,800.00

41 ALLIGATOR CR	M	5.00 SF	
42 BLEEDING	N	900.00 SF	
48 L & T CR	L	162.00 FT	lu
48 L & T CR	M	136.00 FT	w
52 RAVELING	L	3,840.00 SF	
57 WEATHERING	M	3,840.00 SF	

Sample Number: 03

Sample Type: R

Sample Comments:

Sample PCI: 42

Sample Area (SF): 4,800.00

42 BLEEDING	N	480.00 SF	
48 L & T CR	H	10.00 FT	1ft
48 L & T CR	L	44.00 FT	lu
48 L & T CR	M	62.00 FT	w
52 RAVELING	L	4,320.00 SF	
57 WEATHERING	M	4,320.00 SF	

Sample Number: 04

Sample Type: R

Sample Comments:

Sample PCI: 47

Sample Area (SF): 4,800.00

42 BLEEDING	N	240.00 SF	
48 L & T CR	L	42.00 FT	lu
48 L & T CR	M	232.00 FT	w
50 PATCHING	L	9.00 SF	
52 RAVELING	L	4,401.00 SF	
57 WEATHERING	M	4,401.00 SF	

RE-INSPECTION REPORT

FOREST CITY MUNICIPAL AIRPORT/TRIMBLE FIELD

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: FXY

Page 19

Branch - Section ID: T02FC - 002

Branch Name: TAXIWAY 02

Use: TAXIWAY

LCD: 6/1/2012

PCI Family: IowaAACTW_NCE

Surface Type: AAC

Rank: P

Section Area (sf): 6,532.00

Length (ft): 80.00

Width (ft): 70.00

From: T02FC-03

To: RW15

Slabs:

Section Comments:

Slab Length (ft):

Slab Width (ft):

Joint Length (ft):

Last Insp Date: 2/26/2026

Inspection Comments:

PCI: 65

Total Samples: 1

Surveyed: 1

Sample Number: 01

Sample Type: R

Sample Comments:

Sample PCI: 64

Sample Area (SF): 6,532.00

48 L & T CR

H

15.00 FT

3in

48 L & T CR

L

95.00 FT

ls

48 L & T CR

L

26.00 FT

lu

48 L & T CR

M

128.00 FT

w

52 RAVELING

L

1,500.00 SF

57 WEATHERING

L

6,532.00 SF

RE-INSPECTION REPORT

FOREST CITY MUNICIPAL AIRPORT/TRIMBLE FIELD

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: FXY

Page 20

Branch - Section ID: T02FC - 003

Branch Name: TAXIWAY 02

Use: TAXIWAY

LCD: 6/1/2012

PCI Family: IowaAACTW_NCE

Surface Type: AAC

Rank: P

Section Area (sf): 27,616.00

Length (ft): 570.00

Width (ft): 40.00

From: T02FC-02

To: T02FC-01

Slabs:

Section Comments:

Slab Length (ft):

Slab Width (ft):

Joint Length (ft):

Last Insp Date: 2/26/2026

Inspection Comments:

PCI: 72

Total Samples: 6

Surveyed: 4

Sample Number: 01

Sample Type: R

Sample Comments:

Sample PCI: 75

Sample Area (SF): 4,800.00

48 L & T CR	L	22.00 FT	lu
48 L & T CR	M	68.00 FT	w
52 RAVELING	L	1,000.00 SF	
57 WEATHERING	L	4,800.00 SF	

Sample Number: 02

Sample Type: R

Sample Comments:

Sample PCI: 68

Sample Area (SF): 4,800.00

48 L & T CR	L	98.00 FT	lu
48 L & T CR	M	113.00 FT	w
52 RAVELING	L	1,000.00 SF	
57 WEATHERING	L	4,800.00 SF	

Sample Number: 03

Sample Type: R

Sample Comments:

Sample PCI: 74

Sample Area (SF): 4,800.00

48 L & T CR	L	45.00 FT	lu
48 L & T CR	M	58.00 FT	w
52 RAVELING	L	1,000.00 SF	
57 WEATHERING	L	4,800.00 SF	

Sample Number: 06

Sample Type: R

Sample Comments:

Sample PCI: 70

Sample Area (SF): 6,000.00

48 L & T CR	L	111.00 FT	ls
48 L & T CR	L	10.00 FT	lu
48 L & T CR	M	12.00 FT	w
52 RAVELING	L	1,000.00 SF	
57 WEATHERING	L	5,760.00 SF	
57 WEATHERING	M	240.00 SF	pr

RE-INSPECTION REPORT

FOREST CITY MUNICIPAL AIRPORT/TRIMBLE FIELD

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: FXY

Page 21

Branch - Section ID: TH01FC - 001

Branch Name: T-HANGAR 01

Use: T-HANGAR

LCD: 6/1/2006

PCI Family: IowaPCCTH_NCE&NE

Surface Type: PCC

Rank: P

Section Area (sf): 4,229.00

Length (ft): 100.00

Width (ft): 35.00

From: SEE MAP

To: SEE MAP

Slabs: 45

Section Comments: avg

Slab Length (ft): 10.00

Slab Width (ft): 9.50

Joint Length (ft): 704.94

Last Insp Date: 2/26/2026

Inspection Comments:

PCI: 88

Total Samples: 3

Surveyed: 3

Sample Number: 01

Sample Type: R

Sample Comments:

Sample PCI: 88

Sample Area (Slabs): 11.00

65 JT SEAL DMG

H

11.00 Slabs

Sample Number: 02

Sample Type: R

Sample Comments:

Sample PCI: 88

Sample Area (Slabs): 20.00

65 JT SEAL DMG

H

20.00 Slabs

Sample Number: 03

Sample Type: R

Sample Comments:

Sample PCI: 88

Sample Area (Slabs): 14.00

65 JT SEAL DMG

H

14.00 Slabs

RE-INSPECTION REPORT

FOREST CITY MUNICIPAL AIRPORT/TRIMBLE FIELD

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: FXY

Page 22

Branch - Section ID: TH01FC - 002

Branch Name: T-HANGAR 01

Use: T-HANGAR

LCD: 1/1/1991

PCI Family: IowaPCCTH_NCE&NE

Surface Type: PCC

Rank: P

Section Area (sf): 8,516.00

Length (ft): 116.00

Width (ft): 77.00

From: SEE MAP

To: SEE MAP

Slabs: 27

Section Comments: avg

Slab Length (ft): 19.25

Slab Width (ft): 16.50

Joint Length (ft): 965.25

Last Insp Date: 2/26/2026

Inspection Comments:

PCI: 41

Total Samples: 2

Surveyed: 2

Sample Number: 01

Sample Type: R

Sample Comments:

Sample PCI: 41

Sample Area (Slabs): 15.00

63 LINEAR CR	M	1.00 Slabs
65 JT SEAL DMG	H	14.00 Slabs
72 SHAT. SLAB	L	3.00 Slabs
72 SHAT. SLAB	M	2.00 Slabs

Sample Number: 02

Sample Type: R

Sample Comments:

Sample PCI: 41

Sample Area (Slabs): 12.00

63 LINEAR CR	L	3.00 Slabs
63 LINEAR CR	M	5.00 Slabs
65 JT SEAL DMG	H	12.00 Slabs
73 SHRINKAGE CR	N	2.00 Slabs
74 JOINT SPALL	M	1.00 Slabs

RE-INSPECTION REPORT
FOREST CITY MUNICIPAL AIRPORT/TRIMBLE FIELD

Branch - Section ID: TH01FC - 003

Branch Name: T-HANGAR 01

Use: T-HANGAR

LCD: 1/1/1994

Surface Type: AC

Rank: P

Section Area (sf): 2,646.00

Length (ft): 132.00

Width (ft): 20.00

From: SEE MAP

To: SEE MAP

Slabs:

Slab Length (ft):

Slab Width (ft):

Joint Length (ft):

Last Insp Date: 2/26/2026

PCI: 41

Total Samples: 1

Surveyed: 1

PCI Family: IowaAsphaltTH_Northern

Section Comments:

Inspection Comments:

Sample Number: 01

Sample Type: R

Sample PCI: 41

Sample Area (SF): 2,646.00

Sample Comments:

41 ALLIGATOR CR	M	100.00 SF	
48 L & T CR	L	67.00 FT	lu
48 L & T CR	M	132.00 FT	fs w
57 WEATHERING	M	2,646.00 SF	

RE-INSPECTION REPORT

FOREST CITY MUNICIPAL AIRPORT/TRIMBLE FIELD

Pavement Database: IA 2025

Generate Date: 7/15/2026

Network ID: FXY

Page 24

Branch - Section ID: TH01FC - 004

Branch Name: T-HANGAR 01

Use: T-HANGAR

LCD: 8/3/2025

PCI Family: IowaPCCTH_NCE&NE

Surface Type: PCC

Rank: P

Section Area (sf): 33,109.00

Length (ft): 1,262.00

Width (ft): 25.00

From: SEE MAP

To: SEE MAP

Slabs: 212

Section Comments:

Slab Length (ft): 12.50

Slab Width (ft): 12.50

Joint Length (ft): 5,300.00

Last Insp Date: 2/26/2026

Inspection Comments:

PCI: 100

Total Samples: 13

Surveyed: 6

Sample Number: 02

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 20.00

NO DISTRESS

Sample Number: 04

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 19.00

NO DISTRESS

Sample Number: 06

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 20.00

NO DISTRESS

Sample Number: 07

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 20.00

NO DISTRESS

Sample Number: 10

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 20.00

NO DISTRESS

Sample Number: 11

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 25.00

NO DISTRESS

APPENDIX D

WORK HISTORY REPORT

WORK HISTORY

Pavement Database: IA 2025

Generate Date: 6/29/2026

Network ID: FXY

Page 1

Network: FOREST CITY MUNICIPAL AIRPORT/TRIMBLE FIELD

Branch - Section ID: A01FC - 001

LCD: 6/1/2007

Use: APRON

Rank: P

Surface: PCC

Length (ft): 140.00

Width (ft): 160.00

True Area (sf): 25,521.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-01-2007	CR-PC	Complete Reconstruction - PCC	-	-	True	-
06-01-1974	NC-PC	New Construction - PCC	-	-	True	-

Branch - Section ID: A01FC - 002

LCD: 6/3/2014

Use: APRON

Rank: P

Surface: PCC

Length (ft): 230.00

Width (ft): 220.00

True Area (sf): 56,548.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-03-2014	CR-PC	Complete Reconstruction - PCC	-	6.00	True	6" P501
06-02-2014	SB-AG	Subbase - Aggregate	-	6.00	False	6" AGG BASE
06-01-2014	SG-CO	Subgrade - Compacted	-	6.00	False	SUBGRADE
03-19-1998	CR-PC	Complete Reconstruction - PCC	-	-	True	-
08-01-1974	NC-AC	New Construction - AC	-	-	True	-

Branch - Section ID: R09FC - 001

LCD: 6/1/2004

Use: RUNWAY

Rank: S

Surface: AAC

Length (ft): 1,048.00

Width (ft): 60.00

True Area (sf): 59,477.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-01-2012	CS-AC	Crack Sealing - AC	-	-	False	-
06-01-2004	OL-AS	Overlay - AC Structural	-	2.25	True	2.25" P-401 Overlay-PRE OVERLAY REPAIRS
06-02-1974	NC-AC	New Construction - AC	-	1.00	True	1" P-401 AC
06-01-1974	BA-BI	Base Course - Bituminous	-	5.00	False	5" P-201 Bit Base

Branch - Section ID: R09FC - 002

LCD: 6/1/2004

Use: RUNWAY

Rank: S

Surface: AAC

Length (ft): 964.00

Width (ft): 60.00

True Area (sf): 57,466.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-01-2012	CS-AC	Crack Sealing - AC	-	-	False	-
06-01-2004	OL-AS	Overlay - AC Structural	-	2.25	True	2.25" P-401 Overlay -PRE OVERLAY REPAIRS
06-02-1974	NC-AC	New Construction - AC	-	4.00	True	4" P-401 AC
06-01-1974	BA-BI	Base Course - Bituminous	-	5.00	False	5" P-201 Bit Base

WORK HISTORY

Pavement Database: IA 2025

Generate Date: 6/29/2026

Network ID: FXY

Page 2

Branch - Section ID: R09FC - 003

LCD: 6/1/2004
Use: RUNWAY
Rank: S
Surface: AAC

Length (ft): 372.00
Width (ft): 60.00
True Area (sf): 21,667.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-01-2012	CS-AC	Crack Sealing - AC	-	-	False	-
06-01-2004	OL-AS	Overlay - AC Structural	-	2.25	True	2.25" P-401 Overlay -PRE OVERLAY REPAIRS
06-02-1974	NC-AC	New Construction - AC	-	1.00	True	1" P-401
06-01-1974	BA-BI	Base Course - Bituminous	-	5.00	False	5" P-201 Bit Base

Branch - Section ID: R09FC - 004

LCD: 6/1/2007
Use: RUNWAY
Rank: S
Surface: AAC

Length (ft): 190.00
Width (ft): 60.00
True Area (sf): 13,202.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-01-2018	PA-AS	Patching - AC Shallow	-	-	False	AC SHALLOW PATCHING
06-01-2012	CS-AC	Crack Sealing - AC	-	-	False	CRACK SEAL
06-01-2007	OL-AS	Overlay - AC Structural	-	-	True	AC OVERLAY
06-01-2004	OL-AS	Overlay - AC Structural	-	2.25	True	2.25" P-401 Overlay -PRE OVERLAY REPAIRS
06-02-1974	NC-AC	New Construction - AC	-	1.00	True	1" P-401
06-01-1974	BA-BI	Base Course - Bituminous	-	5.00	False	5" P-201 Bit Base

Branch - Section ID: R15FC - 001

LCD: 10/2/2024
Use: RUNWAY
Rank: P
Surface: AAC

Length (ft): 3,300.00
Width (ft): 100.00
True Area (sf): 327,248.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
10-02-2024	OL-AC	Overlay - AC	-	3.00	True	3" (2 LIFTS) P-401 ASPHALT SURFACE AND LEVELING/BASE COURSE
10-01-2024	MI-CO	Cold Milling	-	-	False	1"-6" VARIABLE MILLING
06-01-2017	CS-AC	Crack Sealing - AC	-	-	False	-
06-01-2017	PA-AS	Patching - AC Shallow	-	-	False	Wide Transverse Cracks
06-01-2012	CS-AC	Crack Sealing - AC	-	-	False	-
08-01-2007	OL-AS	Overlay - AC Structural	-	-	True	-
06-01-1974	OL-AC	Overlay - AC	-	3.00	True	3" P-401 AC Overlay
06-02-1969	NC-AC	New Construction - AC	-	1.50	True	1.5" P-401 AC
06-01-1969	BA-BI	Base Course - Bituminous	-	5.00	False	5" P-201 Bit. Base

WORK HISTORY

Pavement Database: IA 2025

Generate Date: 6/29/2026

Network ID: FXY

Page 3

Branch - Section ID: R15FC - 002

LCD: 10/2/2024
Use: RUNWAY
Rank: P
Surface: AAC

Length (ft): 2,498.00
Width (ft): 100.00
True Area (sf): 262,494.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
10-02-2024	OL-AC	Overlay - AC	-	3.00	True	3" (2 LIFTS) P401 ASPHALT SURFACE AND LEVELING/BASE COURSE
10-01-2024	MI-CO	Cold Milling	-	-	False	1"-6" VARIABLE MILLING
06-01-2017	CS-AC	Crack Sealing - AC	-	-	False	-
06-01-2017	PA-AS	Patching - AC Shallow	-	-	False	Wide Transverse Cracks
06-01-2012	CS-AC	Crack Sealing - AC	-	-	False	-
08-01-2007	OL-AS	Overlay - AC Structural	-	-	True	-
06-02-1974	NC-AC	New Construction - AC	-	4.00	True	4" P-401 AC
06-01-1974	BA-BI	Base Course - Bituminous	-	4.00	False	4" P-201 Bit Base

Branch - Section ID: R15FC - 003

LCD: 8/1/2007
Use: RUNWAY
Rank: P
Surface: AAC

Length (ft): 79.00
Width (ft): 79.00
True Area (sf): 7,689.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-01-2017	CS-AC	Crack Sealing - AC	-	-	False	-
06-01-2017	PA-AS	Patching - AC Shallow	-	-	False	Wide Transverse Cracks
06-01-2012	CS-AC	Crack Sealing - AC	-	-	False	-
08-01-2007	OL-AS	Overlay - AC Structural	-	-	True	-
06-02-1974	NC-AC	New Construction - AC	-	4.00	True	4" P-401 AC
06-01-1974	BA-BI	Base Course - Bituminous	-	4.00	False	4" P-201 Bit Base

Branch - Section ID: T01FC - 001

LCD: 6/1/2012
Use: TAXIWAY
Rank: P
Surface: AAC

Length (ft): 150.00
Width (ft): 60.00
True Area (sf): 9,807.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-01-2012	OL-AS	Overlay - AC Structural	-	2.00	True	1" MILL; 2" AC OVERLAY W/0.5" LEVELING COURSE
10-01-1996	OL-AS	Overlay - AC Structural	-	2.00	True	-
08-01-1985	NC-AC	New Construction - AC	-	-	True	-

Branch - Section ID: T01FC - 002

LCD: 11/1/2004
Use: TAXIWAY
Rank: P
Surface: AC

Length (ft): 430.00
Width (ft): 25.00
True Area (sf): 11,766.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
11-01-2004	NC-AC	New Construction - AC	-	-	True	DATE PROVIDED BY AIRPORT

WORK HISTORY

Pavement Database: IA 2025

Generate Date: 6/29/2026

Network ID: FXY

Page 4

Branch - Section ID: T02FC - 001

LCD: 7/1/1985
Use: TAXIWAY
Rank: P
Surface: AC

Length (ft): 470.00
Width (ft): 40.00
True Area (sf): 19,122.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-01-2018	PA-AS	Patching - AC Shallow	-	-	False	-
07-01-1985	NC-AC	New Construction - AC	-	-	True	-

Branch - Section ID: T02FC - 002

LCD: 6/1/2012
Use: TAXIWAY
Rank: P
Surface: AAC

Length (ft): 80.00
Width (ft): 70.00
True Area (sf): 6,532.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-01-2025	CS-AC	Crack Sealing - AC	-	-	False	Field estimate
06-01-2012	OL-AS	Overlay - AC Structural	-	2.00	True	1" MILL; 2" AC OVERLAY W/0.5" LEVELING COURSE
06-01-2007	OL-AS	Overlay - AC Structural	-	-	True	-
08-01-1985	NC-AC	New Construction - AC	-	-	True	-

Branch - Section ID: T02FC - 003

LCD: 6/1/2012
Use: TAXIWAY
Rank: P
Surface: AAC

Length (ft): 570.00
Width (ft): 40.00
True Area (sf): 27,616.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-01-2012	OL-AS	Overlay - AC Structural	-	2.00	True	1" MILL; 2" AC OVERLAY W/0.5" LEVELING COURSE
07-01-1985	NC-AC	New Construction - AC	-	-	True	-

Branch - Section ID: TH01FC - 001

LCD: 6/1/2006
Use: T-HANGAR
Rank: P
Surface: PCC

Length (ft): 100.00
Width (ft): 35.00
True Area (sf): 4,229.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-01-2006	NC-IN	New Construction - Initial	-	-	True	ESTIMATED

Branch - Section ID: TH01FC - 002

LCD: 1/1/1991
Use: T-HANGAR
Rank: P
Surface: PCC

Length (ft): 116.00
Width (ft): 77.00
True Area (sf): 8,516.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-01-2011	SL-PC	Slab Replacement - PCC	-	-	False	EXPENDED FEW SLABS
01-01-1991	NC-IN	New Construction - Initial	-	-	True	PRE 1994 (BACKCALCULATED)

WORK HISTORY

Pavement Database: IA 2025
Network ID: FXY

Generate Date: 6/29/2026
Page 5

Branch - Section ID: TH01FC - 003

LCD: 1/1/1994
Use: T-HANGAR
Rank: P
Surface: AC

Length (ft): 132.00
Width (ft): 20.00
True Area (sf): 2,646.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
01-01-1994	NC-IN	New Construction - Initial	-	-	True	PRE 1994

Branch - Section ID: TH01FC - 004

LCD: 8/3/2025
Use: T-HANGAR
Rank: P
Surface: PCC

Length (ft): 1,262.00
Width (ft): 25.00
True Area (sf): 33,109.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
08-03-2025	CR-PC	Complete Reconstruction - PCC	-	6.00	True	6" IDOT PCC
08-02-2025	SB-AG	Subbase - Aggregate	-	6.00	False	6" MODIFIED SUBBASE
08-01-2025	SG-CO	Subgrade - Compacted	-	6.00	False	6" SUBGRADE PREPARATION
01-01-2012	NC-IN	New Construction - Initial	-	-	True	ESTIMATED

APPENDIX E

LOCALIZED PREVENTIVE MAINTENANCE POLICIES AND UNIT COST TABLES

Table E-1. Localized preventive maintenance policy, asphalt-surfaced pavements.

Distress Type	Severity Level	Maintenance Action
Alligator Cracking	Low	Monitor
Alligator Cracking	Medium	Asphalt Patch
Alligator Cracking	High	Asphalt Patch
Bleeding	N/A	Monitor
Block Cracking	Low	Monitor
Block Cracking	Medium	Crack Seal—Asphalt
Block Cracking	High	Crack Seal—Asphalt
Corrugation	Low	Monitor
Corrugation	Medium	Asphalt Patch
Corrugation	High	Asphalt Patch
Depression	Low	Monitor
Depression	Medium	Monitor
Depression	High	Asphalt Patch
Jet-Blast Erosion	N/A	Asphalt Patch
Joint Reflection Cracking	Low	Monitor
Joint Reflection Cracking	Medium	Crack Seal—Asphalt
Joint Reflection Cracking	High	Crack Seal—Asphalt
L&T Cracking	Low	Monitor
L&T Cracking	Medium	Crack Seal—Asphalt
L&T Cracking	High	Crack Seal—Asphalt
Oil Spillage	N/A	Asphalt Patch
Patching	Low	Monitor
Patching	Medium	Asphalt Patch
Patching	High	Asphalt Patch
Polished Aggregate	N/A	Monitor
Raveling	Low	Monitor
Raveling	Medium	Asphalt Patch
Raveling	High	Asphalt Patch
Rutting	Low	Monitor
Rutting	Medium	Monitor
Rutting	High	Asphalt Patch
Shoving	Low	Monitor
Shoving	Medium	Asphalt Patch
Shoving	High	Asphalt Patch
Slippage Cracking	N/A	Asphalt Patch
Swelling	Low	Monitor
Swelling	Medium	Monitor
Swelling	High	Asphalt Patch
Weathering	Low	Monitor
Weathering	Medium	Monitor
Weathering	High	Asphalt Patch

Table E-2. Localized preventive maintenance policy, concrete pavements.

Distress Type	Severity Level	Maintenance Action
ASR	Low	Monitor
ASR	Medium	Slab Replacement
ASR	High	Slab Replacement
Blowup	Low	Slab Replacement
Blowup	Medium	Slab Replacement
Blowup	High	Slab Replacement
Corner Break	Low	Crack Seal—Concrete
Corner Break	Medium	Full-Depth Concrete Patch
Corner Break	High	Full-Depth Concrete Patch
Durability Cracking	Low	Monitor
Durability Cracking	Medium	Full-Depth Concrete Patch
Durability Cracking	High	Slab Replacement
Faulting	Low	Monitor
Faulting	Medium	Grinding
Faulting	High	Slab Replacement
Joint Seal Damage	Low	Monitor
Joint Seal Damage	Medium	Joint Seal
Joint Seal Damage	High	Joint Seal
LTD Cracking	Low	Monitor
LTD Cracking	Medium	Crack Seal—Concrete
LTD Cracking	High	Slab Replacement
Patching (Small and Large)	Low	Monitor
Patching (Small and Large)	Medium	Full-Depth Concrete Patch
Patching (Small and Large)	High	Full-Depth Concrete Patch
Popouts	N/A	Monitor
Pumping	N/A	Monitor
Scaling	Low	Monitor
Scaling	Medium	Partial-Depth Concrete Patch
Scaling	High	Slab Replacement
Shattered Slab	Low	Crack Seal—Concrete
Shattered Slab	Medium	Slab Replacement
Shattered Slab	High	Slab Replacement
Shrinkage Cracking	N/A	Monitor
Spalling (Joint and Corner)	Low	Monitor
Spalling (Joint and Corner)	Medium	Partial-Depth Concrete Patch
Spalling (Joint and Corner)	High	Partial-Depth Concrete Patch

Table E-3. 2026 unit costs for localized preventive maintenance actions.

Maintenance Action	Unit Cost
Asphalt Patch—Asphalt-Surfaced Pavement	\$16.27/sf
Crack Sealing—Asphalt-Surfaced Pavement	\$2.78/lf
Partial-Depth Concrete Patch—Concrete Pavement	\$41.68/sf
Full-Depth Concrete Patch—Concrete Pavement	\$18.61/sf
Crack Sealing—Concrete Pavement	\$3.35/lf
Joint Sealing—Concrete Pavement	\$3.35/lf
Grinding—Concrete Pavement	\$0.40/sf
Slab Replacement—Concrete Pavement	\$18.61/sf

Table note: The unit cost estimates are based on broad statewide numbers and should be adjusted to reflect local costs.

Table E-4. 2026 unit costs (per square foot) based on pavement type and PCI ranges.

Pavement Type	PCI Range 0–40	PCI Range 40–50	PCI Range 50–60	PCI Range 60–70	PCI Range 70–80	PCI Range 80–90	PCI Range 90–100
Asphalt-Surfaced	\$11.55	\$5.46	\$5.46	\$5.46	\$0.00	\$0.00	\$0.00
Concrete	\$19.30	\$9.13	\$9.13	\$9.13	\$0.00	\$0.00	\$0.00

Table notes:

1. The unit cost estimates are based on broad statewide numbers and should be adjusted to reflect local costs.
2. Pavement type: asphalt-surfaced = AC (asphalt cement concrete), AAC (asphalt overlay on AC), or APC (asphalt overlay on concrete).

APPENDIX F

YEAR 2026 LOCALIZED PREVENTIVE MAINTENANCE DETAILS

Table F-1. Year 2026 localized preventive maintenance details.

Branch	Section	Distress Type	Severity	Distress Quantity	Distress Unit	Maintenance Action	Unit Cost	2026 Estimated Cost
A01FC	01	Joint Seal Damage	Medium	255	Slabs	Joint Seal (Localized)	\$3.35	\$15,954
A01FC	01	Joint Spalling	Medium	2	Slabs	Patching - PCC Partial Depth	\$41.68	\$558
A01FC	01	LTD Cracking	Medium	2	Slabs	Crack Sealing - PCC	\$3.35	\$69
A01FC	02	Corner Break	Low	4	Slabs	Crack Sealing - PCC	\$3.35	\$116
A01FC	02	Corner Break	Medium	4	Slabs	Patching - PCC Full Depth	\$18.61	\$2,534
A01FC	02	Faulting	Medium	4	Slabs	Grinding (Localized)	\$0.40	\$17
A01FC	02	Joint Seal Damage	Medium	565	Slabs	Joint Seal (Localized)	\$3.35	\$36,202
A01FC	02	Joint Spalling	Medium	13	Slabs	Patching - PCC Partial Depth	\$41.68	\$3,405
A01FC	02	LTD Cracking	Medium	4	Slabs	Crack Sealing - PCC	\$3.35	\$141
R15FC	01	L&T Cracking	Medium	2,955	Ft	Crack Sealing - AC	\$2.78	\$8,214
R15FC	02	L&T Cracking	Medium	2,017	Ft	Crack Sealing - AC	\$2.78	\$5,609
T02FC	03	L&T Cracking	Medium	340	Ft	Crack Sealing - AC	\$2.78	\$945
TH01FC	01	Joint Seal Damage	High	45	Slabs	Joint Seal (Localized)	\$3.35	\$2,362

Table notes:

1. See Figure 3 for the location of the branch and section.
2. Distress types are defined by ASTM D5340. L&T cracking = longitudinal and transverse cracking; LTD cracking = longitudinal, transverse, and diagonal cracking; ASR = alkali-silica reaction.
3. The costs provided are of a general nature for the entire State and may require adjustments to reflect specific conditions at Forest City Municipal Airport/Trimble Field.



PREPARED FOR

Iowa Department of Transportation
Modal Transportation Bureau
800 Lincoln Way
Ames, Iowa 50010
515-239-1691
<https://iowadot.gov/modes-travel/aviation>

AUGUST 2026